



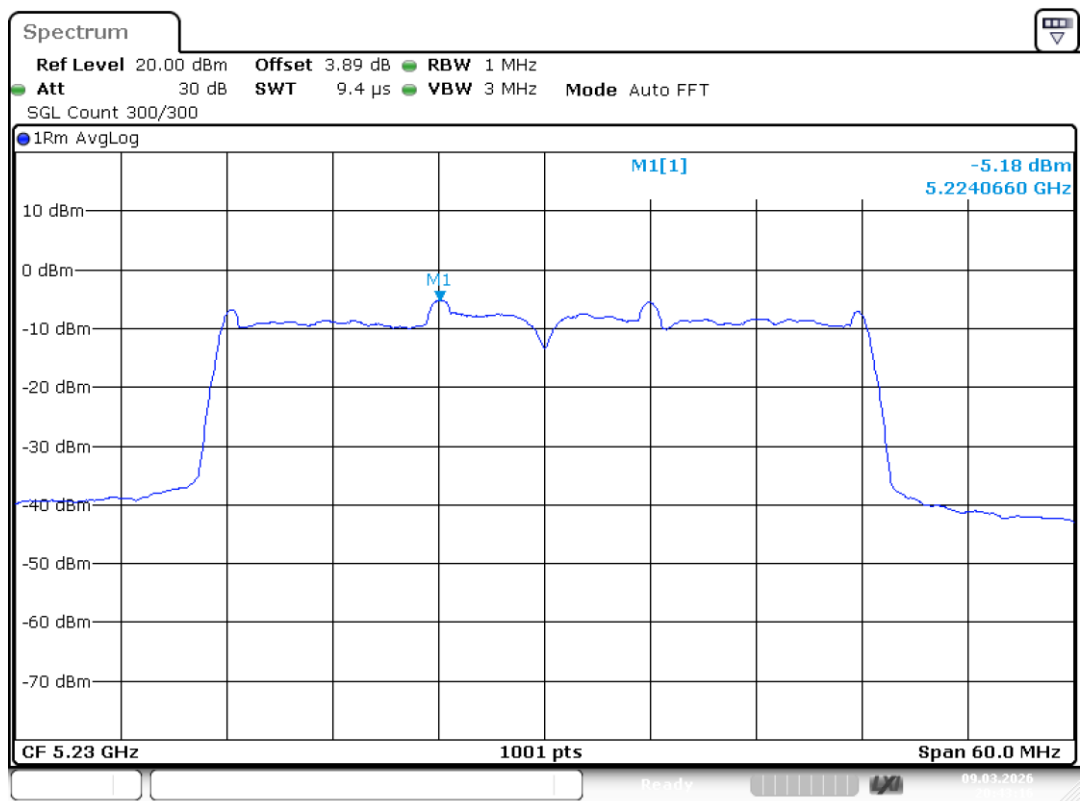


Date: 9.MAR.2026 20:43:17

PSD NVNT ac40 5230MHz Ant1

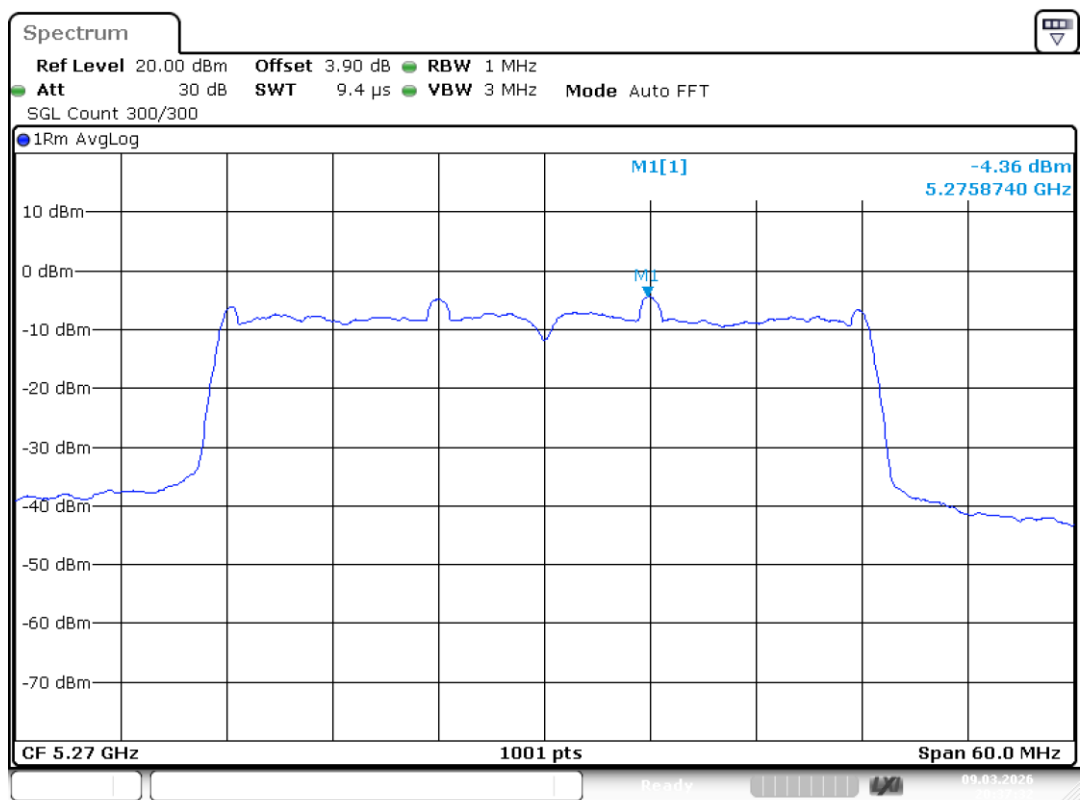


Date: 9.MAR.2026 20:37:32

PSD NVNT ac40 5270MHz Ant1

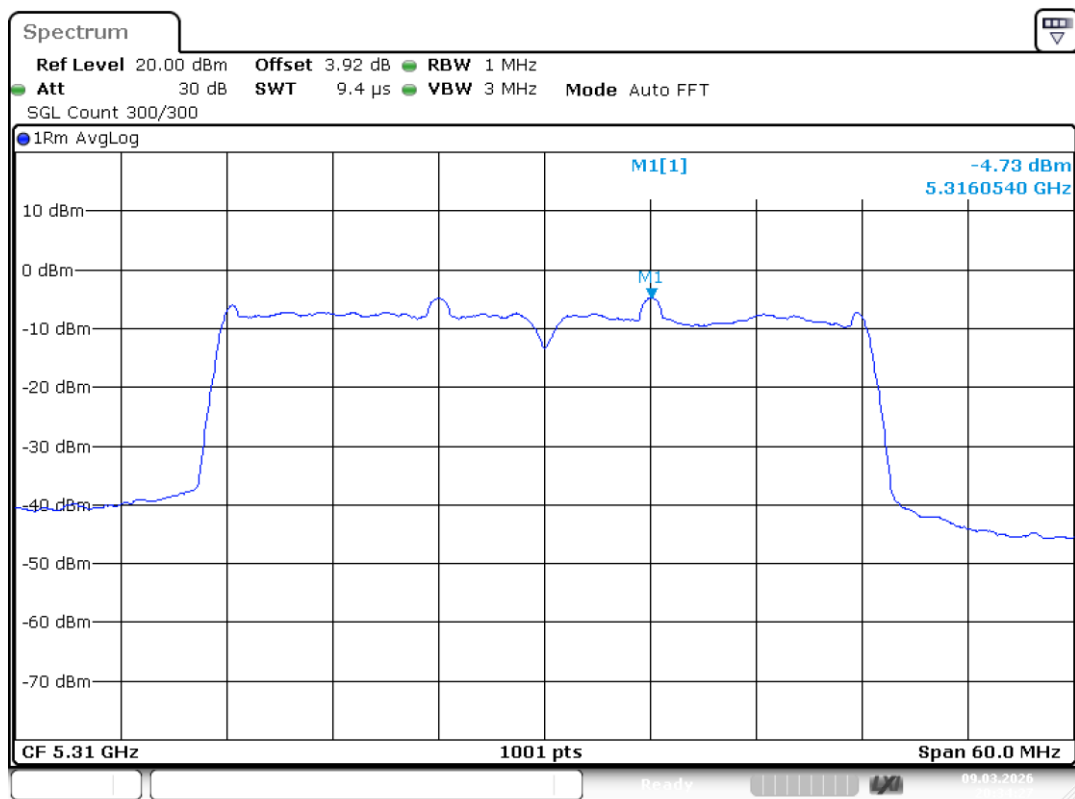


Date: 9.MAR.2026 20:34:27

PSD NVNT ac40 5310MHz Ant1

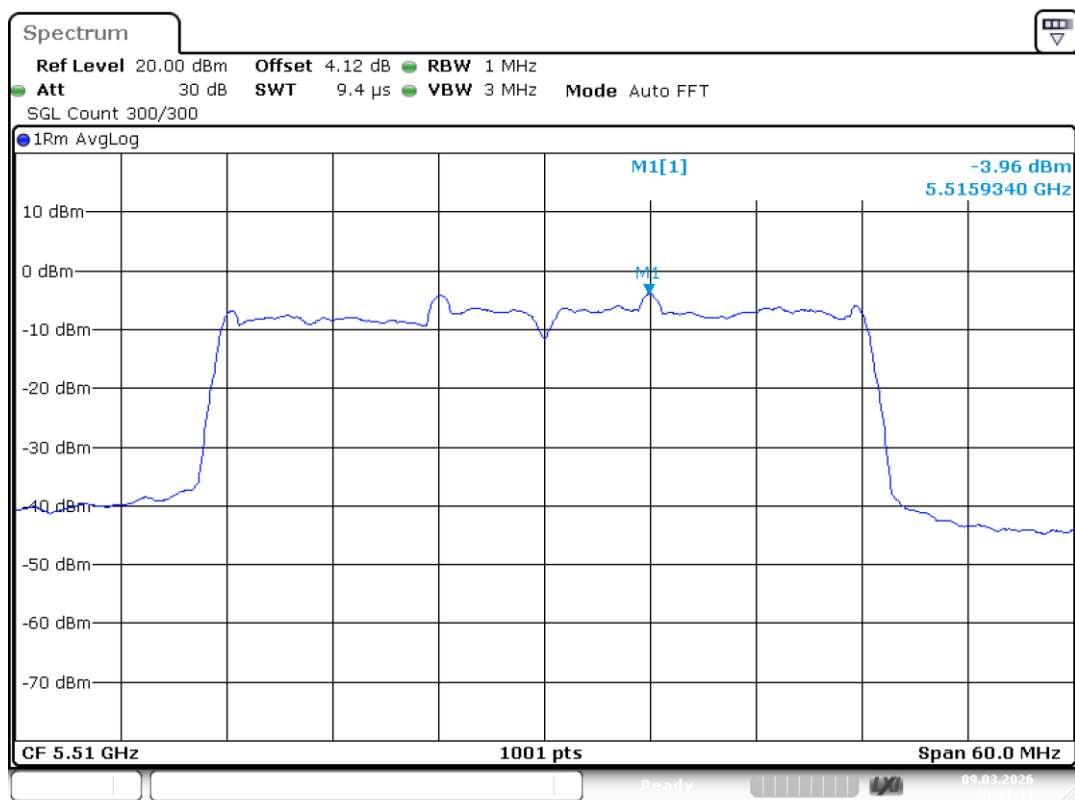


Date: 9.MAR.2026 20:31:33

PSD NVNT ac40 5510MHz Ant1

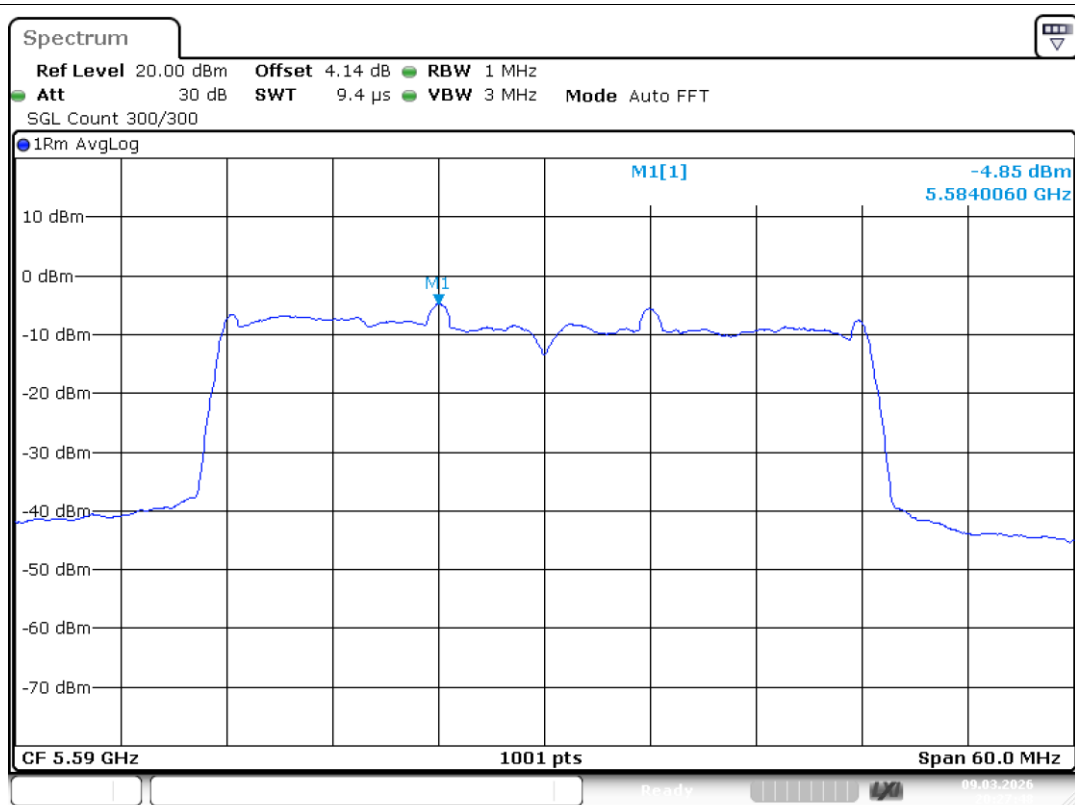


Date: 9.MAR.2026 20:27:49

PSD NVNT ac40 5590MHz Ant1

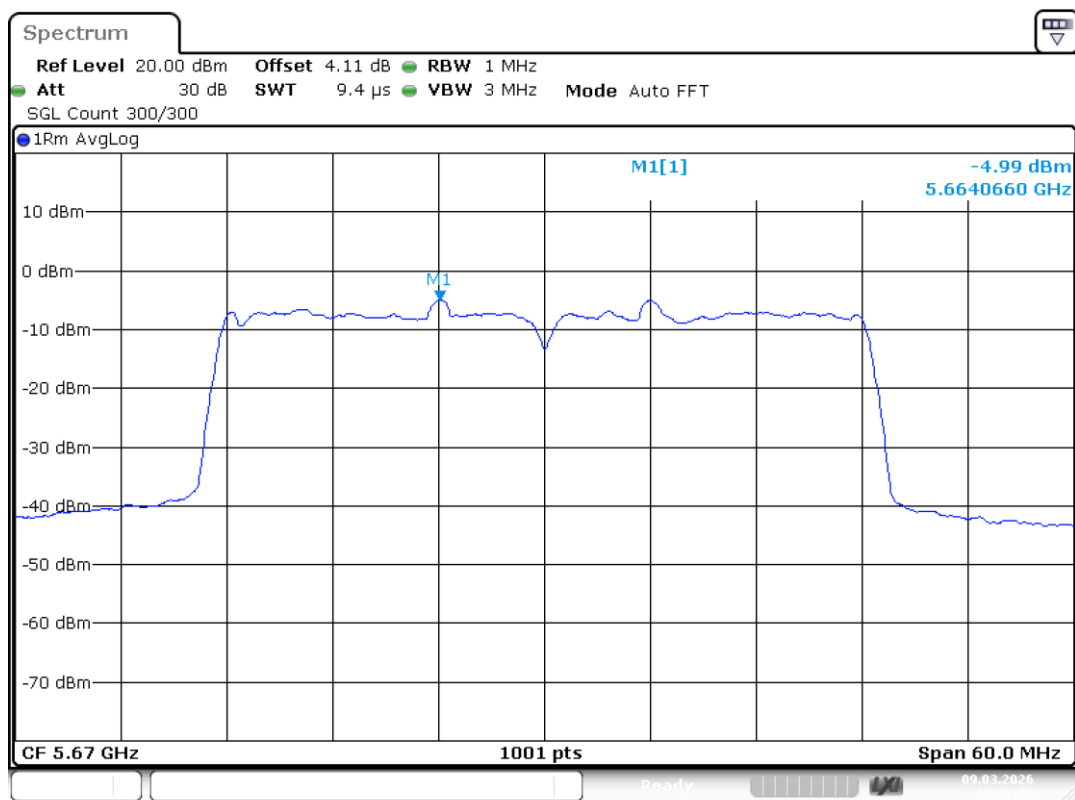


Date: 9.MAR.2026 20:25:09

PSD NVNT ac40 5670MHz Ant1

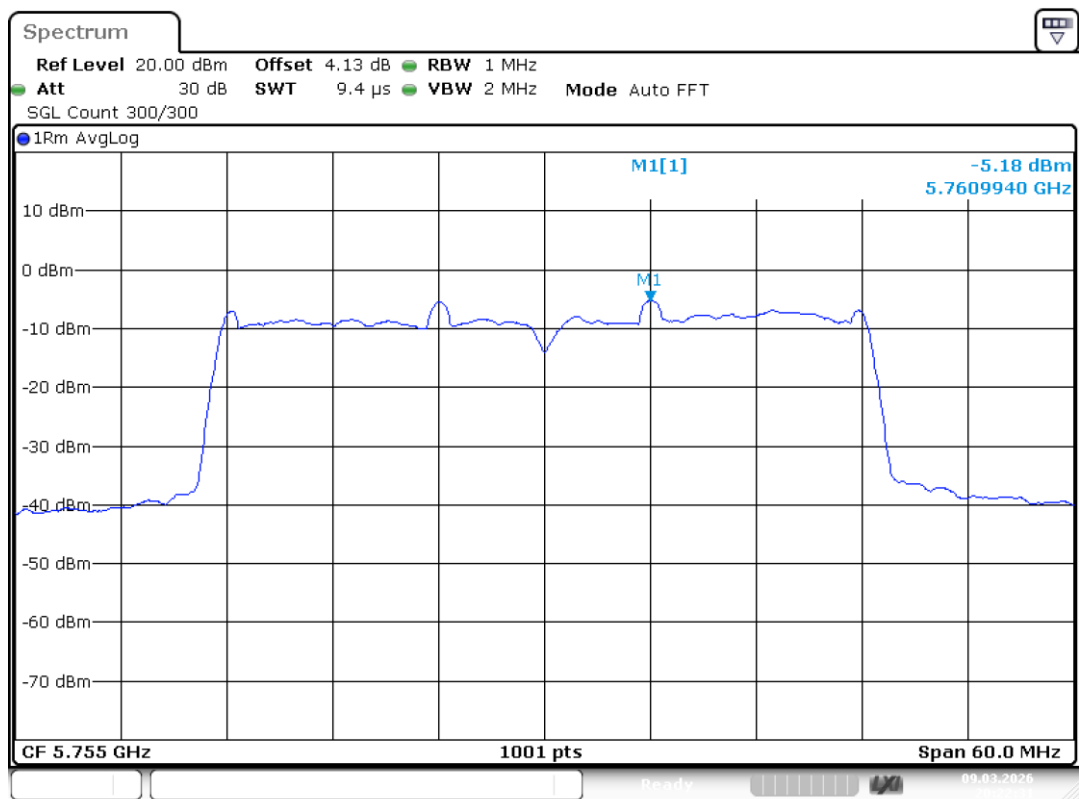


Date: 9.MAR.2026 20:22:31

PSD NVNT ac40 5755MHz Ant1

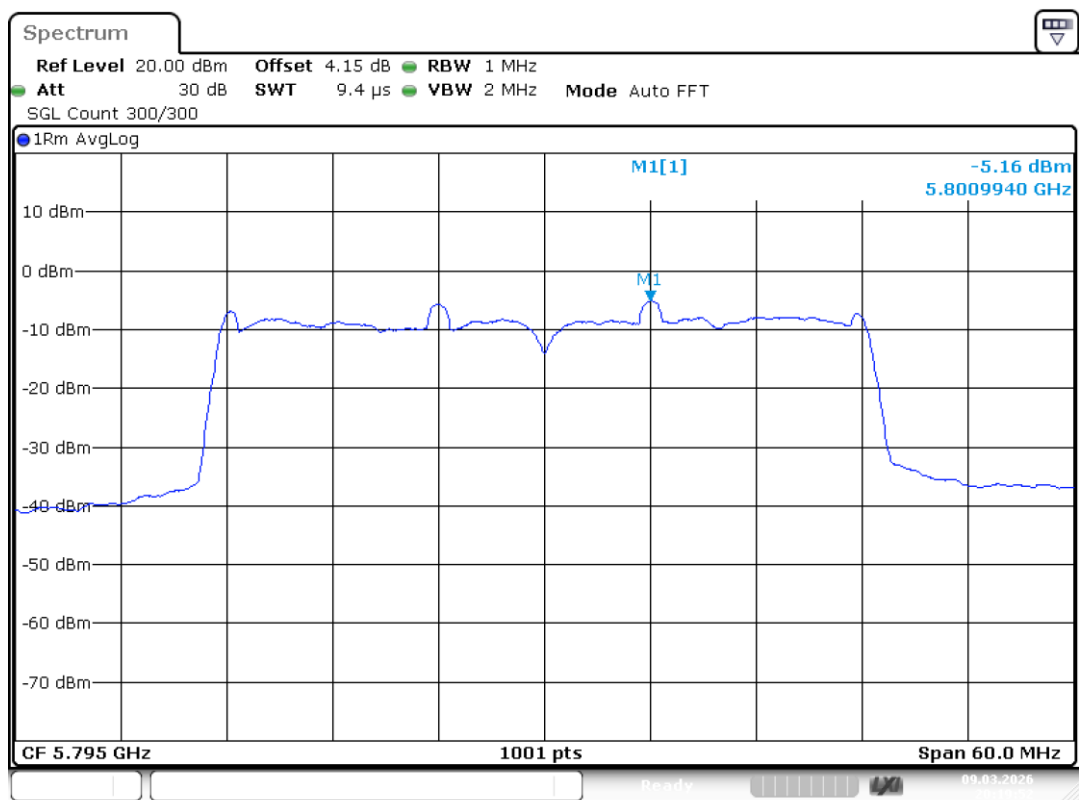


Date: 9.MAR.2026 20:19:53

PSD NVNT ac40 5795MHz Ant1

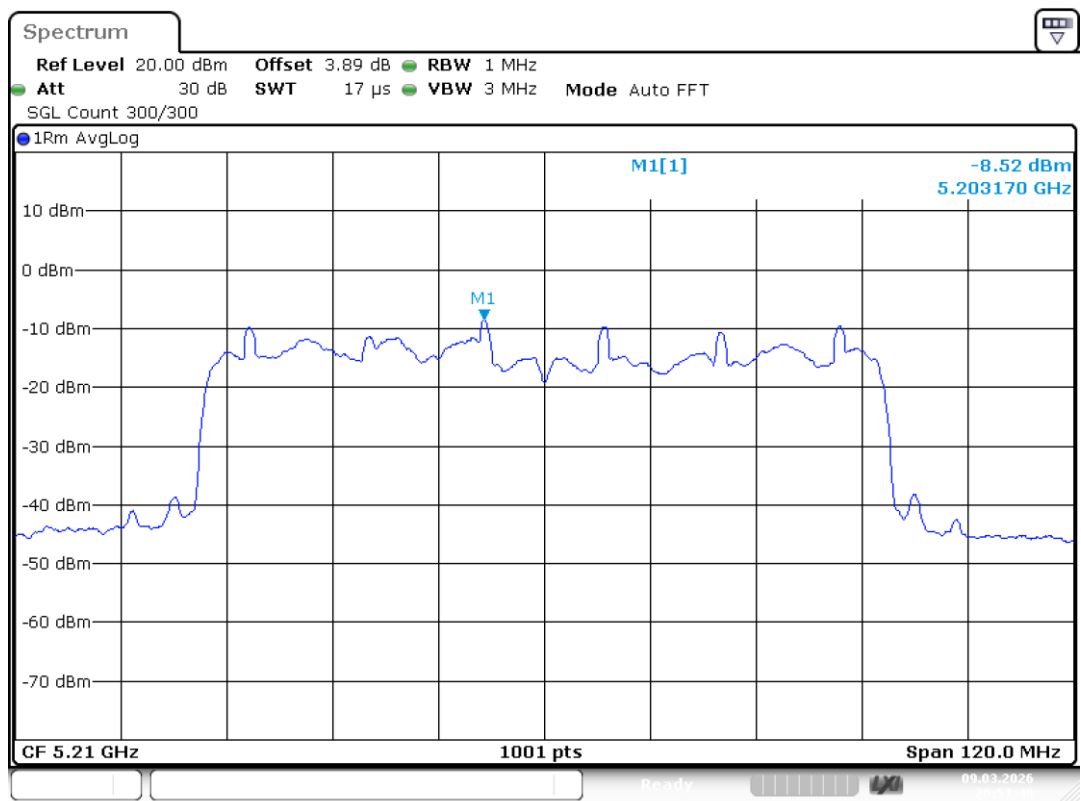


Date: 9.MAR.2026 20:51:40

PSD NVNT ac80 5210MHz Ant1

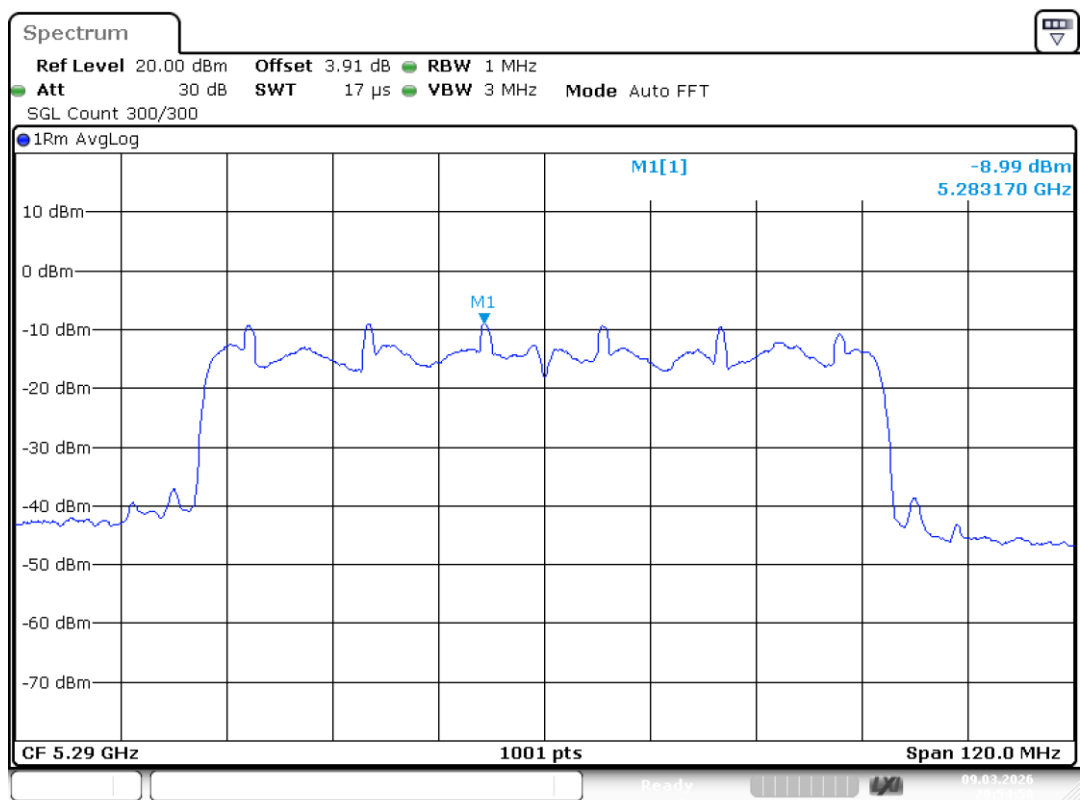


Date: 9.MAR.2026 20:54:58

PSD NVNT ac80 5290MHz Ant1

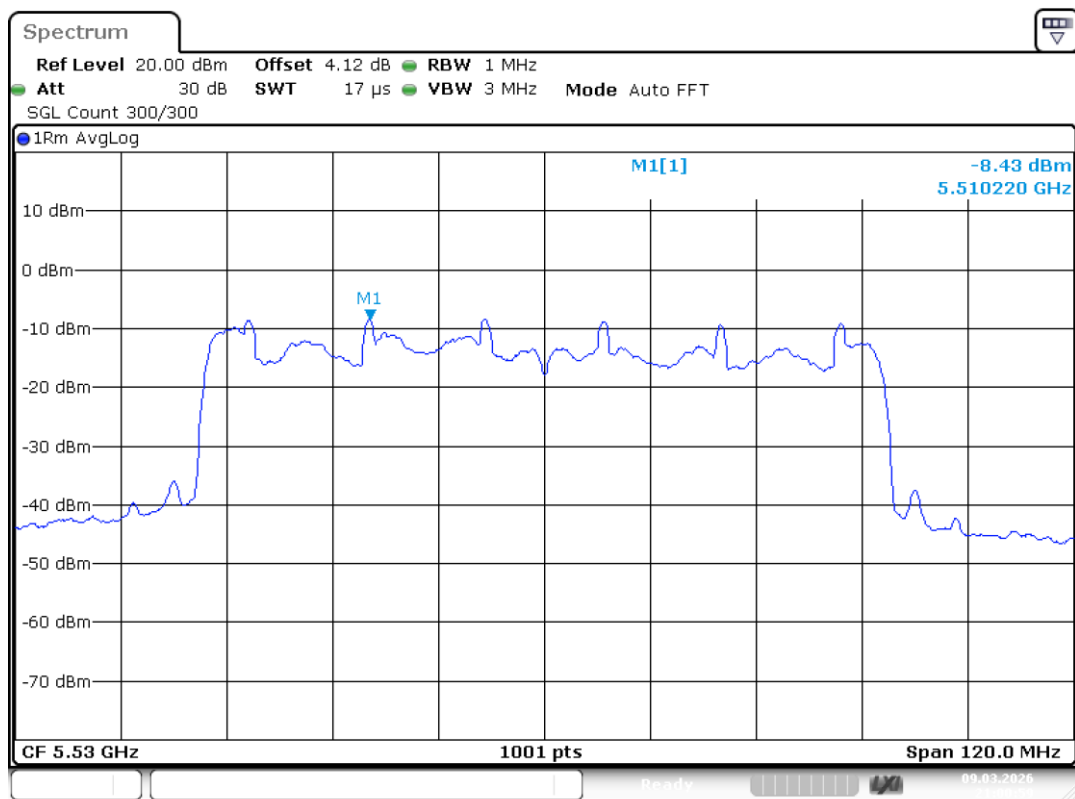


Date: 9.MAR.2026 21:00:59

PSD NVNT ac80 5530MHz Ant1

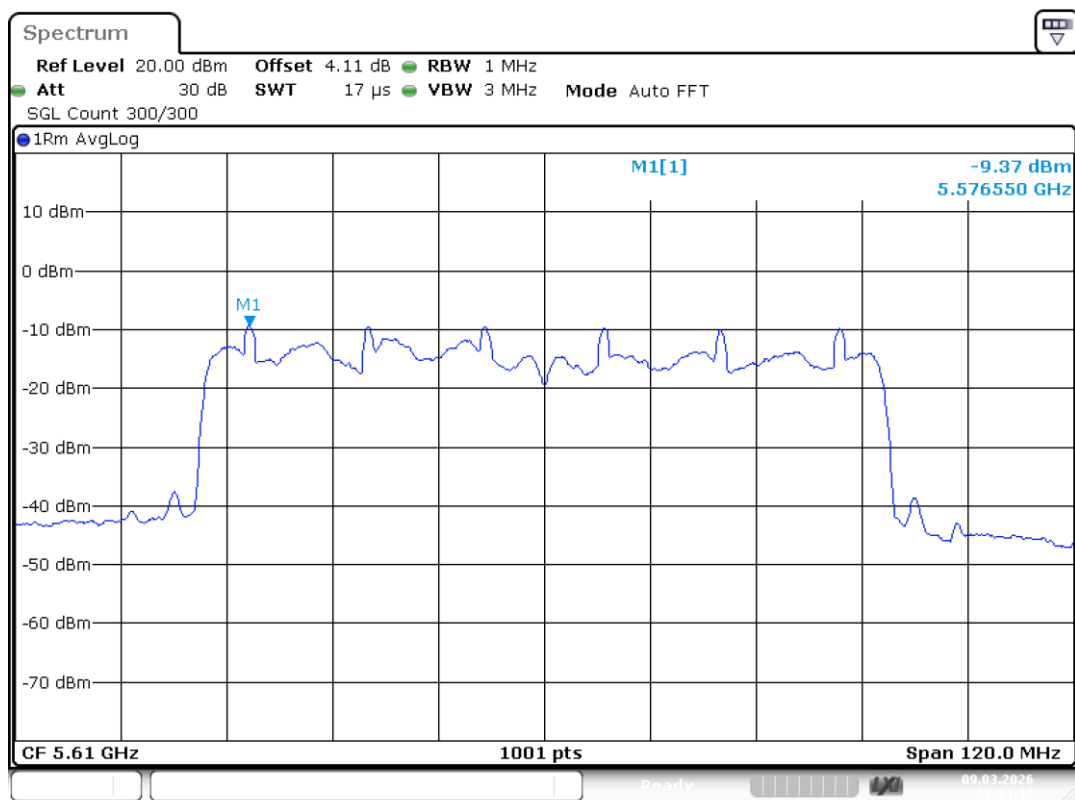

Date: 9.MAR.2026 21:04:12

PSD NVNT ac80 5610MHz Ant1

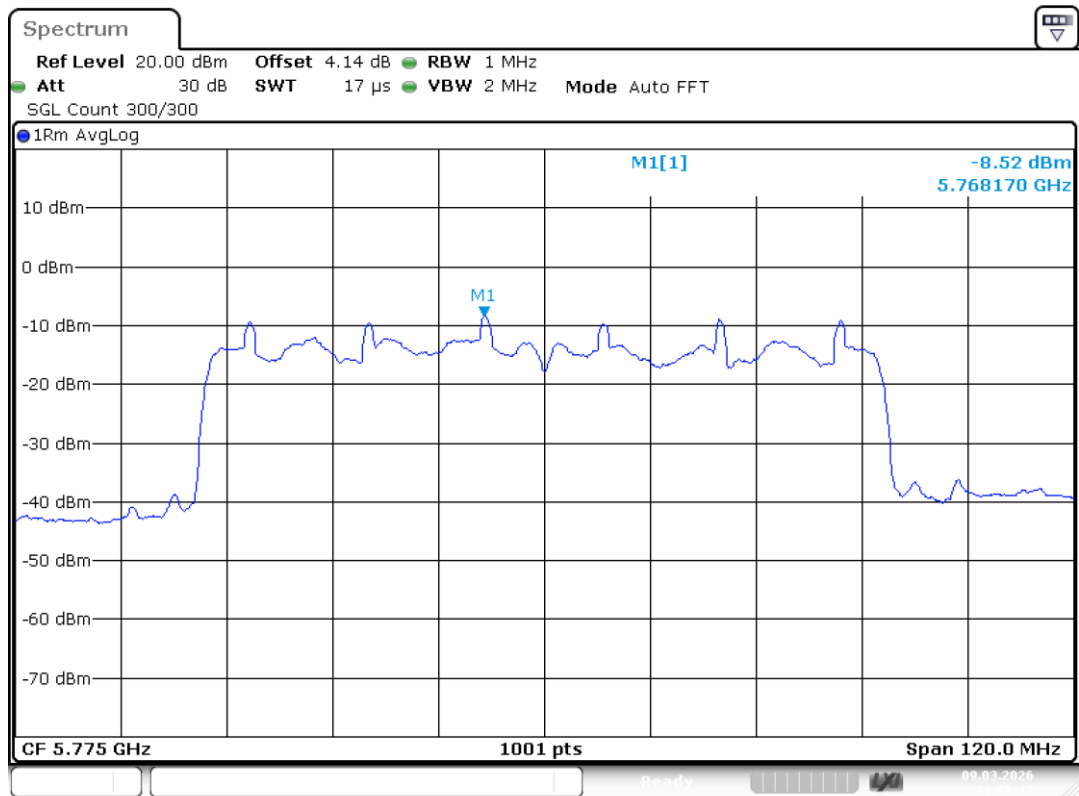

Date: 9.MAR.2026 21:08:16

PSD NVNT ac80 5775MHz Ant1

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 2.55V	a	5180	Ant1	5180	0	0	25	Pass
20C 3V	a	5180	Ant1	5180	0	0	25	Pass
20C 3.45V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 3.3V	a	5180	Ant1	5180	0	0	25	Pass
-10C 3.3V	a	5180	Ant1	5180	0	0	25	Pass
0C 3.3V	a	5180	Ant1	5180	0	0	25	Pass
10C 3.3V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 3.3V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 3.3V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 3.3V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 3.3V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
60C 3.3V	a	5180	Ant1	5180	0	0	25	Pass
70C 3.3V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 2.55V	a	5200	Ant1	5200	0	0	25	Pass
20C 3V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 3.45V	a	5200	Ant1	5200.02	20000	3.85	25	Pass
-20C 3V	a	5200	Ant1	5200	0	0	25	Pass
-10C 3V	a	5200	Ant1	5200.02	20000	3.85	25	Pass
0C 3V	a	5200	Ant1	5200	0	0	25	Pass
10C 3V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 3V	a	5200	Ant1	5200	0	0	25	Pass
40C 3V	a	5200	Ant1	5200	0	0	25	Pass
50C 3V	a	5200	Ant1	5200	0	0	25	Pass
60C 3V	a	5200	Ant1	5200	0	0	25	Pass
70C 3V	a	5200	Ant1	5200	0	0	25	Pass
20C 2.55V	a	5240	Ant1	5240	0	0	25	Pass
20C 3V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 3.45V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
-20C 3V	a	5240	Ant1	5240	0	0	25	Pass
-10C 3V	a	5240	Ant1	5240	0	0	25	Pass
0C 3V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 3V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 3V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 3V	a	5240	Ant1	5240	0	0	25	Pass
50C 3V	a	5240	Ant1	5240	0	0	25	Pass
60C 3V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
70C 3V	a	5240	Ant1	5240	0	0	25	Pass
20C 2.55V	a	5260	Ant1	5260	0	0	25	Pass
20C 3V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
20C 3.45V	a	5260	Ant1	5260.02	20000	3.8	25	Pass

Report

-20C 3V	a	5260	Ant1	5260	0	0	25	Pass
-10C 3V	a	5260	Ant1	5260	0	0	25	Pass
0C 3V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 3V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
30C 3V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
40C 3V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
50C 3V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
60C 3V	a	5260	Ant1	5260.04	40000	7.6	25	Pass
70C 3V	a	5260	Ant1	5260	0	0	25	Pass
20C 2.55V	a	5280	Ant1	5280	0	0	25	Pass
20C 3V	a	5280	Ant1	5280.02	20000	3.79	25	Pass
20C 3.45V	a	5280	Ant1	5280	0	0	25	Pass
-20C 3V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-10C 3V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 3V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
10C 3V	a	5280	Ant1	5280	0	0	25	Pass
30C 3V	a	5280	Ant1	5280	0	0	25	Pass
40C 3V	a	5280	Ant1	5280	0	0	25	Pass
50C 3V	a	5280	Ant1	5280	0	0	25	Pass
60C 3V	a	5280	Ant1	5280	0	0	25	Pass
70C 3V	a	5280	Ant1	5280.02	20000	3.79	25	Pass
20C 2.55V	a	5320	Ant1	5320	0	0	25	Pass
20C 3V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 3.45V	a	5320	Ant1	5320	0	0	25	Pass
-20C 3V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-10C 3V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
0C 3V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
10C 3V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
30C 3V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 3V	a	5320	Ant1	5320	0	0	25	Pass
50C 3V	a	5320	Ant1	5320	0	0	25	Pass
60C 3V	a	5320	Ant1	5320	0	0	25	Pass
70C 3V	a	5320	Ant1	5320	0	0	25	Pass
20C 2.55V	a	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 3V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 3.45V	a	5500	Ant1	5500	0	0	25	Pass
-20C 3V	a	5500	Ant1	5500	0	0	25	Pass
-10C 3V	a	5500	Ant1	5500.02	20000	3.64	25	Pass
0C 3V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
10C 3V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 3V	a	5500	Ant1	5500	0	0	25	Pass
40C 3V	a	5500	Ant1	5500	0	0	25	Pass
50C 3V	a	5500	Ant1	5500	0	0	25	Pass
60C 3V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass

Report

70C 3V	a	5500	Ant1	5500	0	0	25	Pass
20C 2.55V	a	5600	Ant1	5600	0	0	25	Pass
20C 3V	a	5600	Ant1	5600	0	0	25	Pass
20C 3.45V	a	5600	Ant1	5600.02	20000	3.57	25	Pass
-20C 3V	a	5600	Ant1	5600	0	0	25	Pass
-10C 3V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
0C 3V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
10C 3V	a	5600	Ant1	5600.02	20000	3.57	25	Pass
30C 3V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
40C 3V	a	5600	Ant1	5600	0	0	25	Pass
50C 3V	a	5600	Ant1	5599.96	-40000	-7.14	25	Pass
60C 3V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
70C 3V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
20C 2.55V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 3V	a	5700	Ant1	5700	0	0	25	Pass
20C 3.45V	a	5700	Ant1	5700	0	0	25	Pass
-20C 3V	a	5700	Ant1	5700	0	0	25	Pass
-10C 3V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
0C 3V	a	5700	Ant1	5700	0	0	25	Pass
10C 3V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
30C 3V	a	5700	Ant1	5700	0	0	25	Pass
40C 3V	a	5700	Ant1	5700	0	0	25	Pass
50C 3V	a	5700	Ant1	5700	0	0	25	Pass
60C 3V	a	5700	Ant1	5700	0	0	25	Pass
70C 3V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 2.55V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 3V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 3.45V	a	5745	Ant1	5745	0	0	25	Pass
-20C 3V	a	5745	Ant1	5745	0	0	25	Pass
-10C 3V	a	5745	Ant1	5745	0	0	25	Pass
0C 3V	a	5745	Ant1	5745	0	0	25	Pass
10C 3V	a	5745	Ant1	5745	0	0	25	Pass
30C 3V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 3V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
50C 3V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
60C 3V	a	5745	Ant1	5745	0	0	25	Pass
70C 3V	a	5745	Ant1	5745	0	0	25	Pass
20C 2.55V	a	5785	Ant1	5785	0	0	25	Pass
20C 3V	a	5785	Ant1	5785	0	0	25	Pass
20C 3.45V	a	5785	Ant1	5785.02	20000	3.46	25	Pass
-20C 3V	a	5785	Ant1	5785.02	20000	3.46	25	Pass
-10C 3V	a	5785	Ant1	5785	0	0	25	Pass
0C 3V	a	5785	Ant1	5785.02	20000	3.46	25	Pass
10C 3V	a	5785	Ant1	5785	0	0	25	Pass

Report

30C 3V	a	5785	Ant1	5785	0	0	25	Pass
40C 3V	a	5785	Ant1	5785	0	0	25	Pass
50C 3V	a	5785	Ant1	5785	0	0	25	Pass
60C 3V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
70C 3V	a	5785	Ant1	5785	0	0	25	Pass
20C 2.55V	a	5825	Ant1	5825	0	0	25	Pass
20C 3V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 3.45V	a	5825	Ant1	5825	0	0	25	Pass
-20C 3V	a	5825	Ant1	5825	0	0	25	Pass
-10C 3V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 3V	a	5825	Ant1	5825	0	0	25	Pass
10C 3V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
30C 3V	a	5825	Ant1	5825	0	0	25	Pass
40C 3V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
50C 3V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
60C 3V	a	5825	Ant1	5825	0	0	25	Pass
70C 3V	a	5825	Ant1	5825	0	0	25	Pass
20C 2.55V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 3V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 3.45V	n20	5180	Ant1	5180	0	0	25	Pass
-20C 3V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
-10C 3V	n20	5180	Ant1	5180	0	0	25	Pass
0C 3V	n20	5180	Ant1	5180	0	0	25	Pass
10C 3V	n20	5180	Ant1	5180	0	0	25	Pass
30C 3V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 3V	n20	5180	Ant1	5180	0	0	25	Pass
50C 3V	n20	5180	Ant1	5180	0	0	25	Pass
60C 3V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
70C 3V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 2.55V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 3V	n20	5200	Ant1	5200	0	0	25	Pass
20C 3.45V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 3V	n20	5200	Ant1	5200	0	0	25	Pass
-10C 3V	n20	5200	Ant1	5200	0	0	25	Pass
0C 3V	n20	5200	Ant1	5200	0	0	25	Pass
10C 3V	n20	5200	Ant1	5200	0	0	25	Pass
30C 3V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
40C 3V	n20	5200	Ant1	5200	0	0	25	Pass
50C 3V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
60C 3V	n20	5200	Ant1	5200	0	0	25	Pass
70C 3V	n20	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 2.55V	n20	5240	Ant1	5240	0	0	25	Pass
20C 3V	n20	5240	Ant1	5240	0	0	25	Pass
20C 3.45V	n20	5240	Ant1	5240	0	0	25	Pass

Report

-20C 3V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
-10C 3V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 3V	n20	5240	Ant1	5240	0	0	25	Pass
10C 3V	n20	5240	Ant1	5240.04	40000	7.63	25	Pass
30C 3V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
40C 3V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
50C 3V	n20	5240	Ant1	5240	0	0	25	Pass
60C 3V	n20	5240	Ant1	5240	0	0	25	Pass
70C 3V	n20	5240	Ant1	5240	0	0	25	Pass
20C 2.55V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 3V	n20	5260	Ant1	5260	0	0	25	Pass
20C 3.45V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
-20C 3V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-10C 3V	n20	5260	Ant1	5260	0	0	25	Pass
0C 3V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
10C 3V	n20	5260	Ant1	5260	0	0	25	Pass
30C 3V	n20	5260	Ant1	5260	0	0	25	Pass
40C 3V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 3V	n20	5260	Ant1	5260	0	0	25	Pass
60C 3V	n20	5260	Ant1	5260	0	0	25	Pass
70C 3V	n20	5260	Ant1	5260	0	0	25	Pass
20C 2.55V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 3V	n20	5280	Ant1	5280.02	20000	3.79	25	Pass
20C 3.45V	n20	5280	Ant1	5280	0	0	25	Pass
-20C 3V	n20	5280	Ant1	5280	0	0	25	Pass
-10C 3V	n20	5280	Ant1	5280.02	20000	3.79	25	Pass
0C 3V	n20	5280	Ant1	5280	0	0	25	Pass
10C 3V	n20	5280	Ant1	5280	0	0	25	Pass
30C 3V	n20	5280	Ant1	5280	0	0	25	Pass
40C 3V	n20	5280	Ant1	5280	0	0	25	Pass
50C 3V	n20	5280	Ant1	5280	0	0	25	Pass
60C 3V	n20	5280	Ant1	5280.02	20000	3.79	25	Pass
70C 3V	n20	5280	Ant1	5280	0	0	25	Pass
20C 2.55V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 3V	n20	5320	Ant1	5320	0	0	25	Pass
20C 3.45V	n20	5320	Ant1	5320.02	20000	3.76	25	Pass
-20C 3V	n20	5320	Ant1	5320.02	20000	3.76	25	Pass
-10C 3V	n20	5320	Ant1	5320	0	0	25	Pass
0C 3V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 3V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
30C 3V	n20	5320	Ant1	5320	0	0	25	Pass
40C 3V	n20	5320	Ant1	5320	0	0	25	Pass
50C 3V	n20	5320	Ant1	5320.02	20000	3.76	25	Pass
60C 3V	n20	5320	Ant1	5320	0	0	25	Pass

Report

70C 3V	n20	5320	Ant1	5320	0	0	25	Pass
20C 2.55V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 3V	n20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
20C 3.45V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
-20C 3V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 3V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
0C 3V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
10C 3V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 3V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
40C 3V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
50C 3V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
60C 3V	n20	5500	Ant1	5500	0	0	25	Pass
70C 3V	n20	5500	Ant1	5500	0	0	25	Pass
20C 2.55V	n20	5600	Ant1	5600	0	0	25	Pass
20C 3V	n20	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 3.45V	n20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-20C 3V	n20	5600	Ant1	5600	0	0	25	Pass
-10C 3V	n20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
0C 3V	n20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
10C 3V	n20	5600	Ant1	5600.04	40000	7.14	25	Pass
30C 3V	n20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
40C 3V	n20	5600	Ant1	5600	0	0	25	Pass
50C 3V	n20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
60C 3V	n20	5600	Ant1	5600	0	0	25	Pass
70C 3V	n20	5600	Ant1	5600	0	0	25	Pass
20C 2.55V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 3V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 3.45V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
-20C 3V	n20	5700	Ant1	5700	0	0	25	Pass
-10C 3V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
0C 3V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
10C 3V	n20	5700	Ant1	5700	0	0	25	Pass
30C 3V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
40C 3V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
50C 3V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
60C 3V	n20	5700	Ant1	5700	0	0	25	Pass
70C 3V	n20	5700	Ant1	5700	0	0	25	Pass
20C 2.55V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 3V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 3.45V	n20	5745	Ant1	5745	0	0	25	Pass
-20C 3V	n20	5745	Ant1	5745	0	0	25	Pass
-10C 3V	n20	5745	Ant1	5745	0	0	25	Pass
0C 3V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
10C 3V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass

Report

30C 3V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 3V	n20	5745	Ant1	5745	0	0	25	Pass
50C 3V	n20	5745	Ant1	5745.04	40000	6.96	25	Pass
60C 3V	n20	5745	Ant1	5745	0	0	25	Pass
70C 3V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 2.55V	n20	5785	Ant1	5785	0	0	25	Pass
20C 3V	n20	5785	Ant1	5785	0	0	25	Pass
20C 3.45V	n20	5785	Ant1	5785	0	0	25	Pass
-20C 3V	n20	5785	Ant1	5785	0	0	25	Pass
-10C 3V	n20	5785	Ant1	5785	0	0	25	Pass
0C 3V	n20	5785	Ant1	5785	0	0	25	Pass
10C 3V	n20	5785	Ant1	5785	0	0	25	Pass
30C 3V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 3V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
50C 3V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
60C 3V	n20	5785	Ant1	5785	0	0	25	Pass
70C 3V	n20	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 2.55V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 3V	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
20C 3.45V	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
-20C 3.3V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
-10C 3.3V	n20	5825	Ant1	5825	0	0	25	Pass
0C 3.3V	n20	5825	Ant1	5825	0	0	25	Pass
10C 3.3V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 3.3V	n20	5825	Ant1	5825	0	0	25	Pass
30C 3.3V	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
40C 3.3V	n20	5825	Ant1	5825	0	0	25	Pass
50C 3.3V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
60C 3.3V	n20	5825	Ant1	5825	0	0	25	Pass
70C 3.3V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 2.55V	n40	5190	Ant1	5190	0	0	25	Pass
20C 3V	n40	5190	Ant1	5190	0	0	25	Pass
20C 3.45V	n40	5190	Ant1	5190	0	0	25	Pass
-20C 3V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
-10C 3V	n40	5190	Ant1	5190	0	0	25	Pass
0C 3V	n40	5190	Ant1	5190	0	0	25	Pass
10C 3V	n40	5190	Ant1	5190	0	0	25	Pass
30C 3V	n40	5190	Ant1	5190	0	0	25	Pass
40C 3V	n40	5190	Ant1	5190	0	0	25	Pass
50C 3V	n40	5190	Ant1	5190	0	0	25	Pass
60C 3V	n40	5190	Ant1	5190	0	0	25	Pass
70C 3V	n40	5190	Ant1	5190	0	0	25	Pass
20C 2.55V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 3V	n40	5230	Ant1	5230	0	0	25	Pass

Report

20C 3.45V	n40	5230	Ant1	5230	0	0	25	Pass
-20C 3V	n40	5230	Ant1	5230	0	0	25	Pass
-10C 3V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 3V	n40	5230	Ant1	5230	0	0	25	Pass
10C 3V	n40	5230	Ant1	5230	0	0	25	Pass
30C 3V	n40	5230	Ant1	5230	0	0	25	Pass
40C 3V	n40	5230	Ant1	5230	0	0	25	Pass
50C 3V	n40	5230	Ant1	5230	0	0	25	Pass
60C 3V	n40	5230	Ant1	5230	0	0	25	Pass
70C 3V	n40	5230	Ant1	5230	0	0	25	Pass
20C 2.55V	n40	5270	Ant1	5270	0	0	25	Pass
20C 3V	n40	5270	Ant1	5270	0	0	25	Pass
20C 3.45V	n40	5270	Ant1	5270	0	0	25	Pass
-20C 3V	n40	5270	Ant1	5270.04	40000	7.59	25	Pass
-10C 3V	n40	5270	Ant1	5270	0	0	25	Pass
0C 3V	n40	5270	Ant1	5270	0	0	25	Pass
10C 3V	n40	5270	Ant1	5270.04	40000	7.59	25	Pass
30C 3V	n40	5270	Ant1	5270	0	0	25	Pass
40C 3V	n40	5270	Ant1	5270	0	0	25	Pass
50C 3V	n40	5270	Ant1	5270	0	0	25	Pass
60C 3V	n40	5270	Ant1	5270.04	40000	7.59	25	Pass
70C 3V	n40	5270	Ant1	5270	0	0	25	Pass
20C 2.55V	n40	5310	Ant1	5310	0	0	25	Pass
20C 3V	n40	5310	Ant1	5310.04	40000	7.53	25	Pass
20C 3.45V	n40	5310	Ant1	5310	0	0	25	Pass
-20C 3V	n40	5310	Ant1	5310	0	0	25	Pass
-10C 3V	n40	5310	Ant1	5310	0	0	25	Pass
0C 3V	n40	5310	Ant1	5310	0	0	25	Pass
10C 3V	n40	5310	Ant1	5310	0	0	25	Pass
30C 3V	n40	5310	Ant1	5310	0	0	25	Pass
40C 3V	n40	5310	Ant1	5310	0	0	25	Pass
50C 3V	n40	5310	Ant1	5310	0	0	25	Pass
60C 3V	n40	5310	Ant1	5310	0	0	25	Pass
70C 3V	n40	5310	Ant1	5310	0	0	25	Pass
20C 2.55V	n40	5510	Ant1	5510	0	0	25	Pass
20C 3V	n40	5510	Ant1	5510	0	0	25	Pass
20C 3.45V	n40	5510	Ant1	5510.04	40000	7.26	25	Pass
-20C 3V	n40	5510	Ant1	5510	0	0	25	Pass
-10C 3V	n40	5510	Ant1	5510	0	0	25	Pass
0C 3V	n40	5510	Ant1	5510	0	0	25	Pass
10C 3V	n40	5510	Ant1	5510	0	0	25	Pass
30C 3V	n40	5510	Ant1	5510	0	0	25	Pass
40C 3V	n40	5510	Ant1	5510	0	0	25	Pass
50C 3V	n40	5510	Ant1	5510	0	0	25	Pass

Report

60C 3V	n40	5510	Ant1	5510	0	0	25	Pass
70C 3V	n40	5510	Ant1	5510	0	0	25	Pass
20C 2.55V	n40	5590	Ant1	5590	0	0	25	Pass
20C 3V	n40	5590	Ant1	5590	0	0	25	Pass
20C 3.45V	n40	5590	Ant1	5590	0	0	25	Pass
-20C 3V	n40	5590	Ant1	5590	0	0	25	Pass
-10C 3V	n40	5590	Ant1	5590	0	0	25	Pass
0C 3V	n40	5590	Ant1	5590	0	0	25	Pass
10C 3V	n40	5590	Ant1	5590	0	0	25	Pass
30C 3V	n40	5590	Ant1	5590	0	0	25	Pass
40C 3V	n40	5590	Ant1	5590.04	40000	7.16	25	Pass
50C 3V	n40	5590	Ant1	5590	0	0	25	Pass
60C 3V	n40	5590	Ant1	5590	0	0	25	Pass
70C 3V	n40	5590	Ant1	5590.04	40000	7.16	25	Pass
20C 2.55V	n40	5670	Ant1	5670	0	0	25	Pass
20C 3V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
20C 3.45V	n40	5670	Ant1	5670	0	0	25	Pass
-20C 120V	n40	5670	Ant1	5670	0	0	25	Pass
-10C 120V	n40	5670	Ant1	5670	0	0	25	Pass
0C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
10C 120V	n40	5670	Ant1	5670	0	0	25	Pass
20C 120V	n40	5670	Ant1	5670	0	0	25	Pass
30C 120V	n40	5670	Ant1	5670	0	0	25	Pass
40C 120V	n40	5670	Ant1	5670	0	0	25	Pass
50C 120V	n40	5670	Ant1	5670	0	0	25	Pass
60C 120V	n40	5670	Ant1	5670	0	0	25	Pass
70C 120V	n40	5670	Ant1	5670	0	0	25	Pass
20C 2.55V	n40	5755	Ant1	5755	0	0	25	Pass
20C 3V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 3.45V	n40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
0C 120V	n40	5755	Ant1	5755	0	0	25	Pass
10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
30C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
40C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
50C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
60C 120V	n40	5755	Ant1	5755	0	0	25	Pass
70C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 2.55V	n40	5795	Ant1	5795	0	0	25	Pass
20C 3V	n40	5795	Ant1	5795	0	0	25	Pass
20C 3.45V	n40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	n40	5795	Ant1	5795	0	0	25	Pass

Report

-10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
0C 120V	n40	5795	Ant1	5795	0	0	25	Pass
10C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5795	0	0	25	Pass
50C 120V	n40	5795	Ant1	5795	0	0	25	Pass
60C 120V	n40	5795	Ant1	5795	0	0	25	Pass
70C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 2.55V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 3V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 3.45V	ac20	5180	Ant1	5180	0	0	25	Pass
-20C 3V	ac20	5180	Ant1	5180	0	0	25	Pass
-10C 3V	ac20	5180	Ant1	5180	0	0	25	Pass
0C 3V	ac20	5180	Ant1	5180	0	0	25	Pass
10C 3V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 3V	ac20	5180	Ant1	5180	0	0	25	Pass
40C 3V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
50C 3V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
60C 3V	ac20	5180	Ant1	5180	0	0	25	Pass
70C 3V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 2.55V	ac20	5200	Ant1	5200	0	0	25	Pass
20C 3V	ac20	5200	Ant1	5200	0	0	25	Pass
20C 3.45V	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 3V	ac20	5200	Ant1	5200	0	0	25	Pass
-10C 3V	ac20	5200	Ant1	5200.02	20000	3.85	25	Pass
0C 3V	ac20	5200	Ant1	5200	0	0	25	Pass
10C 3V	ac20	5200	Ant1	5200.02	20000	3.85	25	Pass
30C 3V	ac20	5200	Ant1	5200	0	0	25	Pass
40C 3V	ac20	5200	Ant1	5200	0	0	25	Pass
50C 3V	ac20	5200	Ant1	5200	0	0	25	Pass
60C 3V	ac20	5200	Ant1	5200.02	20000	3.85	25	Pass
70C 3V	ac20	5200	Ant1	5200	0	0	25	Pass
20C 2.55V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 3V	ac20	5240	Ant1	5240	0	0	25	Pass
20C 3.45V	ac20	5240	Ant1	5240	0	0	25	Pass
-20C 3V	ac20	5240	Ant1	5240	0	0	25	Pass
-10C 3V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
0C 3V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 3V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
30C 3V	ac20	5240	Ant1	5240	0	0	25	Pass
40C 3V	ac20	5240	Ant1	5240	0	0	25	Pass
50C 3V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
60C 3V	ac20	5240	Ant1	5240	0	0	25	Pass

Report

70C 3V	ac20	5240	Ant1	5240	0	0	25	Pass
20C 2.55V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 3V	ac20	5260	Ant1	5260	0	0	25	Pass
20C 3.45V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 3V	ac20	5260	Ant1	5260.02	20000	3.8	25	Pass
-10C 3V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 3V	ac20	5260	Ant1	5260	0	0	25	Pass
10C 3V	ac20	5260	Ant1	5260	0	0	25	Pass
30C 3V	ac20	5260	Ant1	5260.02	20000	3.8	25	Pass
40C 3V	ac20	5260	Ant1	5260	0	0	25	Pass
50C 3V	ac20	5260	Ant1	5260	0	0	25	Pass
60C 3V	ac20	5260	Ant1	5260	0	0	25	Pass
70C 3V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 2.55V	ac20	5280	Ant1	5280	0	0	25	Pass
20C 3V	ac20	5280	Ant1	5280	0	0	25	Pass
20C 3.45V	ac20	5280	Ant1	5280	0	0	25	Pass
-20C 3V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-10C 3V	ac20	5280	Ant1	5280	0	0	25	Pass
0C 3V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
10C 3V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 3V	ac20	5280	Ant1	5280.02	20000	3.79	25	Pass
40C 3V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 3V	ac20	5280	Ant1	5280	0	0	25	Pass
60C 3V	ac20	5280	Ant1	5280.02	20000	3.79	25	Pass
70C 3V	ac20	5280	Ant1	5280.02	20000	3.79	25	Pass
20C 2.55V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 3V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 3.45V	ac20	5320	Ant1	5320	0	0	25	Pass
-20C 3V	ac20	5320	Ant1	5320	0	0	25	Pass
-10C 3V	ac20	5320	Ant1	5320	0	0	25	Pass
0C 3V	ac20	5320	Ant1	5320	0	0	25	Pass
10C 3V	ac20	5320	Ant1	5320	0	0	25	Pass
30C 3V	ac20	5320	Ant1	5320	0	0	25	Pass
40C 3V	ac20	5320	Ant1	5320	0	0	25	Pass
50C 3V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
60C 3V	ac20	5320	Ant1	5320	0	0	25	Pass
70C 3V	ac20	5320	Ant1	5320.04	40000	7.52	25	Pass
20C 2.55V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 3V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 3.45V	ac20	5500	Ant1	5500	0	0	25	Pass
-20C 3V	ac20	5500	Ant1	5500	0	0	25	Pass
-10C 3V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
0C 3V	ac20	5500	Ant1	5500	0	0	25	Pass
10C 3V	ac20	5500	Ant1	5500	0	0	25	Pass

Report

30C 3V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
40C 3V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
50C 3V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
60C 3V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
70C 3V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 2.55V	ac20	5600	Ant1	5600	0	0	25	Pass
20C 3V	ac20	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 3.45V	ac20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-20C 3V	ac20	5600	Ant1	5600	0	0	25	Pass
-10C 3V	ac20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
0C 3V	ac20	5600	Ant1	5600.02	20000	3.57	25	Pass
10C 3V	ac20	5600	Ant1	5600	0	0	25	Pass
30C 3V	ac20	5600	Ant1	5600	0	0	25	Pass
40C 3V	ac20	5600	Ant1	5600	0	0	25	Pass
50C 3V	ac20	5600	Ant1	5600	0	0	25	Pass
60C 3V	ac20	5600	Ant1	5600	0	0	25	Pass
70C 3V	ac20	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 2.55V	ac20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 3V	ac20	5700	Ant1	5700	0	0	25	Pass
20C 3.45V	ac20	5700	Ant1	5700	0	0	25	Pass
-20C 3V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-10C 3V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
0C 3V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
10C 3V	ac20	5700	Ant1	5700	0	0	25	Pass
30C 3V	ac20	5700	Ant1	5700	0	0	25	Pass
40C 3V	ac20	5700	Ant1	5700.02	20000	3.51	25	Pass
50C 3V	ac20	5700	Ant1	5700.02	20000	3.51	25	Pass
60C 3V	ac20	5700	Ant1	5700.02	20000	3.51	25	Pass
70C 3V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 2.55V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 3V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 3.45V	ac20	5745	Ant1	5745	0	0	25	Pass
-20C 3V	ac20	5745	Ant1	5745	0	0	25	Pass
-10C 3V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
0C 3V	ac20	5745	Ant1	5745	0	0	25	Pass
10C 3V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
30C 3V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 3V	ac20	5745	Ant1	5745	0	0	25	Pass
50C 3V	ac20	5745	Ant1	5745	0	0	25	Pass
60C 3V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
70C 3V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 2.55V	ac20	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 3V	ac20	5785	Ant1	5785	0	0	25	Pass
20C 3.45V	ac20	5785	Ant1	5785	0	0	25	Pass

Report

-20C 3V	ac20	5785	Ant1	5785	0	0	25	Pass
-10C 3V	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 3V	ac20	5785	Ant1	5785.02	20000	3.46	25	Pass
10C 3V	ac20	5785	Ant1	5785.04	40000	6.91	25	Pass
30C 3V	ac20	5785	Ant1	5785.02	20000	3.46	25	Pass
40C 3V	ac20	5785	Ant1	5785	0	0	25	Pass
50C 3V	ac20	5785	Ant1	5785	0	0	25	Pass
60C 3V	ac20	5785	Ant1	5785	0	0	25	Pass
70C 3V	ac20	5785	Ant1	5785	0	0	25	Pass
20C 2.55V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 3V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 3.45V	ac20	5825	Ant1	5825	0	0	25	Pass
-20C 3V	ac20	5825	Ant1	5825	0	0	25	Pass
-10C 3V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 3V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 3V	ac20	5825	Ant1	5825.04	40000	6.87	25	Pass
30C 3V	ac20	5825	Ant1	5825	0	0	25	Pass
40C 3V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
50C 3V	ac20	5825	Ant1	5825	0	0	25	Pass
60C 3V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
70C 3V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 2.55V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 3V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 3.45V	ac40	5190	Ant1	5190	0	0	25	Pass
--20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
-10C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
0C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
10C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
30C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
40C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
60C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
70C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 2.55V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 3V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 3.45V	ac40	5230	Ant1	5230	0	0	25	Pass
-20C 3V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-10C 3V	ac40	5230	Ant1	5230	0	0	25	Pass
0C 3V	ac40	5230	Ant1	5230	0	0	25	Pass
10C 3V	ac40	5230	Ant1	5230	0	0	25	Pass
30C 3V	ac40	5230	Ant1	5230	0	0	25	Pass
40C 3V	ac40	5230	Ant1	5230	0	0	25	Pass

Report

50C 3V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
60C 3V	ac40	5230	Ant1	5230	0	0	25	Pass
70C 3V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 2.55V	ac40	5270	Ant1	5270	0	0	25	Pass
20C 3V	ac40	5270	Ant1	5270	0	0	25	Pass
20C 3.45V	ac40	5270	Ant1	5270	0	0	25	Pass
-20C 3V	ac40	5270	Ant1	5270	0	0	25	Pass
-10C 3V	ac40	5270	Ant1	5270	0	0	25	Pass
0C 3V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
10C 3V	ac40	5270	Ant1	5270	0	0	25	Pass
30C 3V	ac40	5270	Ant1	5270	0	0	25	Pass
40C 3V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
50C 3V	ac40	5270	Ant1	5270	0	0	25	Pass
60C 3V	ac40	5270	Ant1	5270	0	0	25	Pass
70C 3V	ac40	5270	Ant1	5270	0	0	25	Pass
20C 2.55V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 3V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 3.45V	ac40	5310	Ant1	5310	0	0	25	Pass
-20C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
-10C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
0C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
10C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
30C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
40C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
50C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
60C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
70C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 2.55V	ac40	5510	Ant1	5510	0	0	25	Pass
20C 3V	ac40	5510	Ant1	5510	0	0	25	Pass
20C 3.45V	ac40	5510	Ant1	5510	0	0	25	Pass
-20C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
-10C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
0C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
10C 120V	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
20C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
30C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
40C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
50C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
60C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
70C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
20C 2.55V	ac40	5590	Ant1	5590	0	0	25	Pass
20C 3V	ac40	5590	Ant1	5590	0	0	25	Pass
20C 3.45V	ac40	5590	Ant1	5590	0	0	25	Pass

Report


-20C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
-10C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
0C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
10C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
20C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
30C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
40C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
50C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
60C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
70C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
20C 2.55V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 3V	ac40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
20C 3.45V	ac40	5670	Ant1	5670	0	0	25	Pass
-20C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
-10C 120V	ac40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
0C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
10C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
30C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
40C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
50C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
60C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
70C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 2.55V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 3V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 3.45V	ac40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
0C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
40C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
50C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
60C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
70C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 2.55V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 3V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 3.45V	ac40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass

Report

30C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
40C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
60C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
70C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 2.55V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 3.45V	ac80	5210	Ant1	5210	0	0	25	Pass
-20C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
-10C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
0C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
40C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
50C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
60C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
70C 3V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 2.55V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 3.45V	ac80	5290	Ant1	5290	0	0	25	Pass
-20C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
-10C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
0C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
10C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
30C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
40C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
50C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
60C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
70C 3V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 2.55V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 3.45V	ac80	5530	Ant1	5530	0	0	25	Pass
-20C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
-10C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
0C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
10C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
30C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
40C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
50C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
60C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
70C 3V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 2.55V	ac80	5610	Ant1	5610	0	0	25	Pass
20C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
20C 3.45V	ac80	5610	Ant1	5610	0	0	25	Pass


Report

-20C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
-10C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
0C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
10C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
30C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
40C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
50C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
60C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
70C 3V	ac80	5610	Ant1	5610	0	0	25	Pass
20C 2.55V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 3V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 3.45V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 3V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 3V	ac80	5775	Ant1	5775	0	0	25	Pass
0C 3V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 3V	ac80	5775	Ant1	5775	0	0	25	Pass
30C 3V	ac80	5775	Ant1	5775	0	0	25	Pass
40C 3V	ac80	5775	Ant1	5775	0	0	25	Pass
50C 3V	ac80	5775	Ant1	5775.08	80000	13.85	25	Pass
60C 3V	ac80	5775	Ant1	5775	0	0	25	Pass
70C 3V	ac80	5775	Ant1	5775	0	0	25	Pass

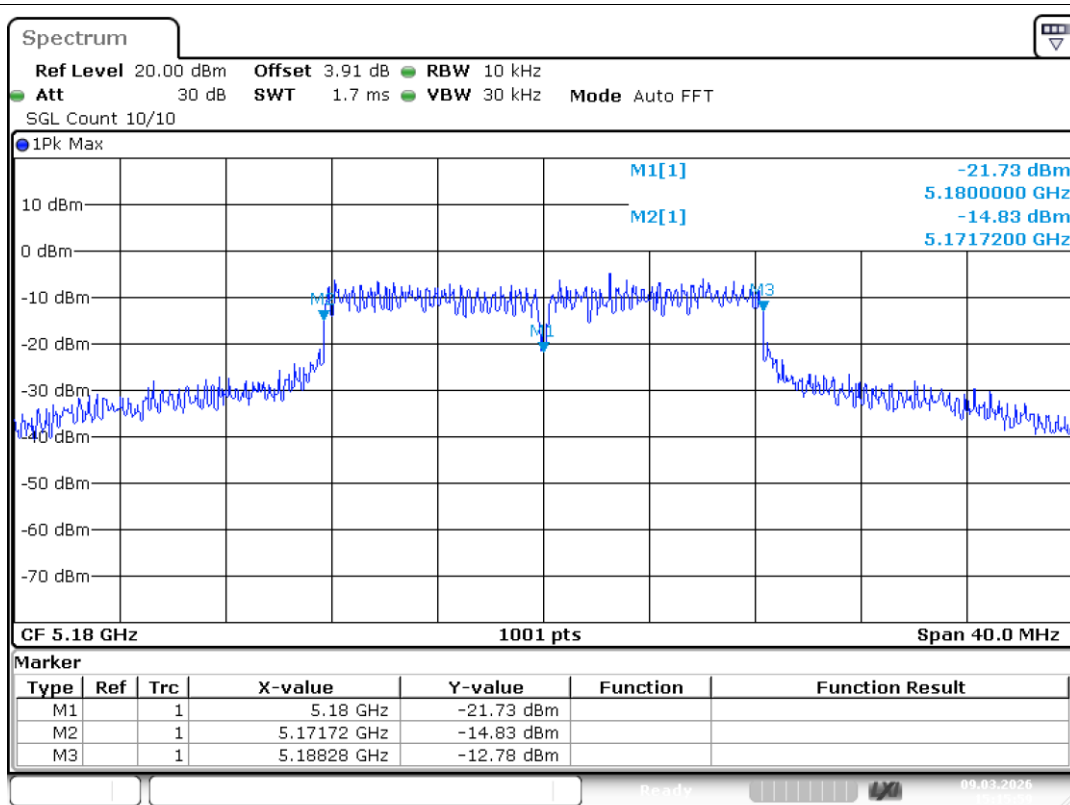


Date: 9.MAR.2026 15:15:59

Freq. Stability 20C 2.55V a 5180MHz Ant1

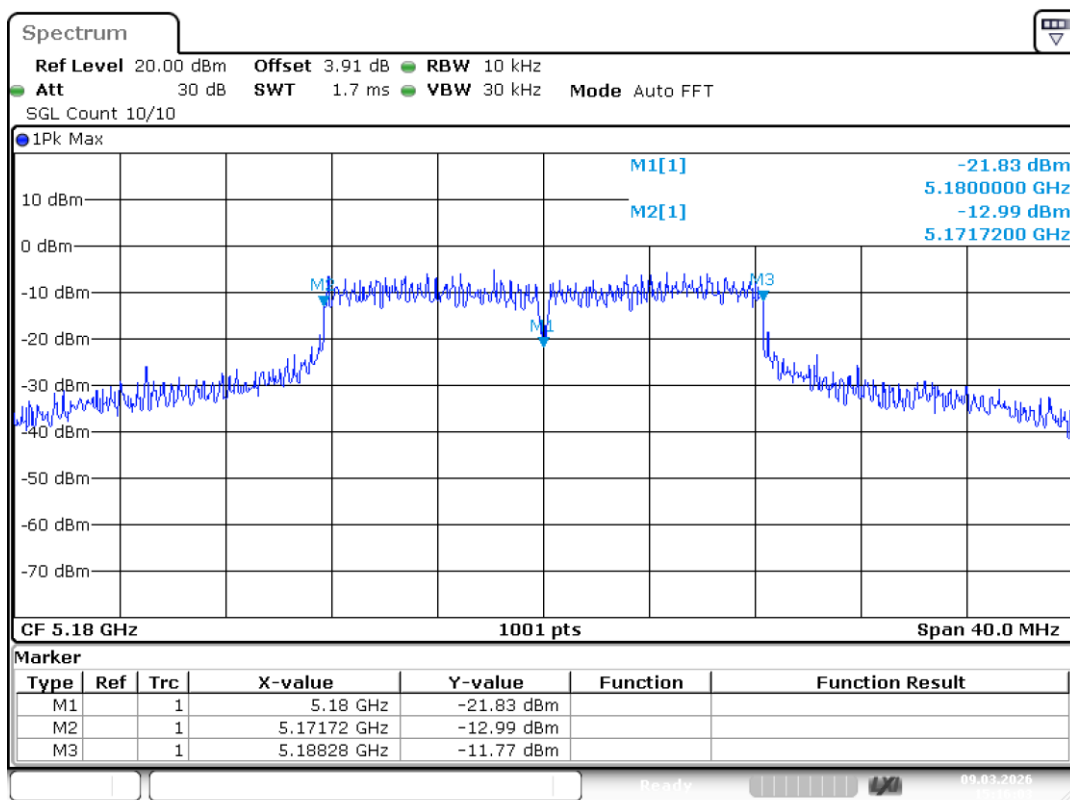


Date: 9.MAR.2026 15:16:03

Freq. Stability 20C 3V a 5180MHz Ant1

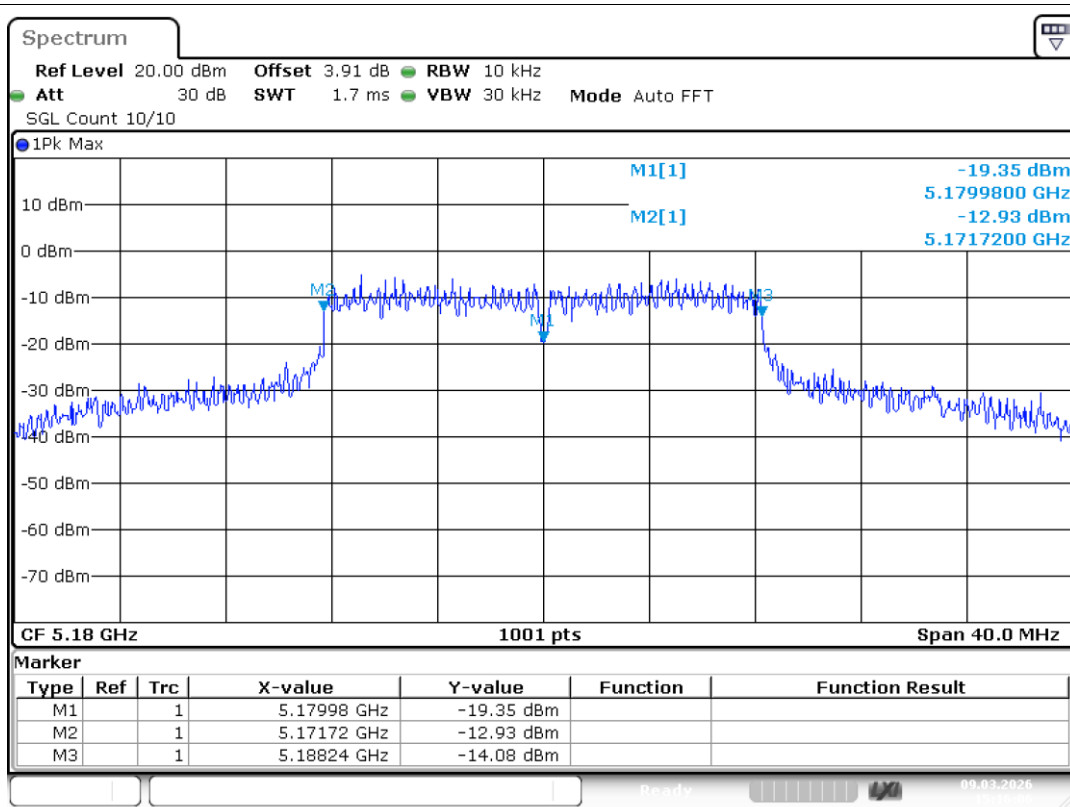


Date: 9.MAR.2026 15:16:06

Freq. Stability 20C 3.45V a 5180MHz Ant1

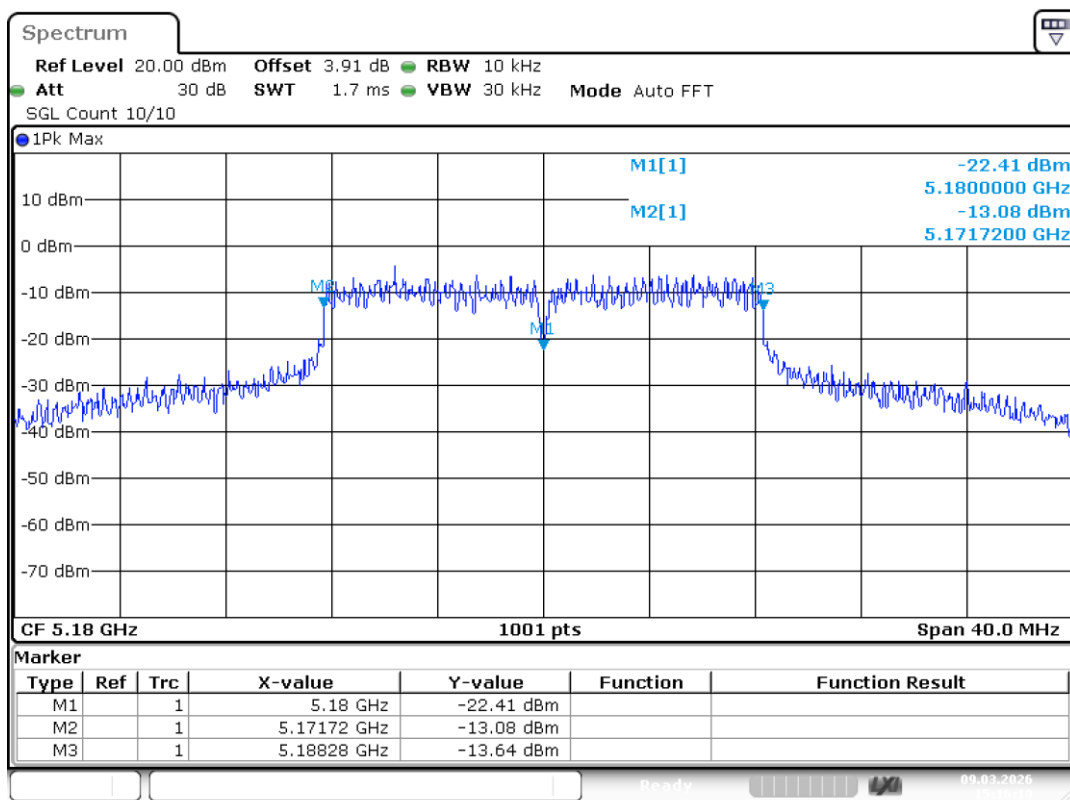


Date: 9.MAR.2026 15:16:10

Freq. Stability -20C 3.3V a 5180MHz Ant1

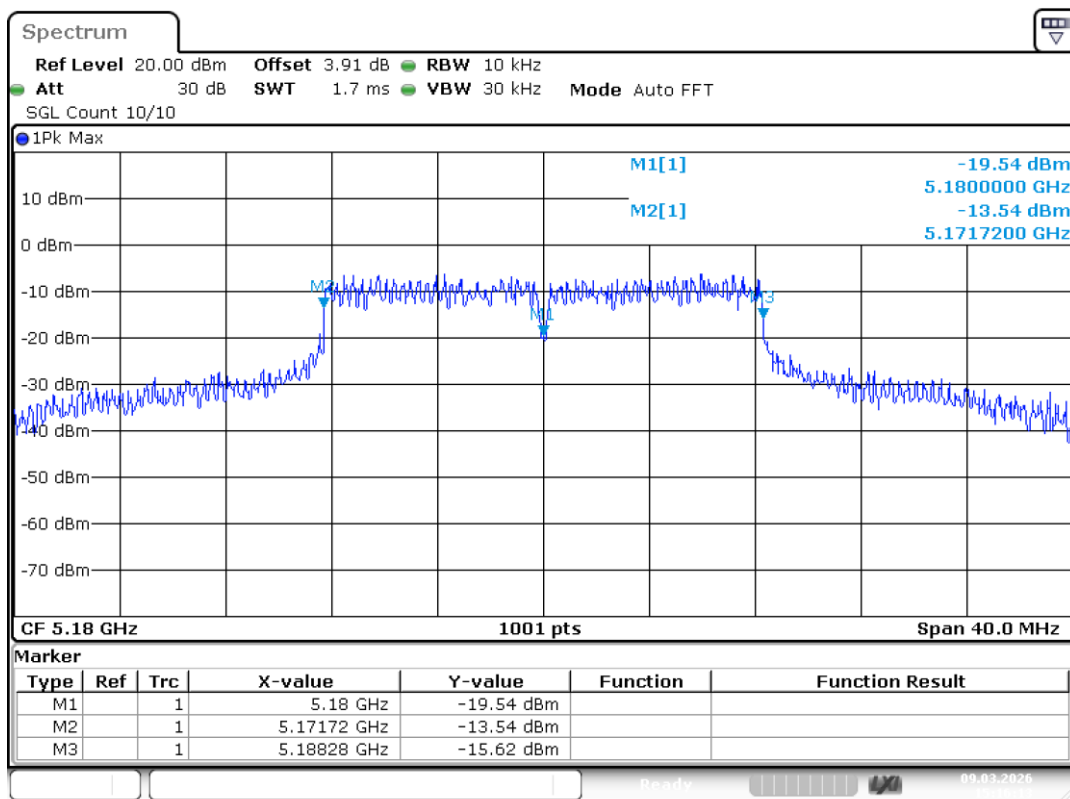


Date: 9.MAR.2026 15:16:14

Freq. Stability -10C 3.3V a 5180MHz Ant1

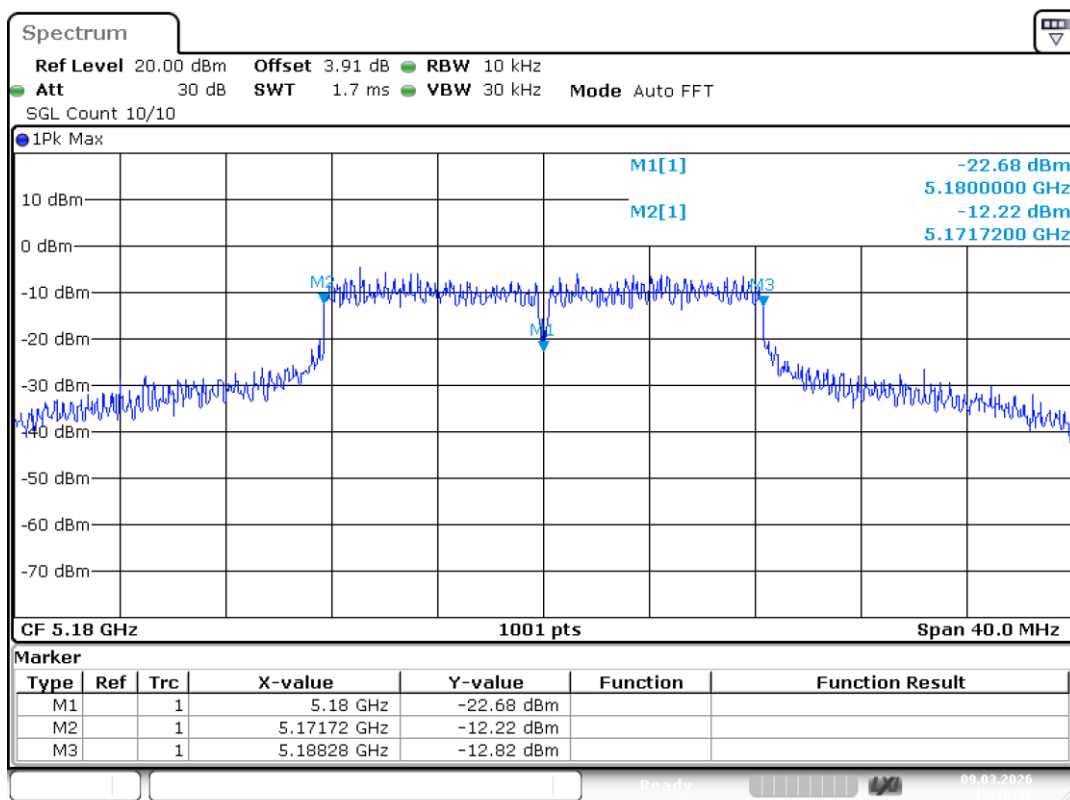


Date: 9.MAR.2026 15:16:17

Freq. Stability 0C 3.3V a 5180MHz Ant1

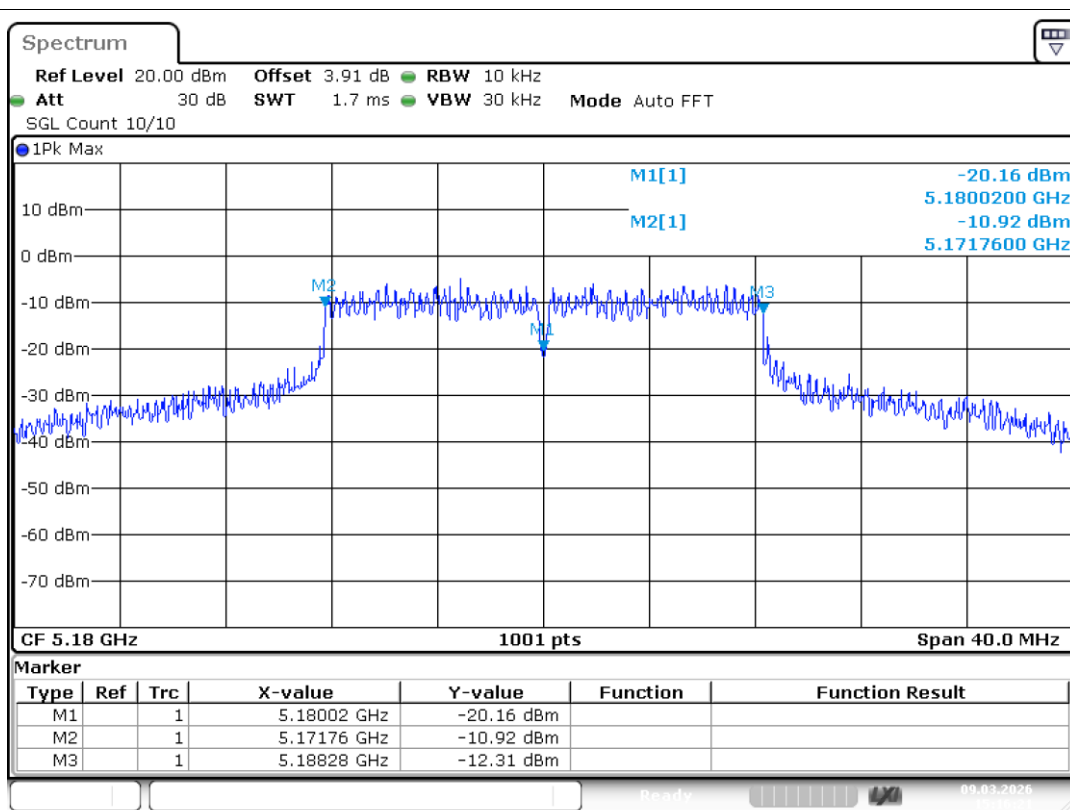


Date: 9.MAR.2026 15:16:21

Freq. Stability 10C 3.3V a 5180MHz Ant1

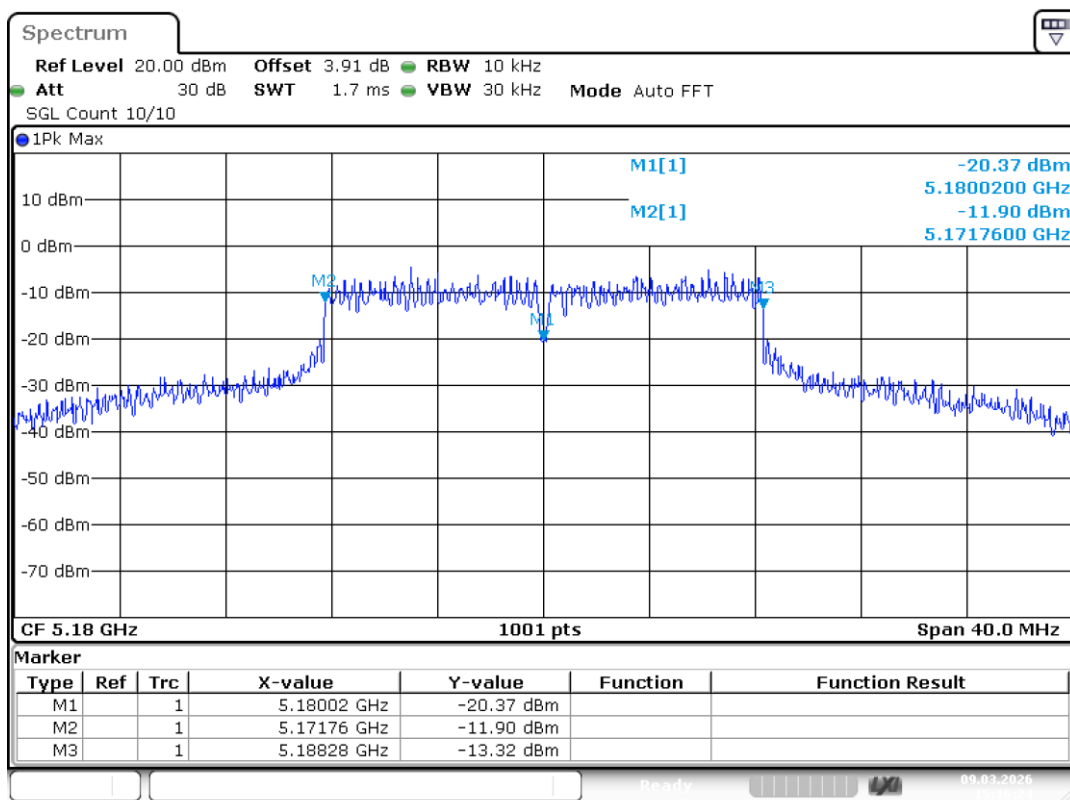


Date: 9.MAR.2026 15:16:24

Freq. Stability 20C 3.3V a 5180MHz Ant1

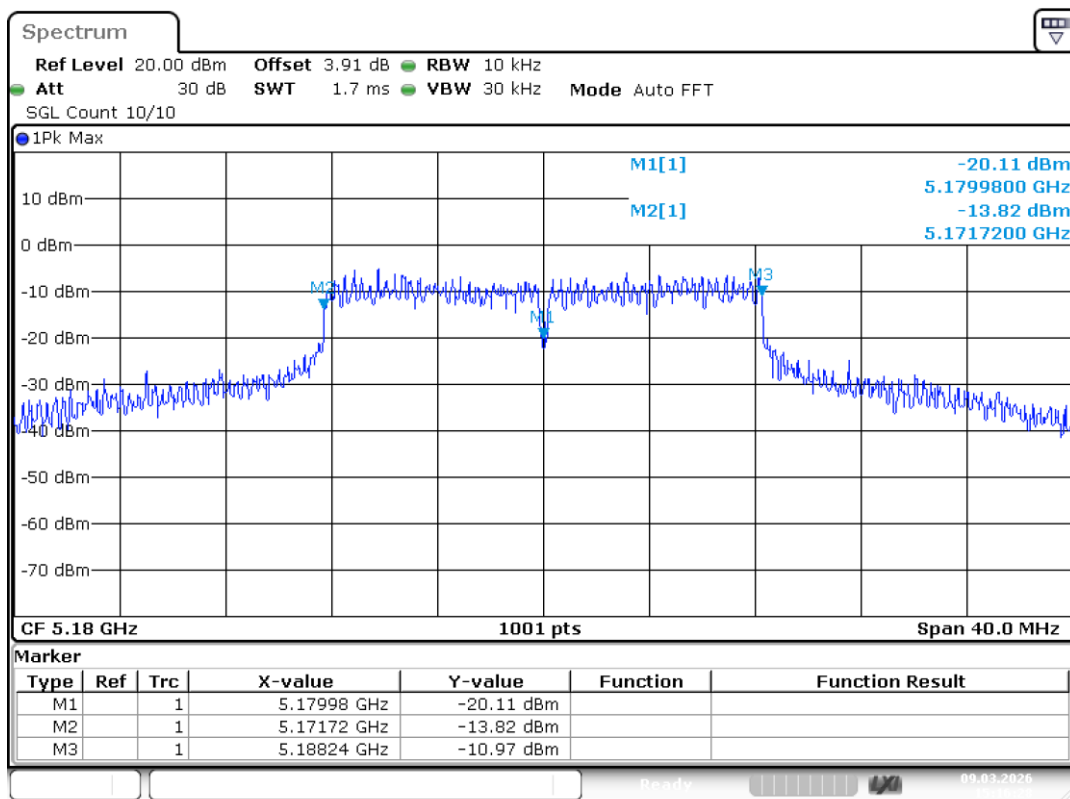


Date: 9.MAR.2026 15:16:28

Freq. Stability 30C 3.3V a 5180MHz Ant1

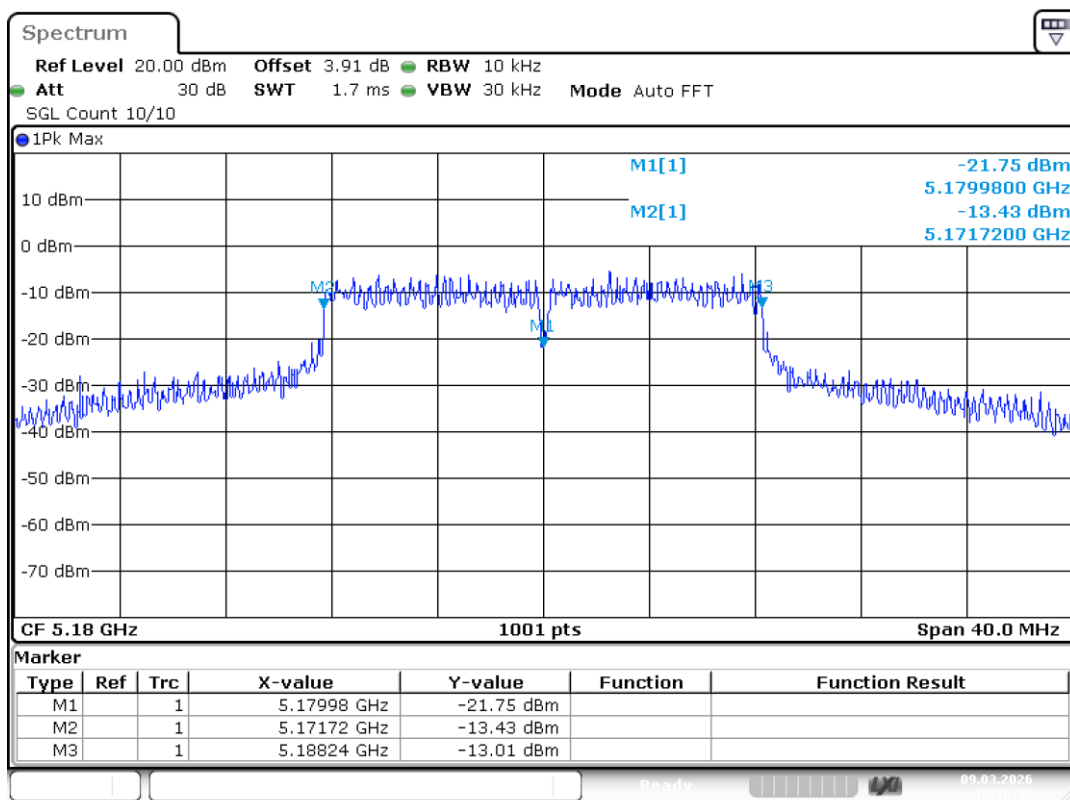


Date: 9.MAR.2026 15:16:32

Freq. Stability 40C 3.3V a 5180MHz Ant1

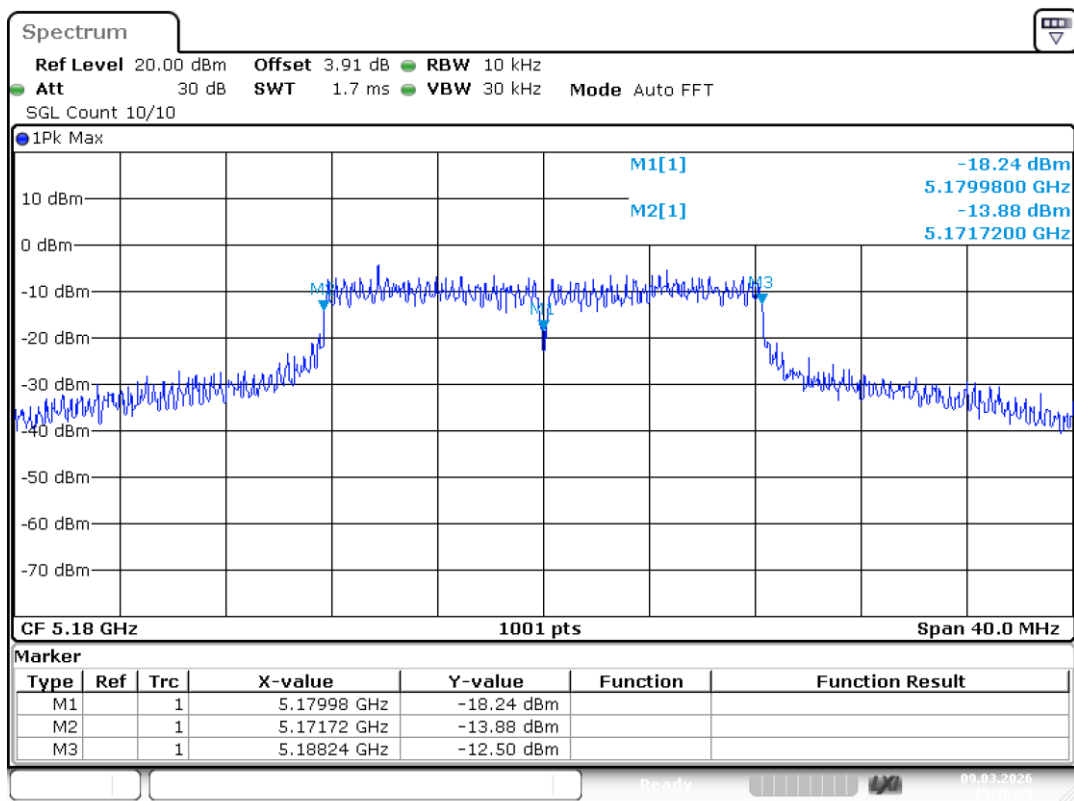

Date: 9.MAR.2026 15:16:35

Freq. Stability 50C 3.3V a 5180MHz Ant1

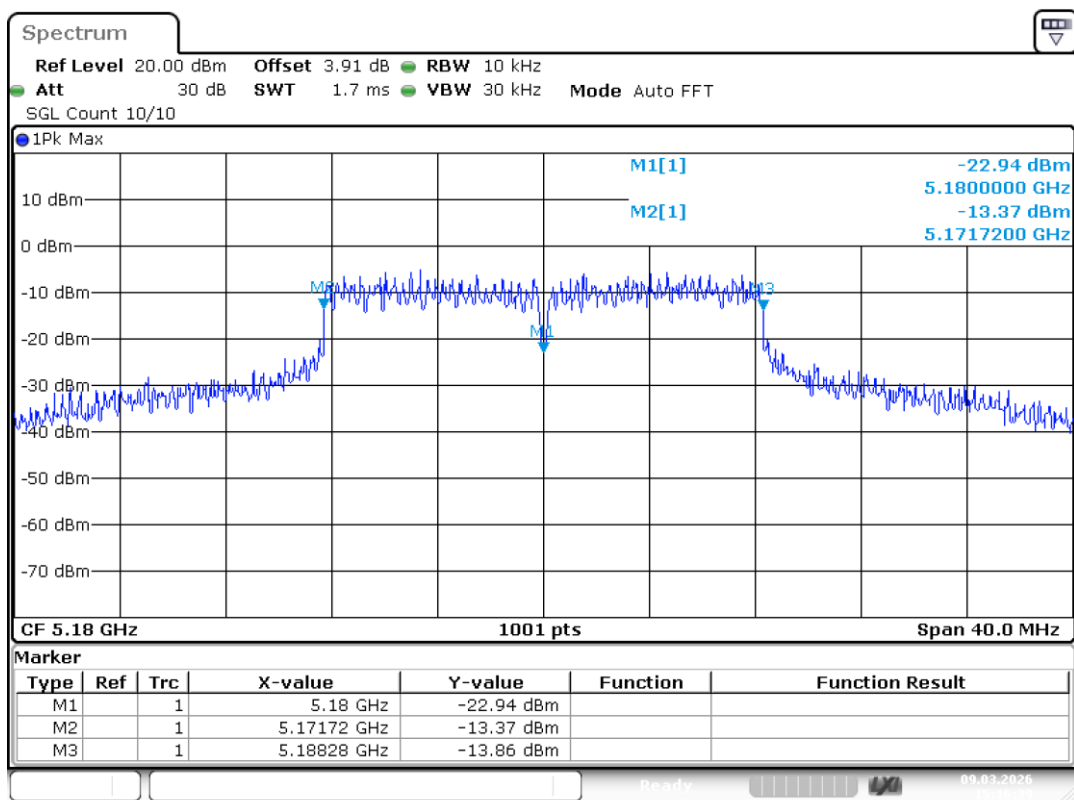

Date: 9.MAR.2026 15:16:39

Freq. Stability 60C 3.3V a 5180MHz Ant1