

## Appendix Test Data

|                  |                     |                    |                    |
|------------------|---------------------|--------------------|--------------------|
| Report No.:      | 1812C50390312502-01 | Test Sample No.:   | 1-2-2              |
| Start Test Date: | 2025-09-05          | Finish Test Date:  | 2025-09-23         |
| Test Engineer:   | <i>dylan. Ma</i>    | Auditor:           | <i>Justin Feng</i> |
| Temperature:     | 25.4℃               | Relative Humidity: | 49%                |
| Pressure:        | 101kPa              |                    |                    |



## Appendix A1: 26dB Bandwidth

### Test Result

| Test Mode | Antenna | Frequency [MHz] | 26db EBW [MHz] | FL[MHz] | FH[MHz] | Limit[MHz] | Verdict |
|-----------|---------|-----------------|----------------|---------|---------|------------|---------|
| 11A       | Ant0    | 5180            | 17.44          | 5171.36 | 5188.80 | ---        | ---     |
| 11A       | Ant2    | 5180            | 17.60          | 5171.28 | 5188.88 | ---        | ---     |
| 11A       | Ant0    | 5200            | 18.24          | 5190.96 | 5209.20 | ---        | ---     |
| 11A       | Ant2    | 5200            | 18.24          | 5190.96 | 5209.20 | ---        | ---     |
| 11A       | Ant0    | 5240            | 18.24          | 5230.96 | 5249.20 | ---        | ---     |
| 11A       | Ant2    | 5240            | 18.04          | 5230.96 | 5249.00 | ---        | ---     |
| 11A       | Ant0    | 5745            | 18.24          | 5735.92 | 5754.16 | ---        | ---     |
| 11A       | Ant2    | 5745            | 18.04          | 5736.04 | 5754.08 | ---        | ---     |
| 11A       | Ant0    | 5785            | 18.16          | 5776.00 | 5794.16 | ---        | ---     |
| 11A       | Ant2    | 5785            | 17.92          | 5776.00 | 5793.92 | ---        | ---     |
| 11A       | Ant0    | 5825            | 17.92          | 5816.04 | 5833.96 | ---        | ---     |
| 11A       | Ant2    | 5825            | 17.96          | 5816.04 | 5834.00 | ---        | ---     |
| 11N20MIMO | Ant0    | 5180            | 18.68          | 5170.72 | 5189.40 | ---        | ---     |
| 11N20MIMO | Ant2    | 5180            | 18.68          | 5170.68 | 5189.36 | ---        | ---     |
| 11N20MIMO | Ant0    | 5200            | 18.68          | 5190.68 | 5209.36 | ---        | ---     |
| 11N20MIMO | Ant2    | 5200            | 18.68          | 5190.72 | 5209.40 | ---        | ---     |
| 11N20MIMO | Ant0    | 5240            | 18.68          | 5230.68 | 5249.36 | ---        | ---     |
| 11N20MIMO | Ant2    | 5240            | 18.72          | 5230.68 | 5249.40 | ---        | ---     |
| 11N20MIMO | Ant0    | 5745            | 18.68          | 5735.64 | 5754.32 | ---        | ---     |
| 11N20MIMO | Ant2    | 5745            | 18.68          | 5735.68 | 5754.36 | ---        | ---     |
| 11N20MIMO | Ant0    | 5785            | 18.40          | 5775.84 | 5794.24 | ---        | ---     |
| 11N20MIMO | Ant2    | 5785            | 18.68          | 5775.68 | 5794.36 | ---        | ---     |
| 11N20MIMO | Ant0    | 5825            | 18.72          | 5815.68 | 5834.40 | ---        | ---     |
| 11N20MIMO | Ant2    | 5825            | 18.64          | 5815.72 | 5834.36 | ---        | ---     |
| 11N40MIMO | Ant0    | 5190            | 38.24          | 5170.80 | 5209.04 | ---        | ---     |

|            |      |      |       |         |         |     |     |
|------------|------|------|-------|---------|---------|-----|-----|
| 11N40MIMO  | Ant2 | 5190 | 38.32 | 5170.80 | 5209.12 | --- | --- |
| 11N40MIMO  | Ant0 | 5230 | 38.08 | 5210.80 | 5248.88 | --- | --- |
| 11N40MIMO  | Ant2 | 5230 | 38.24 | 5210.80 | 5249.04 | --- | --- |
| 11N40MIMO  | Ant0 | 5755 | 38.24 | 5735.80 | 5774.04 | --- | --- |
| 11N40MIMO  | Ant2 | 5755 | 38.08 | 5735.80 | 5773.88 | --- | --- |
| 11N40MIMO  | Ant0 | 5795 | 38.16 | 5775.72 | 5813.88 | --- | --- |
| 11N40MIMO  | Ant2 | 5795 | 38.32 | 5775.72 | 5814.04 | --- | --- |
| 11AC20MIMO | Ant0 | 5180 | 19.08 | 5170.40 | 5189.48 | --- | --- |
| 11AC20MIMO | Ant2 | 5180 | 19.24 | 5170.36 | 5189.60 | --- | --- |
| 11AC20MIMO | Ant0 | 5200 | 19.16 | 5190.40 | 5209.56 | --- | --- |
| 11AC20MIMO | Ant2 | 5200 | 19.16 | 5190.40 | 5209.56 | --- | --- |
| 11AC20MIMO | Ant0 | 5240 | 19.08 | 5230.40 | 5249.48 | --- | --- |
| 11AC20MIMO | Ant2 | 5240 | 19.00 | 5230.56 | 5249.56 | --- | --- |
| 11AC20MIMO | Ant0 | 5745 | 19.04 | 5735.44 | 5754.48 | --- | --- |
| 11AC20MIMO | Ant2 | 5745 | 19.20 | 5735.44 | 5754.64 | --- | --- |
| 11AC20MIMO | Ant0 | 5785 | 18.88 | 5775.56 | 5794.44 | --- | --- |
| 11AC20MIMO | Ant2 | 5785 | 19.16 | 5775.40 | 5794.56 | --- | --- |
| 11AC20MIMO | Ant0 | 5825 | 19.08 | 5815.52 | 5834.60 | --- | --- |
| 11AC20MIMO | Ant2 | 5825 | 19.24 | 5815.28 | 5834.52 | --- | --- |
| 11AC40MIMO | Ant0 | 5190 | 38.32 | 5171.04 | 5209.36 | --- | --- |
| 11AC40MIMO | Ant2 | 5190 | 38.48 | 5170.72 | 5209.20 | --- | --- |
| 11AC40MIMO | Ant0 | 5230 | 38.48 | 5210.96 | 5249.44 | --- | --- |
| 11AC40MIMO | Ant2 | 5230 | 38.48 | 5210.80 | 5249.28 | --- | --- |
| 11AC40MIMO | Ant0 | 5755 | 38.32 | 5735.88 | 5774.20 | --- | --- |
| 11AC40MIMO | Ant2 | 5755 | 38.40 | 5735.64 | 5774.04 | --- | --- |
| 11AC40MIMO | Ant0 | 5795 | 38.24 | 5775.88 | 5814.12 | --- | --- |
| 11AC40MIMO | Ant2 | 5795 | 38.40 | 5775.80 | 5814.20 | --- | --- |
| 11AC80MIMO | Ant0 | 5210 | 84.16 | 5167.12 | 5251.28 | --- | --- |
| 11AC80MIMO | Ant2 | 5210 | 80.32 | 5169.84 | 5250.16 | --- | --- |
| 11AC80MIMO | Ant0 | 5775 | 84.00 | 5732.92 | 5816.92 | --- | --- |
| 11AC80MIMO | Ant2 | 5775 | 84.96 | 5732.28 | 5817.24 | --- | --- |
| 11AX20MIMO | Ant0 | 5180 | 20.08 | 5169.96 | 5190.04 | --- | --- |
| 11AX20MIMO | Ant2 | 5180 | 19.96 | 5170.00 | 5189.96 | --- | --- |
| 11AX20MIMO | Ant0 | 5200 | 20.08 | 5189.96 | 5210.04 | --- | --- |
| 11AX20MIMO | Ant2 | 5200 | 20.16 | 5189.96 | 5210.12 | --- | --- |
| 11AX20MIMO | Ant0 | 5240 | 20.04 | 5229.92 | 5249.96 | --- | --- |
| 11AX20MIMO | Ant2 | 5240 | 20.04 | 5230.00 | 5250.04 | --- | --- |
| 11AX20MIMO | Ant0 | 5745 | 19.96 | 5735.08 | 5755.04 | --- | --- |
| 11AX20MIMO | Ant2 | 5745 | 20.08 | 5734.92 | 5755.00 | --- | --- |
| 11AX20MIMO | Ant0 | 5785 | 19.96 | 5775.00 | 5794.96 | --- | --- |
| 11AX20MIMO | Ant2 | 5785 | 19.96 | 5775.00 | 5794.96 | --- | --- |
| 11AX20MIMO | Ant0 | 5825 | 19.96 | 5815.00 | 5834.96 | --- | --- |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


|            |      |      |       |         |         |     |     |
|------------|------|------|-------|---------|---------|-----|-----|
| 11AX20MIMO | Ant2 | 5825 | 20.12 | 5815.00 | 5835.12 | --- | --- |
| 11AX40MIMO | Ant0 | 5190 | 39.44 | 5170.24 | 5209.68 | --- | --- |
| 11AX40MIMO | Ant2 | 5190 | 39.44 | 5170.32 | 5209.76 | --- | --- |
| 11AX40MIMO | Ant0 | 5230 | 39.52 | 5210.16 | 5249.68 | --- | --- |
| 11AX40MIMO | Ant2 | 5230 | 39.28 | 5210.32 | 5249.60 | --- | --- |
| 11AX40MIMO | Ant0 | 5755 | 39.36 | 5735.24 | 5774.60 | --- | --- |
| 11AX40MIMO | Ant2 | 5755 | 39.28 | 5735.32 | 5774.60 | --- | --- |
| 11AX40MIMO | Ant0 | 5795 | 39.36 | 5775.24 | 5814.60 | --- | --- |
| 11AX40MIMO | Ant2 | 5795 | 39.28 | 5775.32 | 5814.60 | --- | --- |
| 11AX80MIMO | Ant0 | 5210 | 80.32 | 5169.84 | 5250.16 | --- | --- |
| 11AX80MIMO | Ant2 | 5210 | 80.32 | 5169.84 | 5250.16 | --- | --- |
| 11AX80MIMO | Ant0 | 5775 | 80.32 | 5734.84 | 5815.16 | --- | --- |
| 11AX80MIMO | Ant2 | 5775 | 80.80 | 5734.84 | 5815.64 | --- | --- |


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Test Graphs

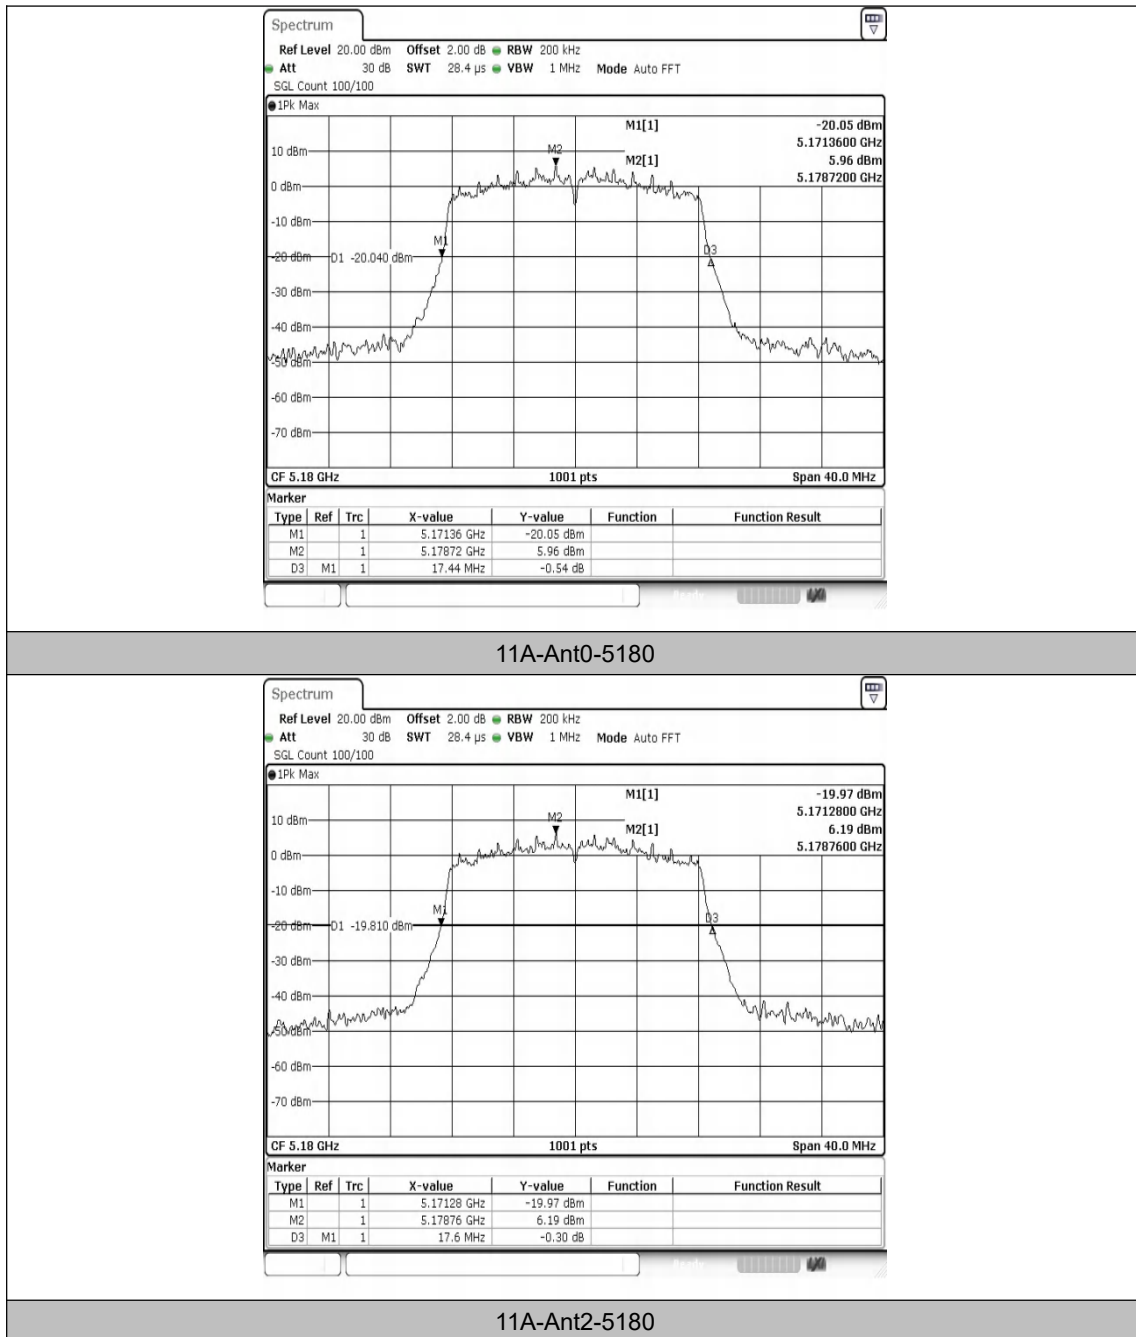

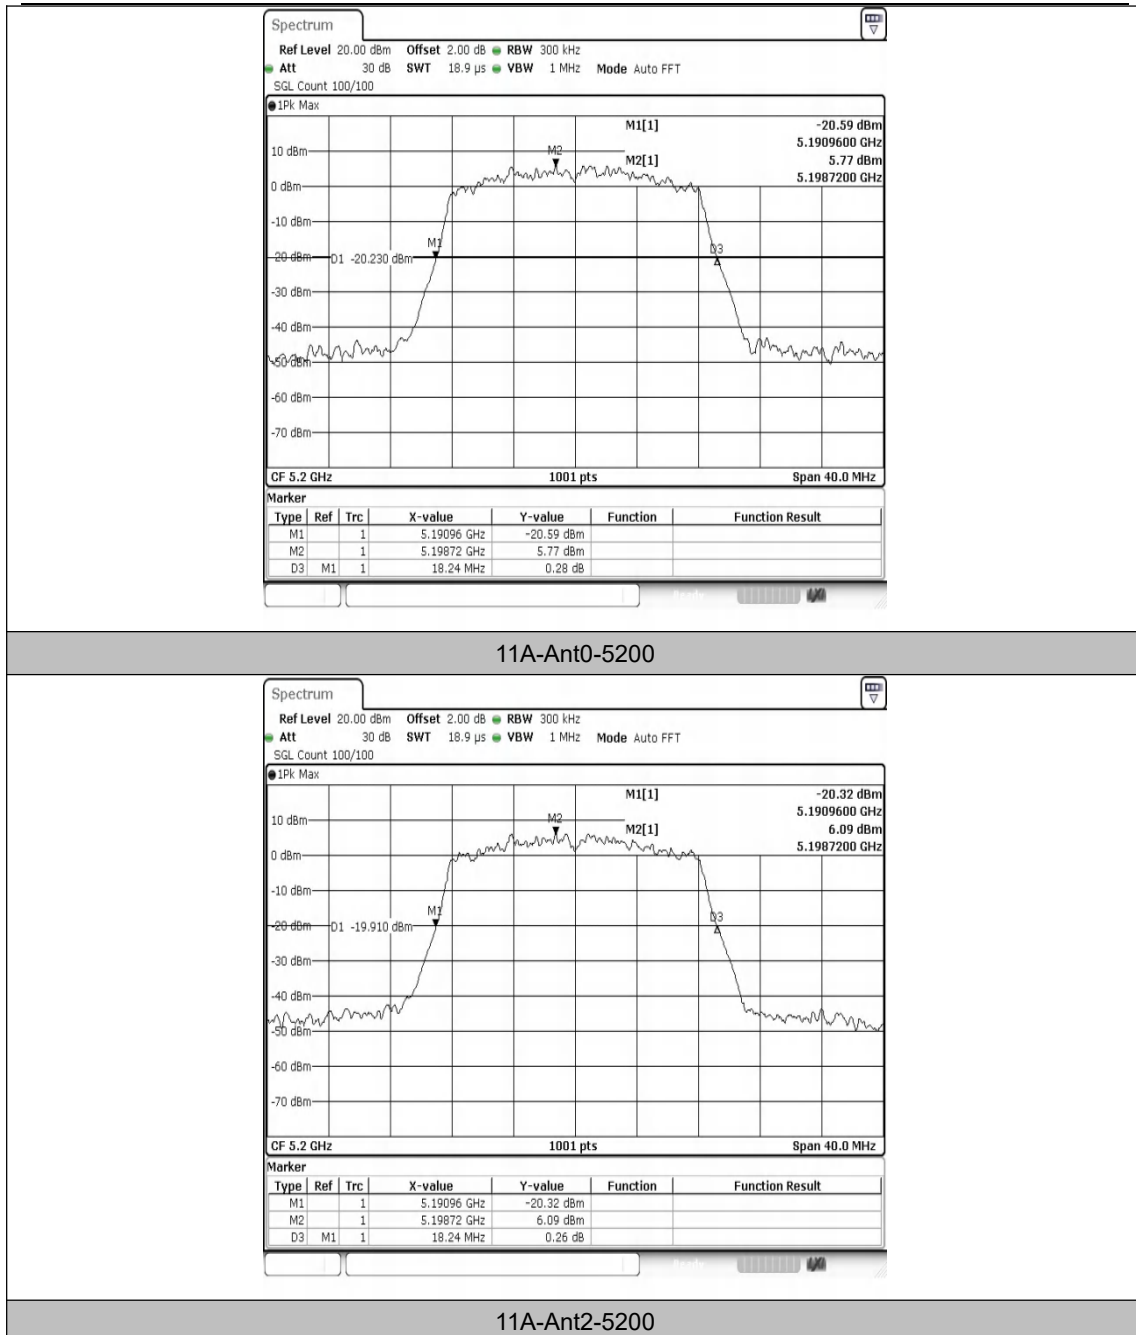


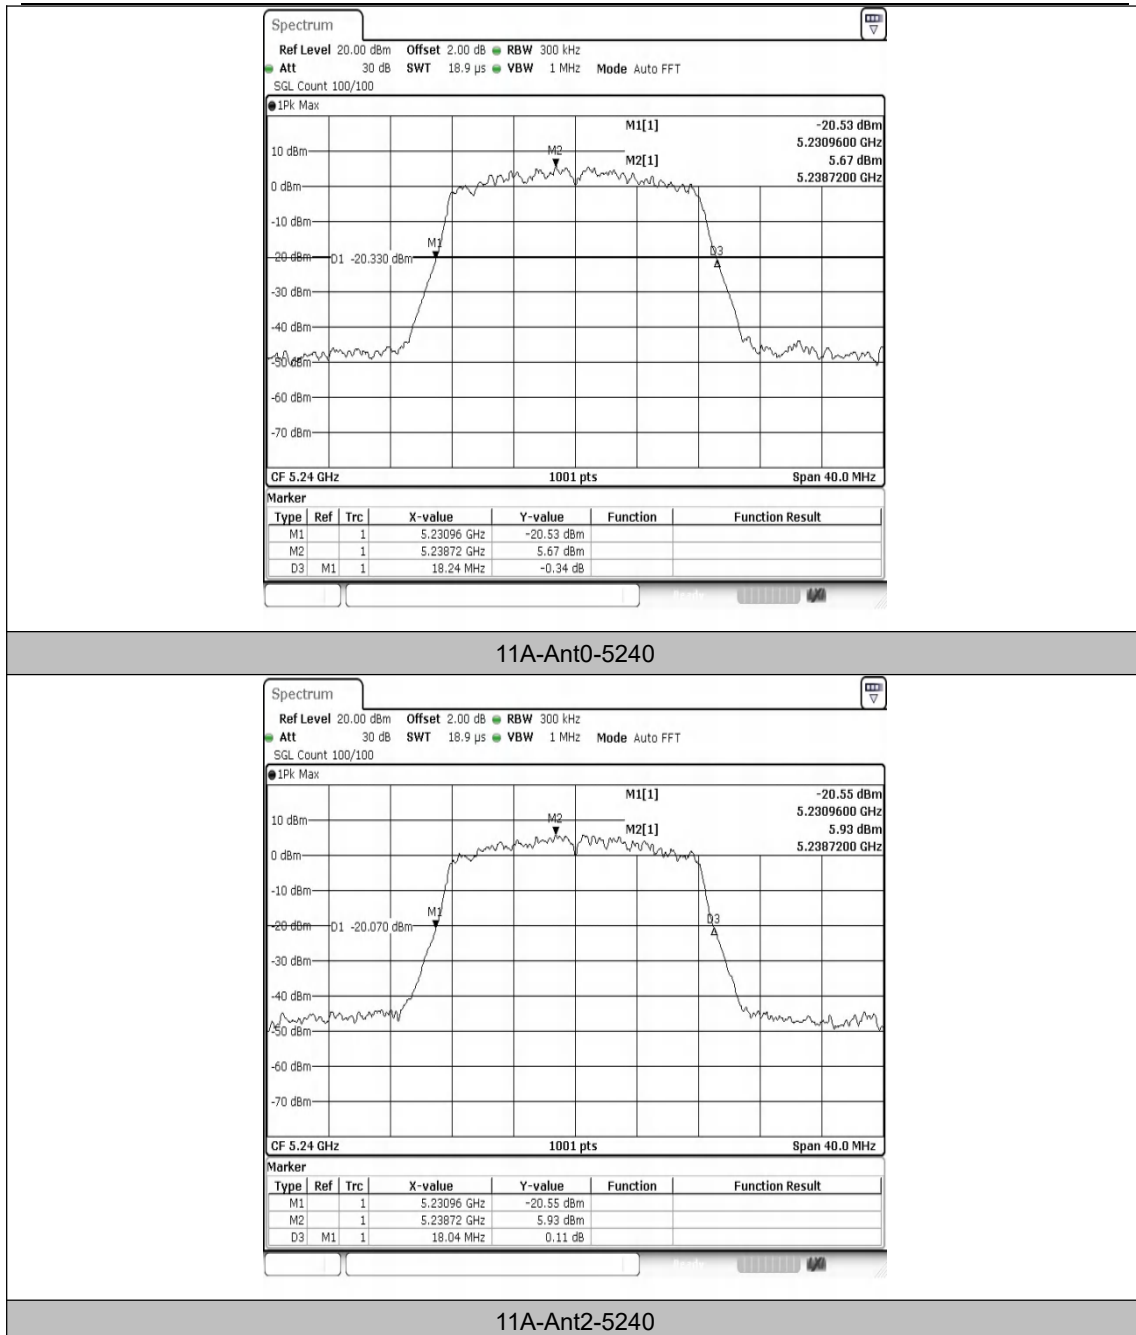


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

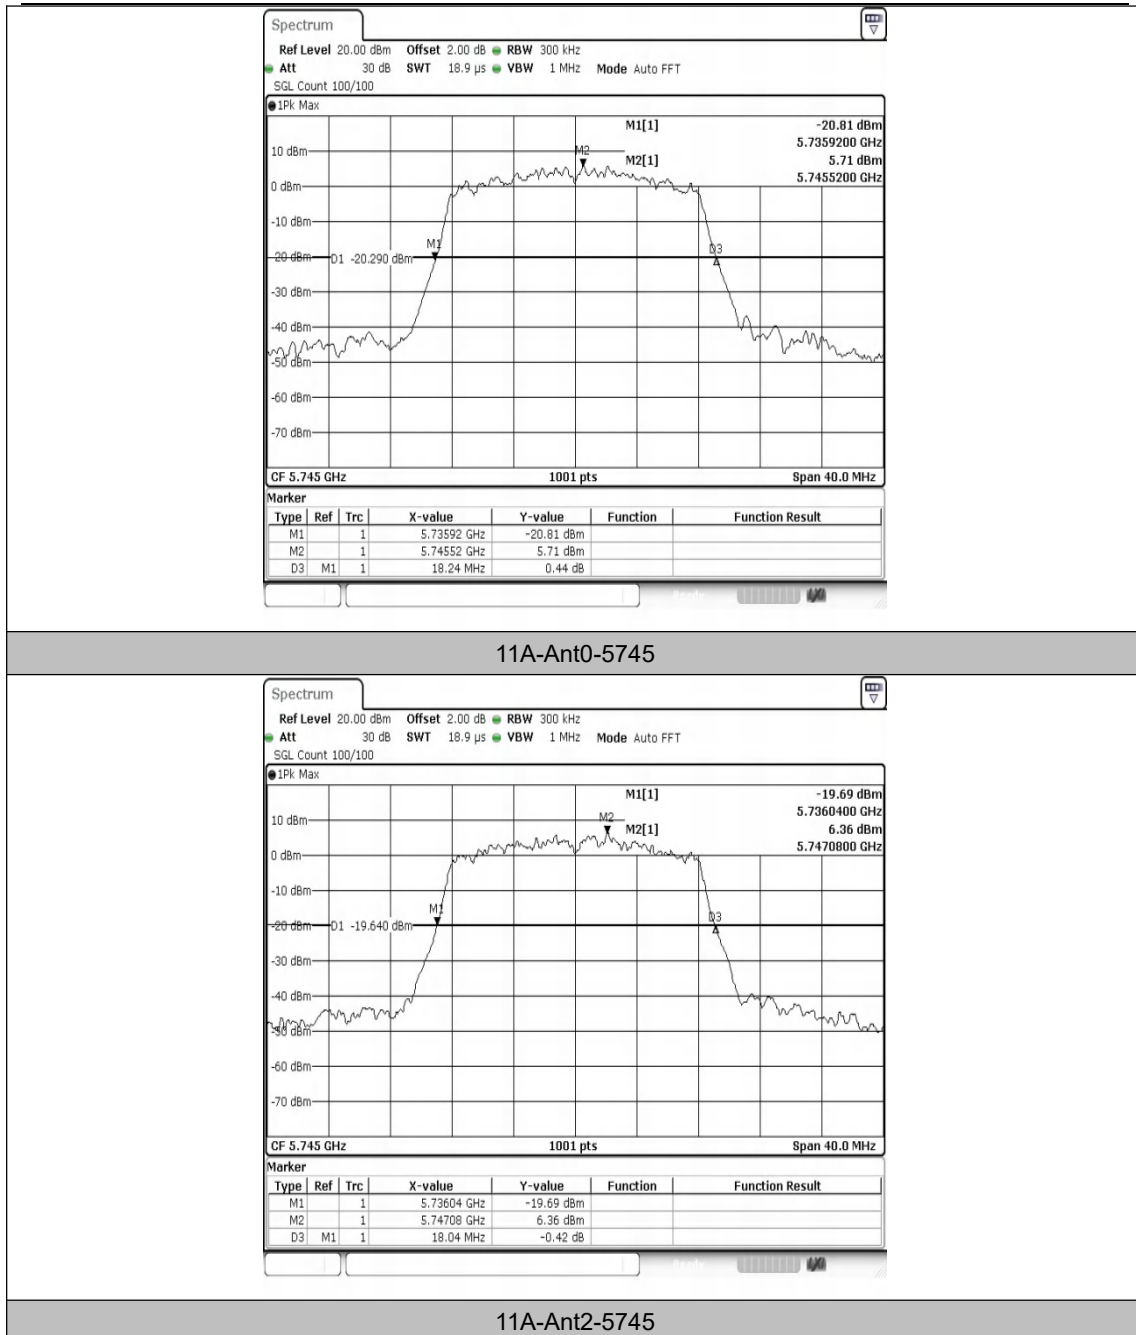



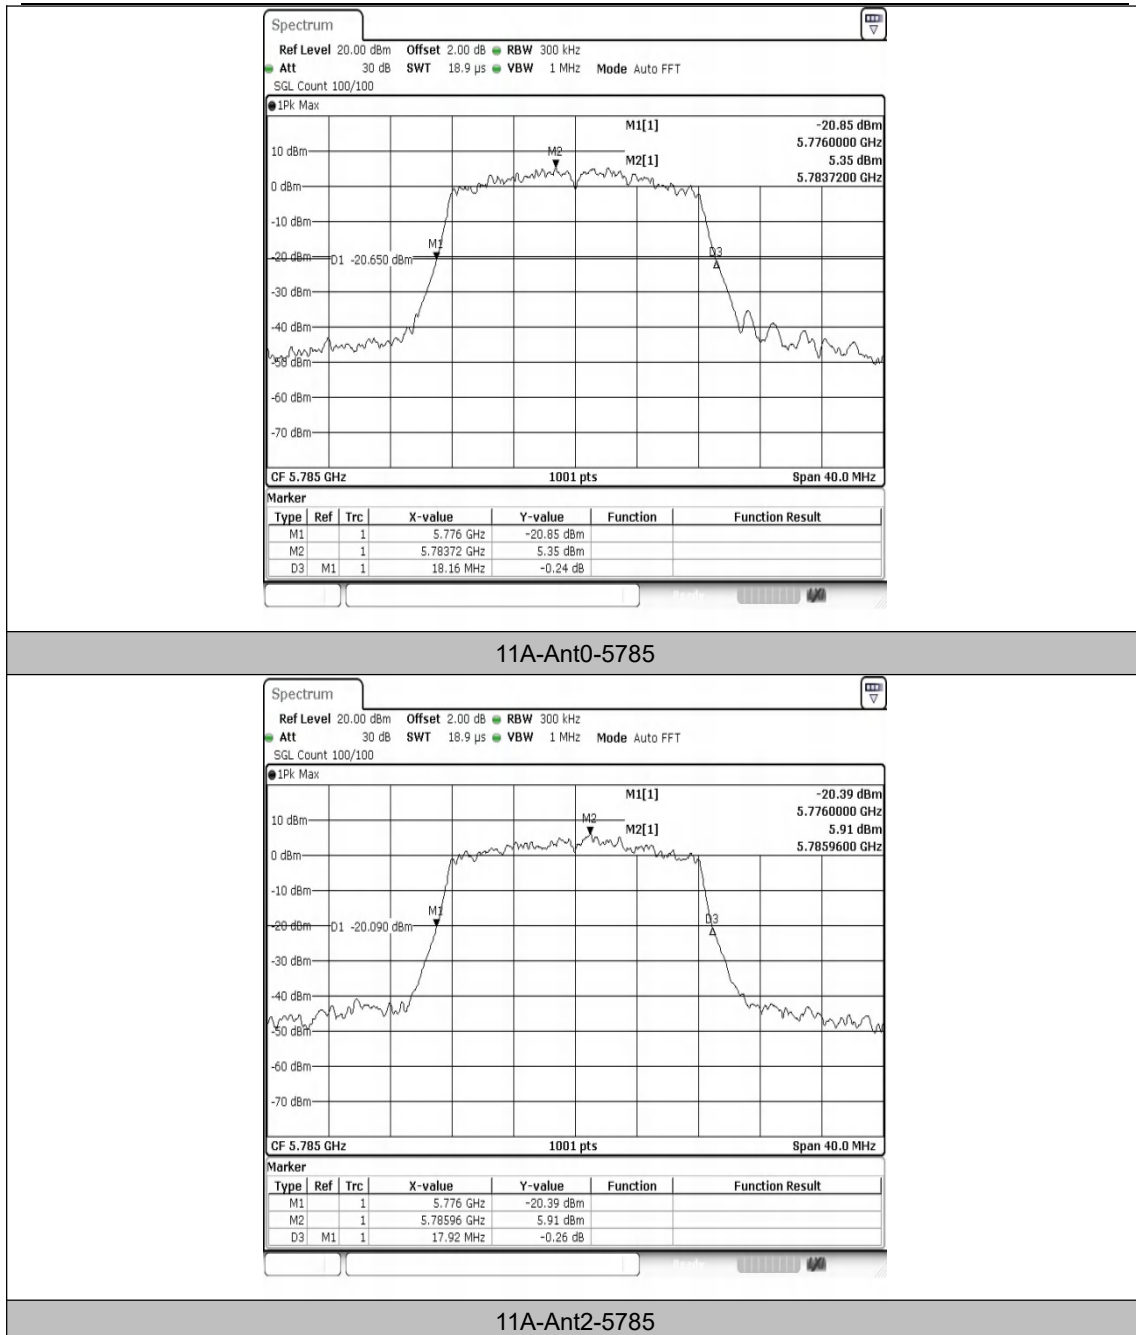


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)




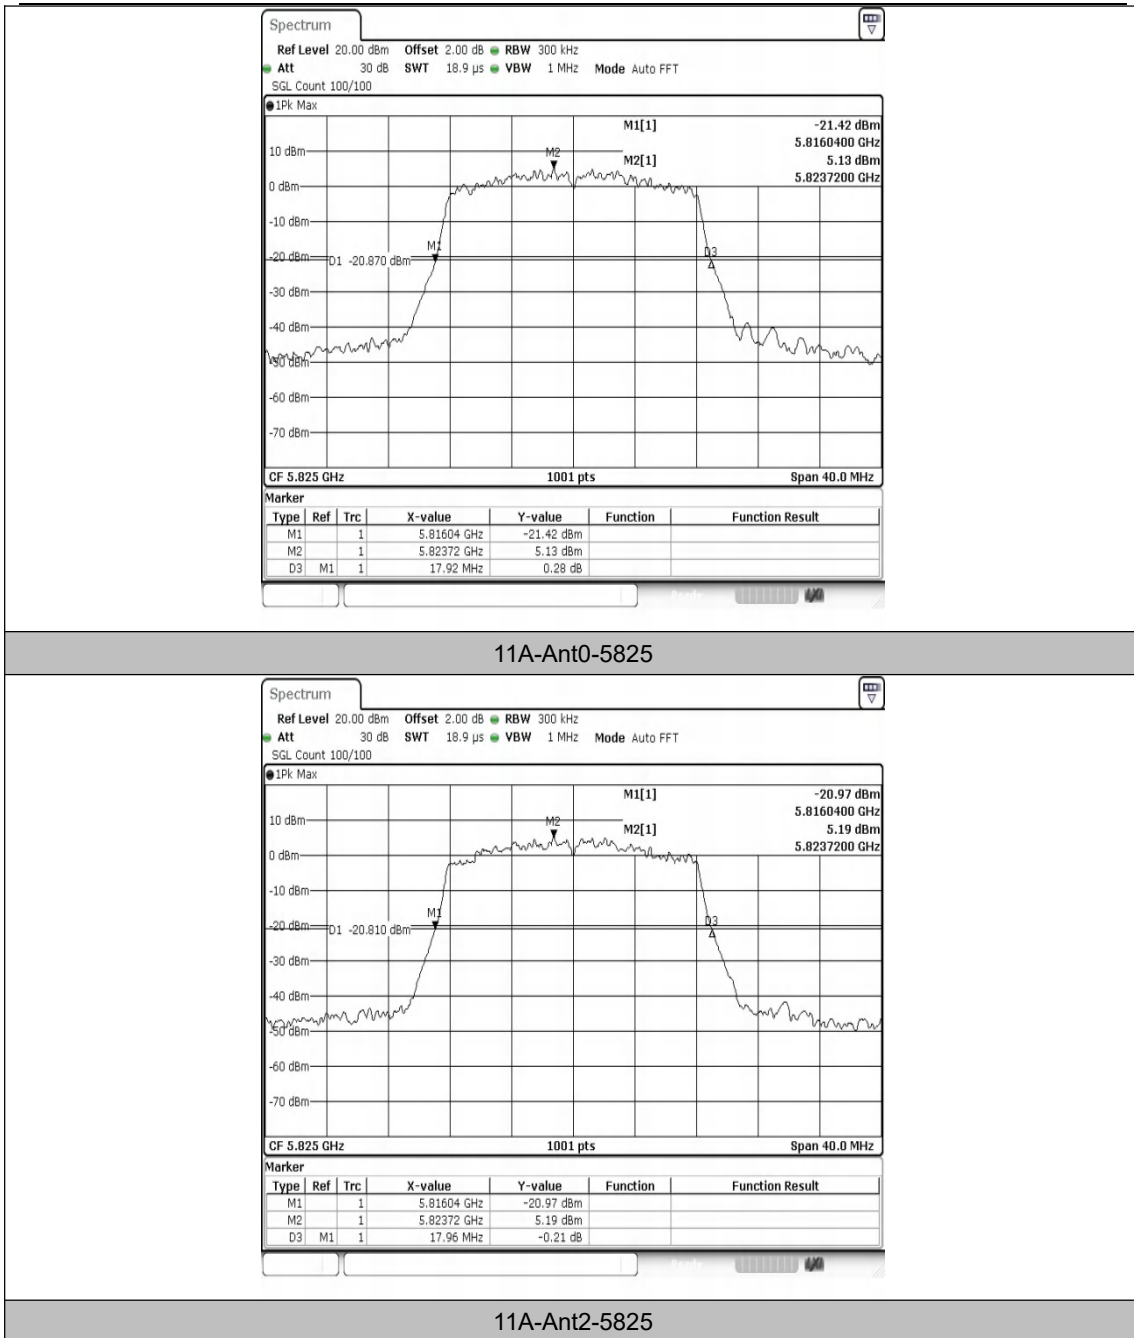

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

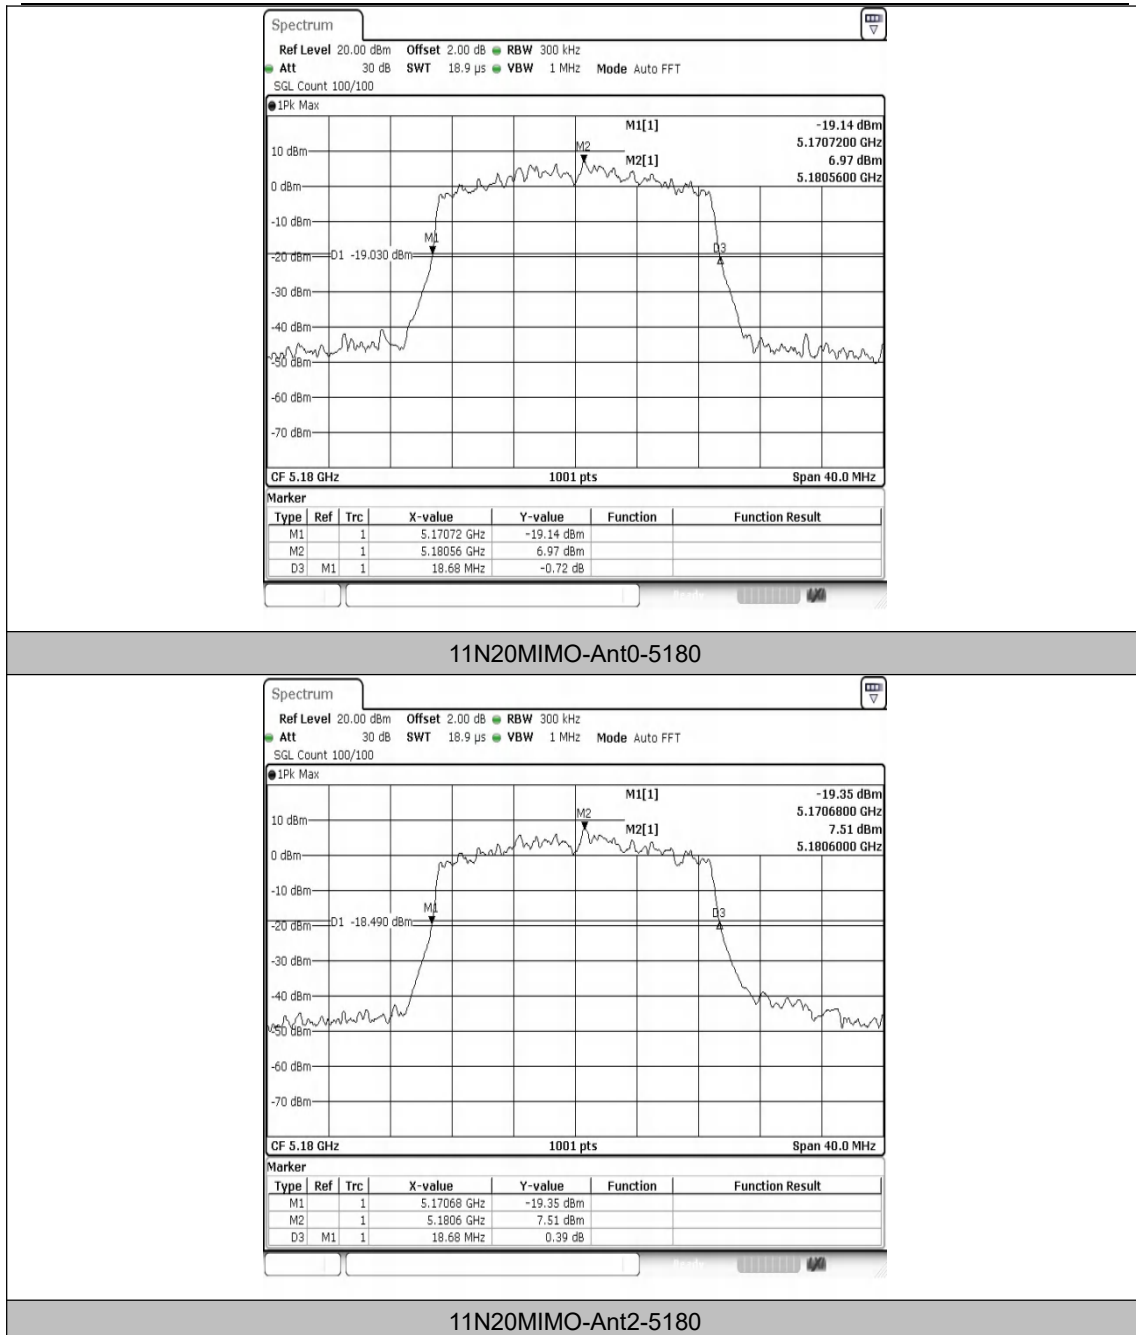

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

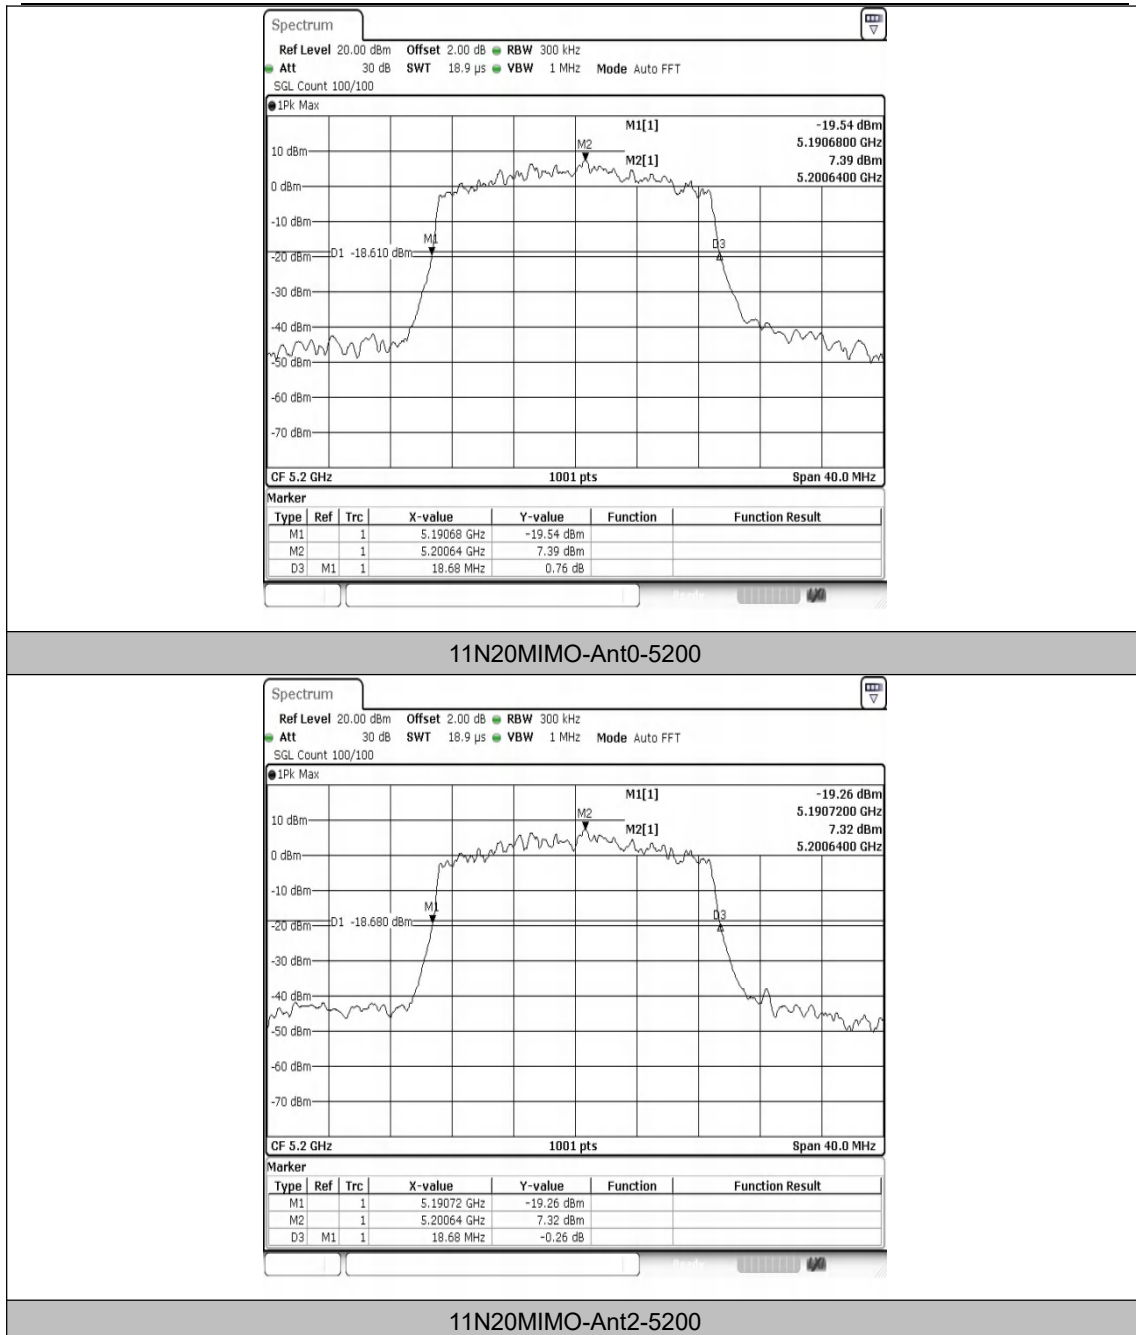

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

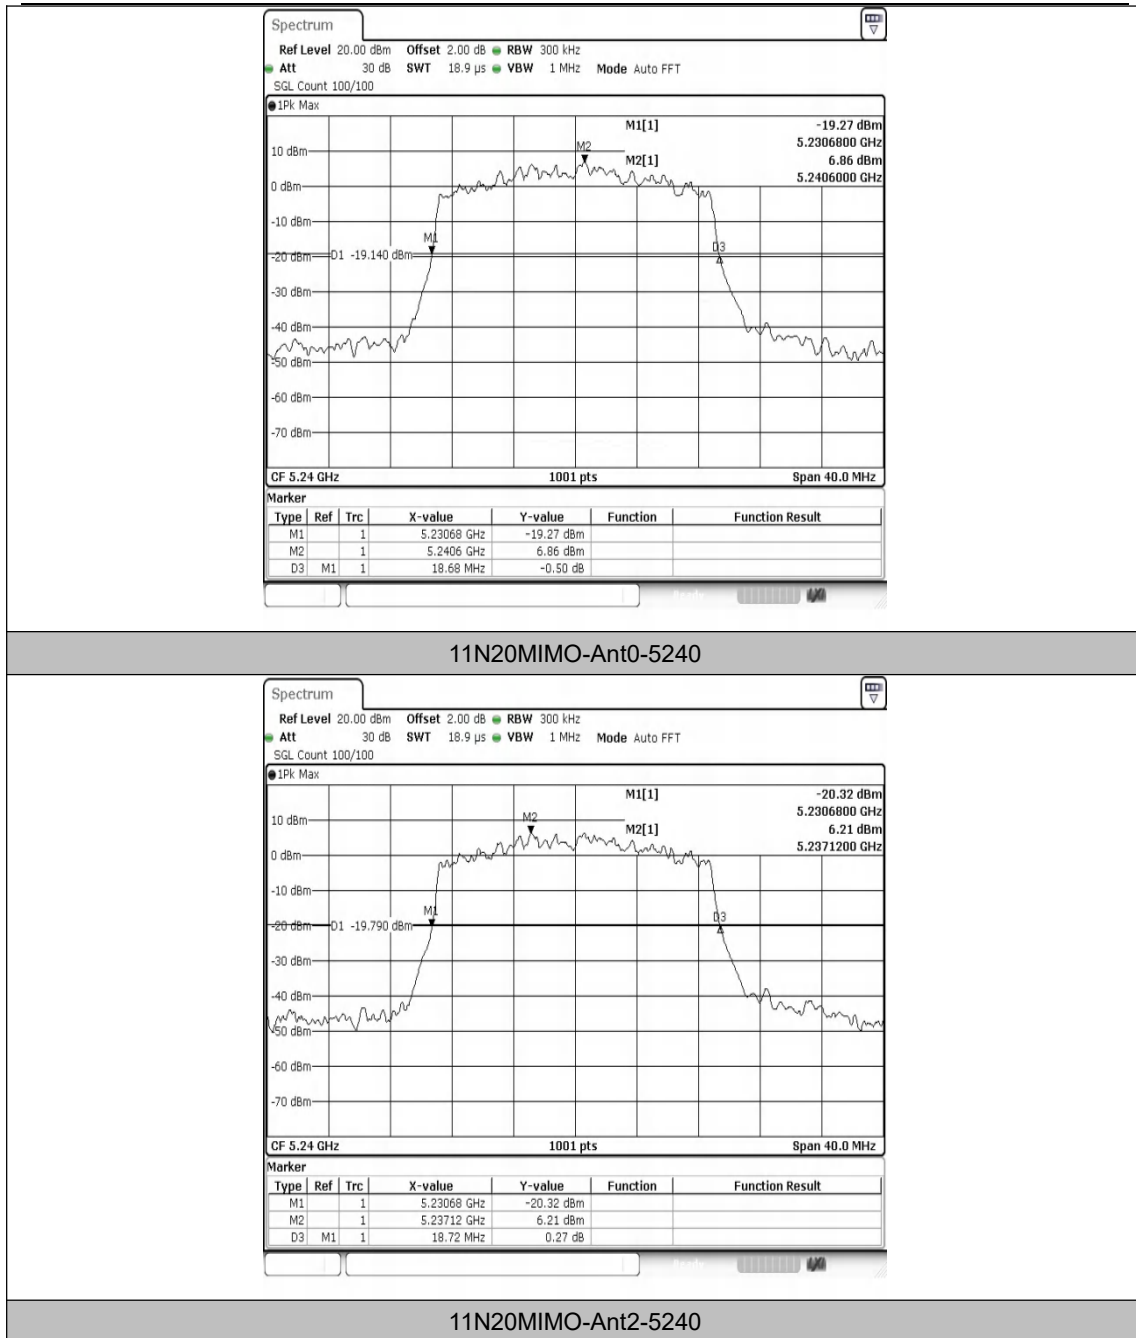



#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

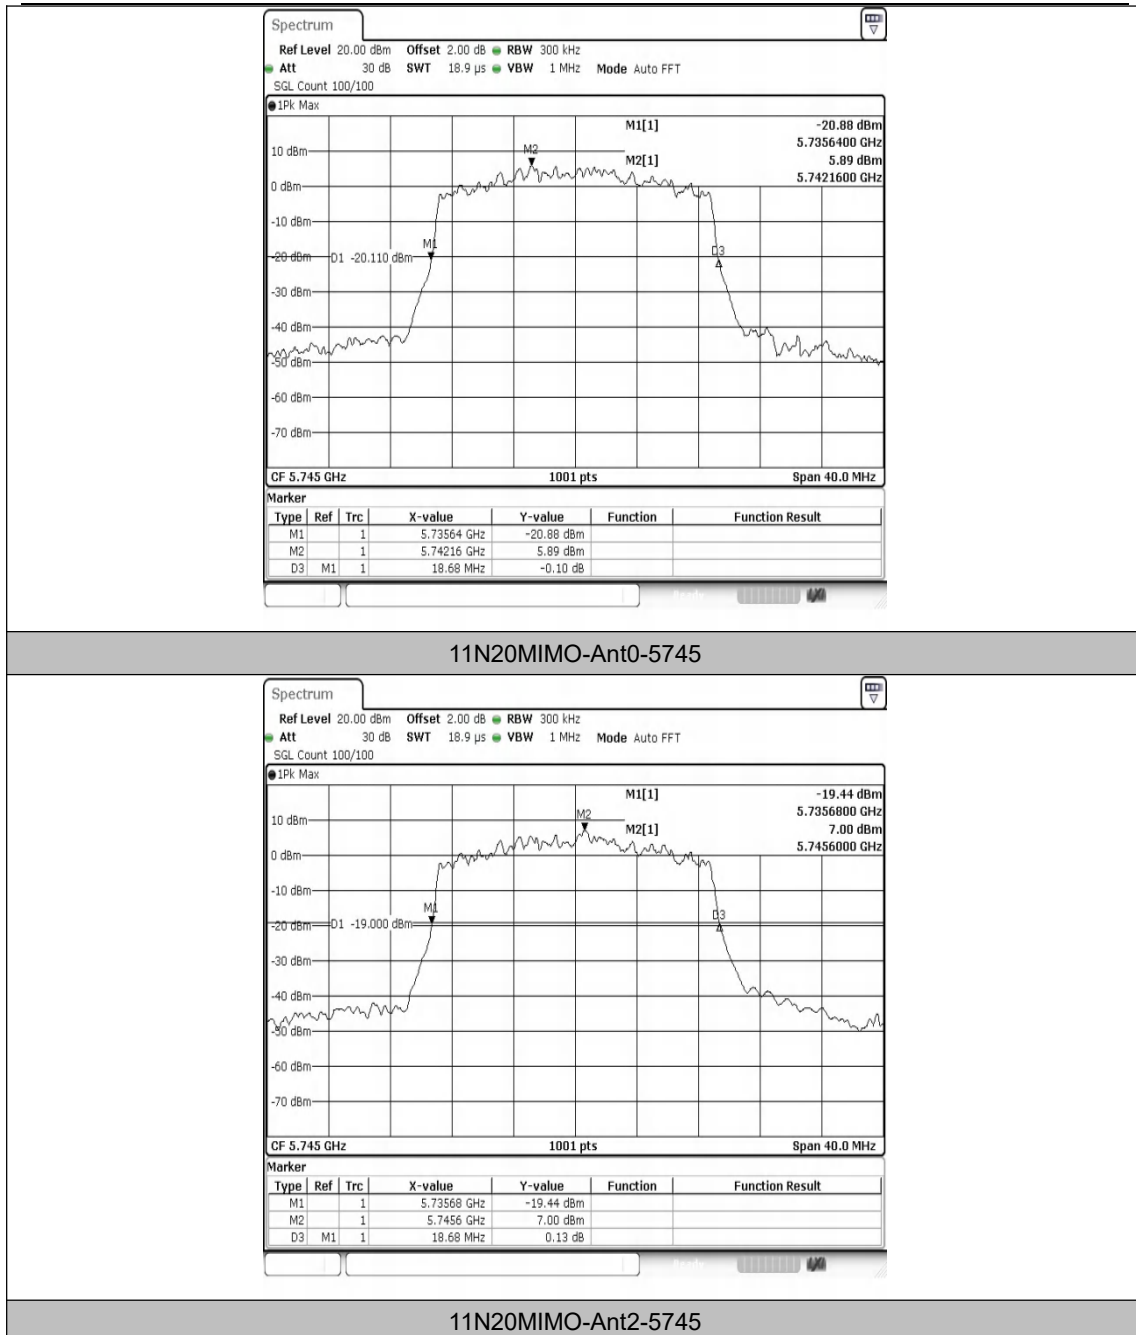

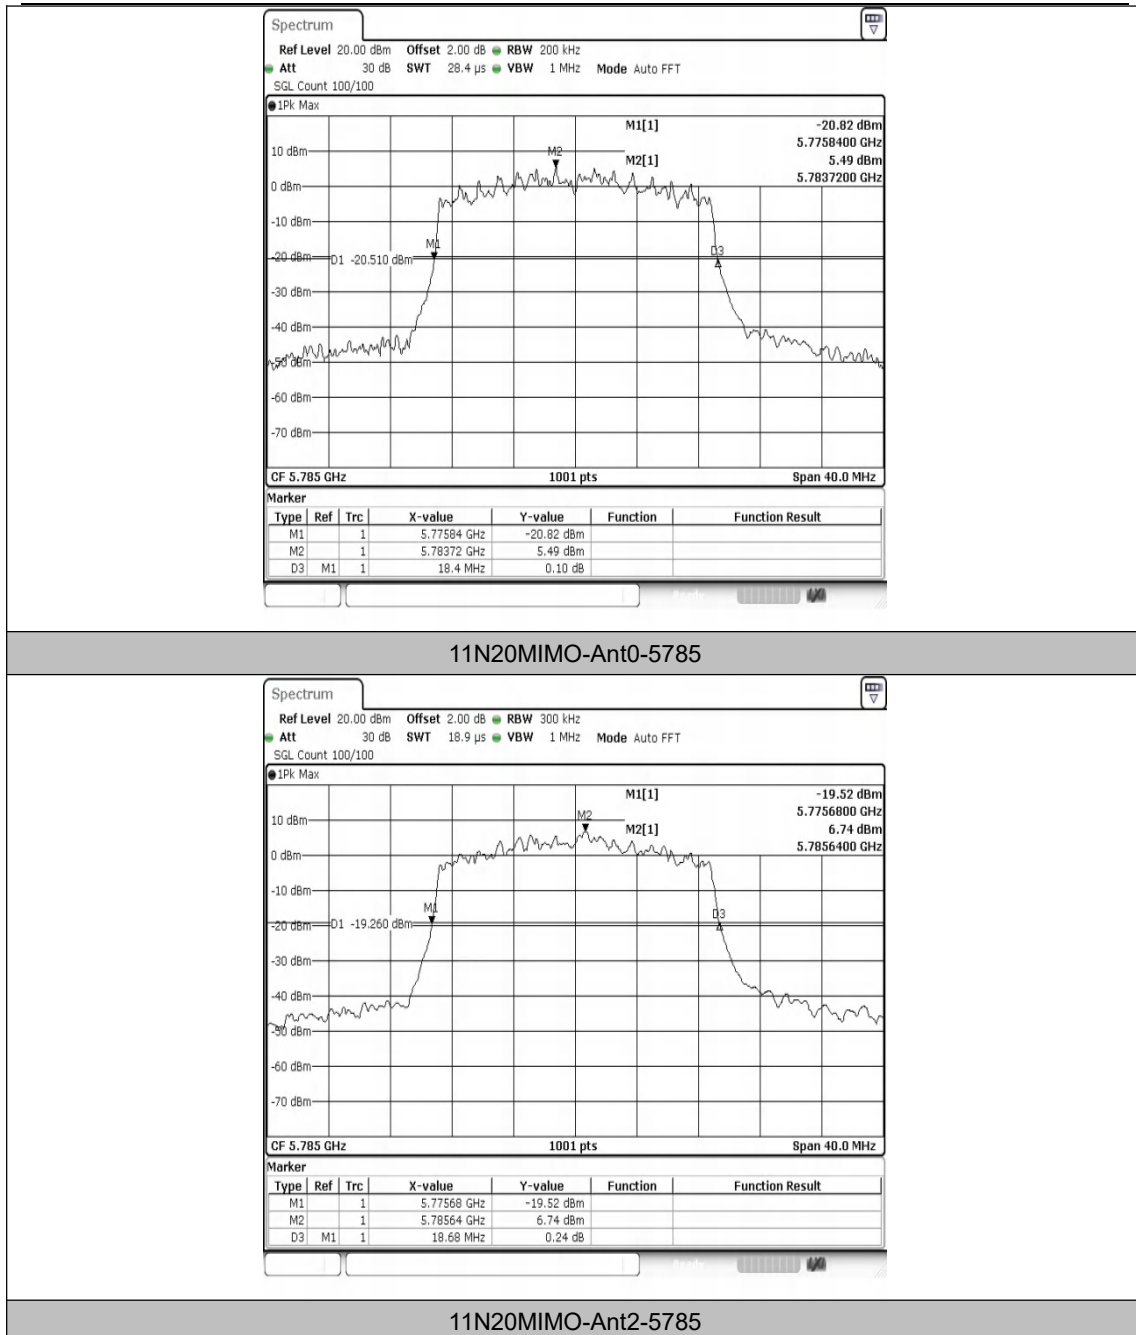

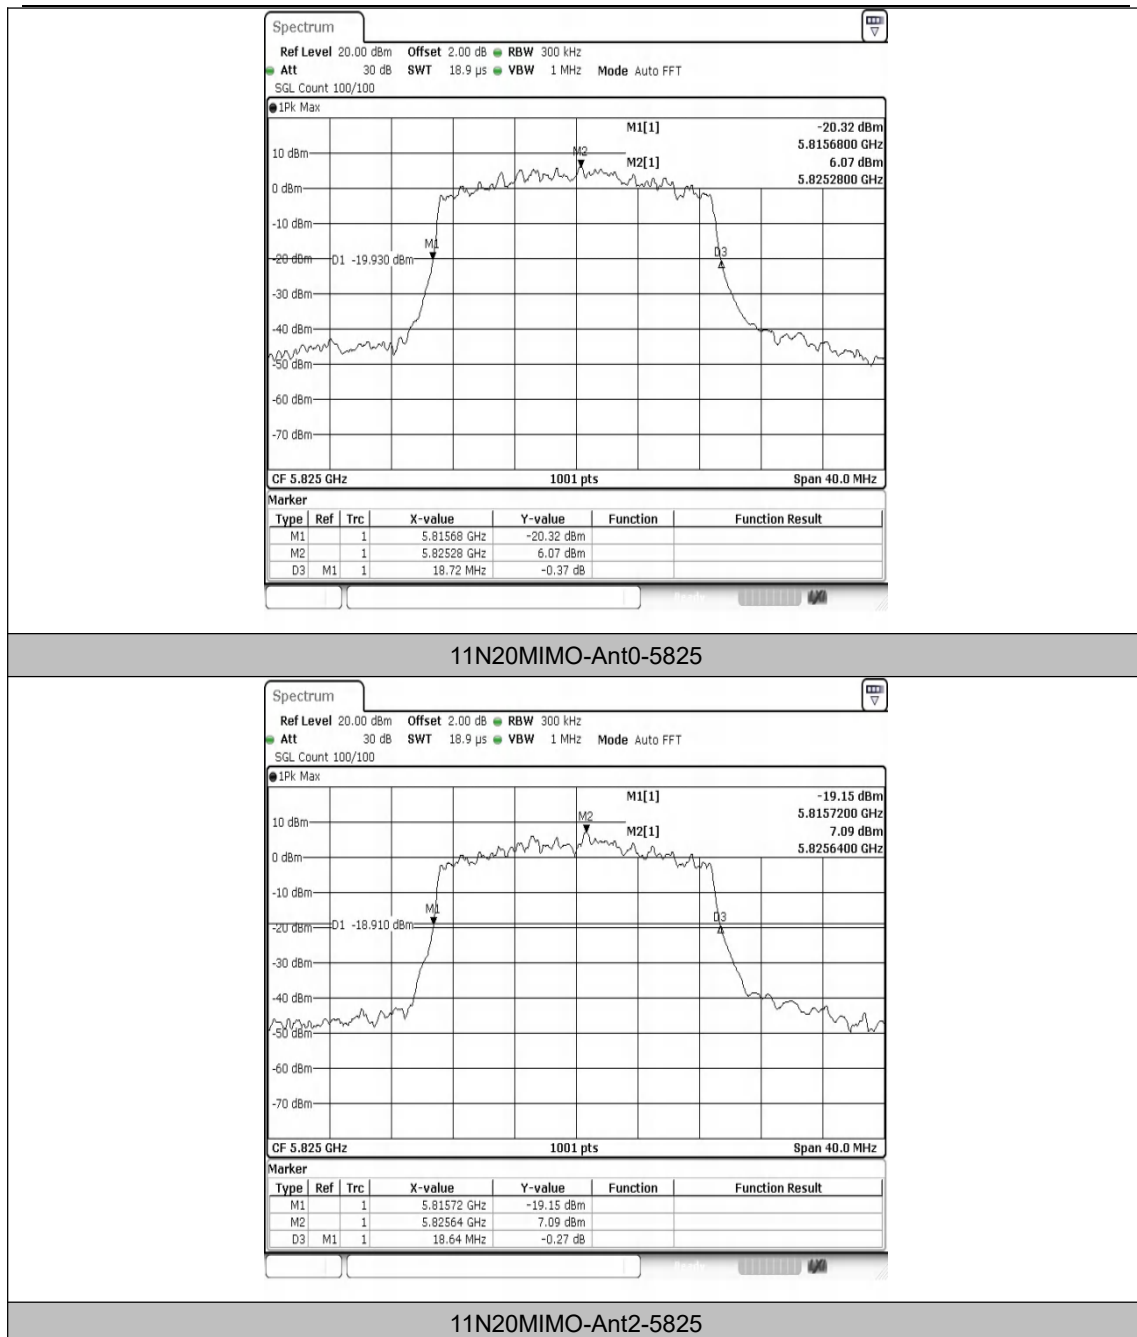


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)




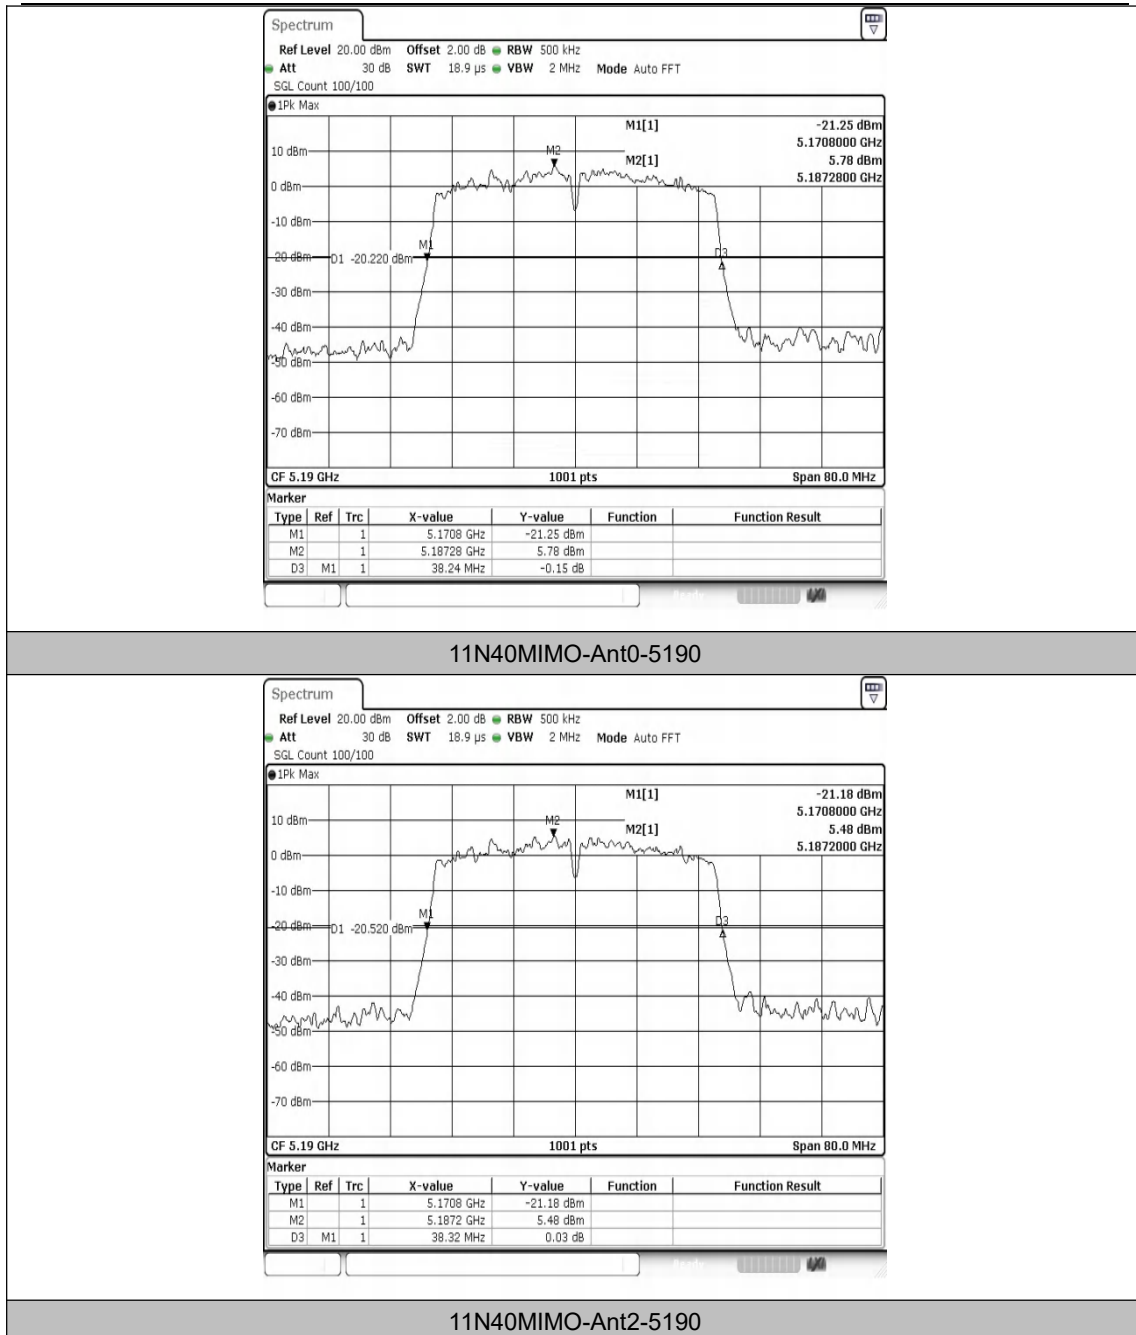


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

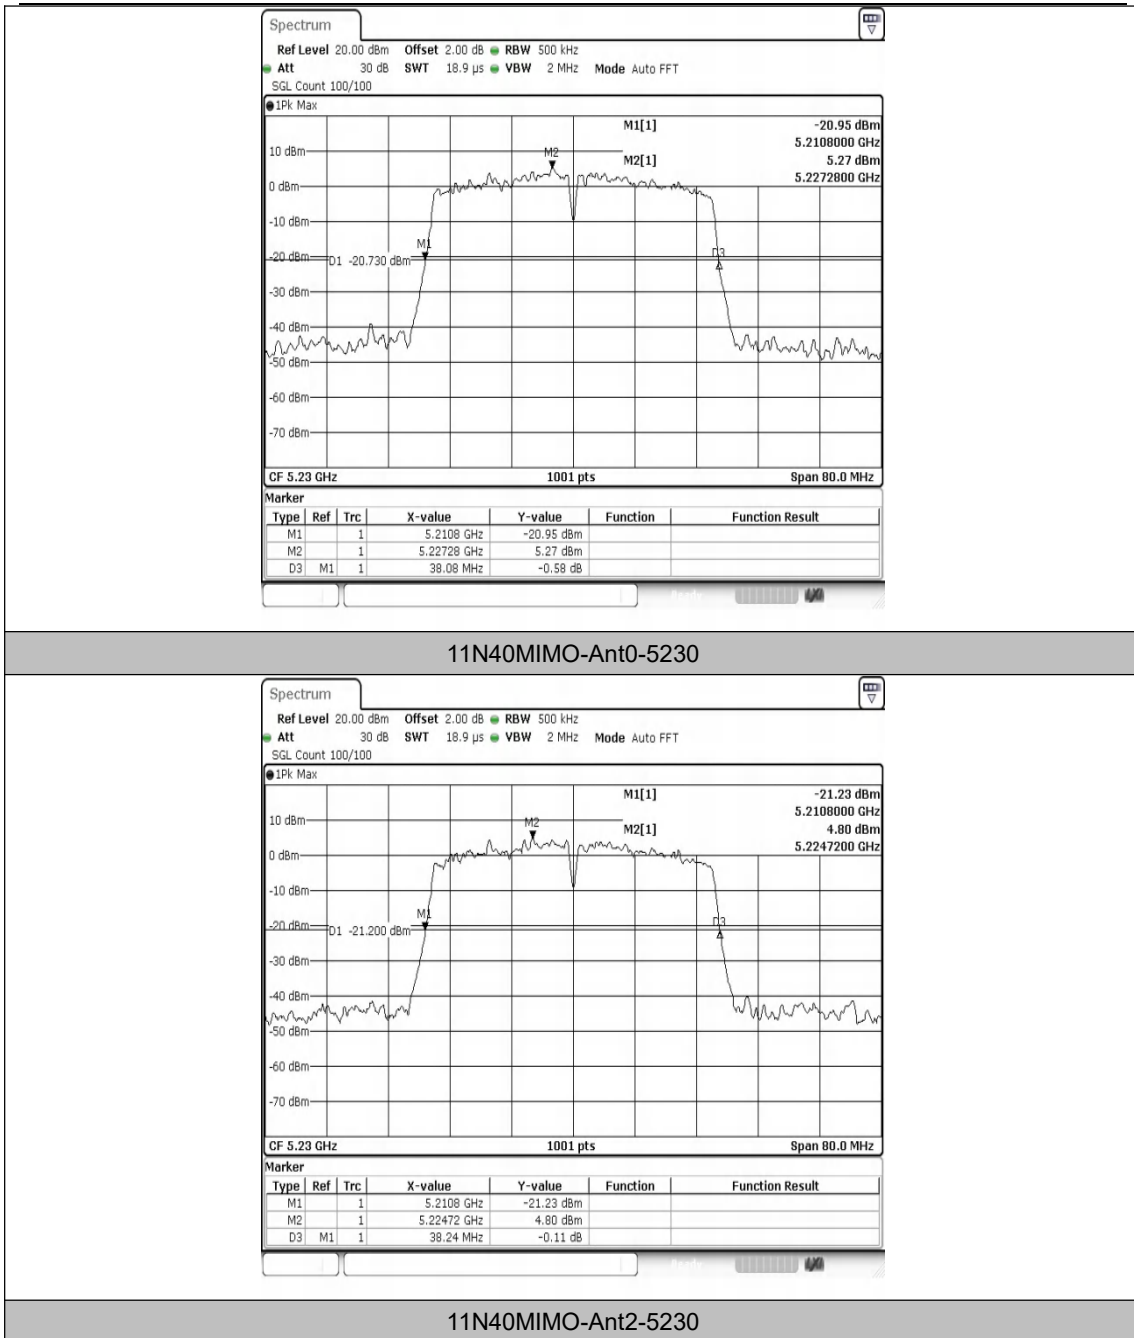


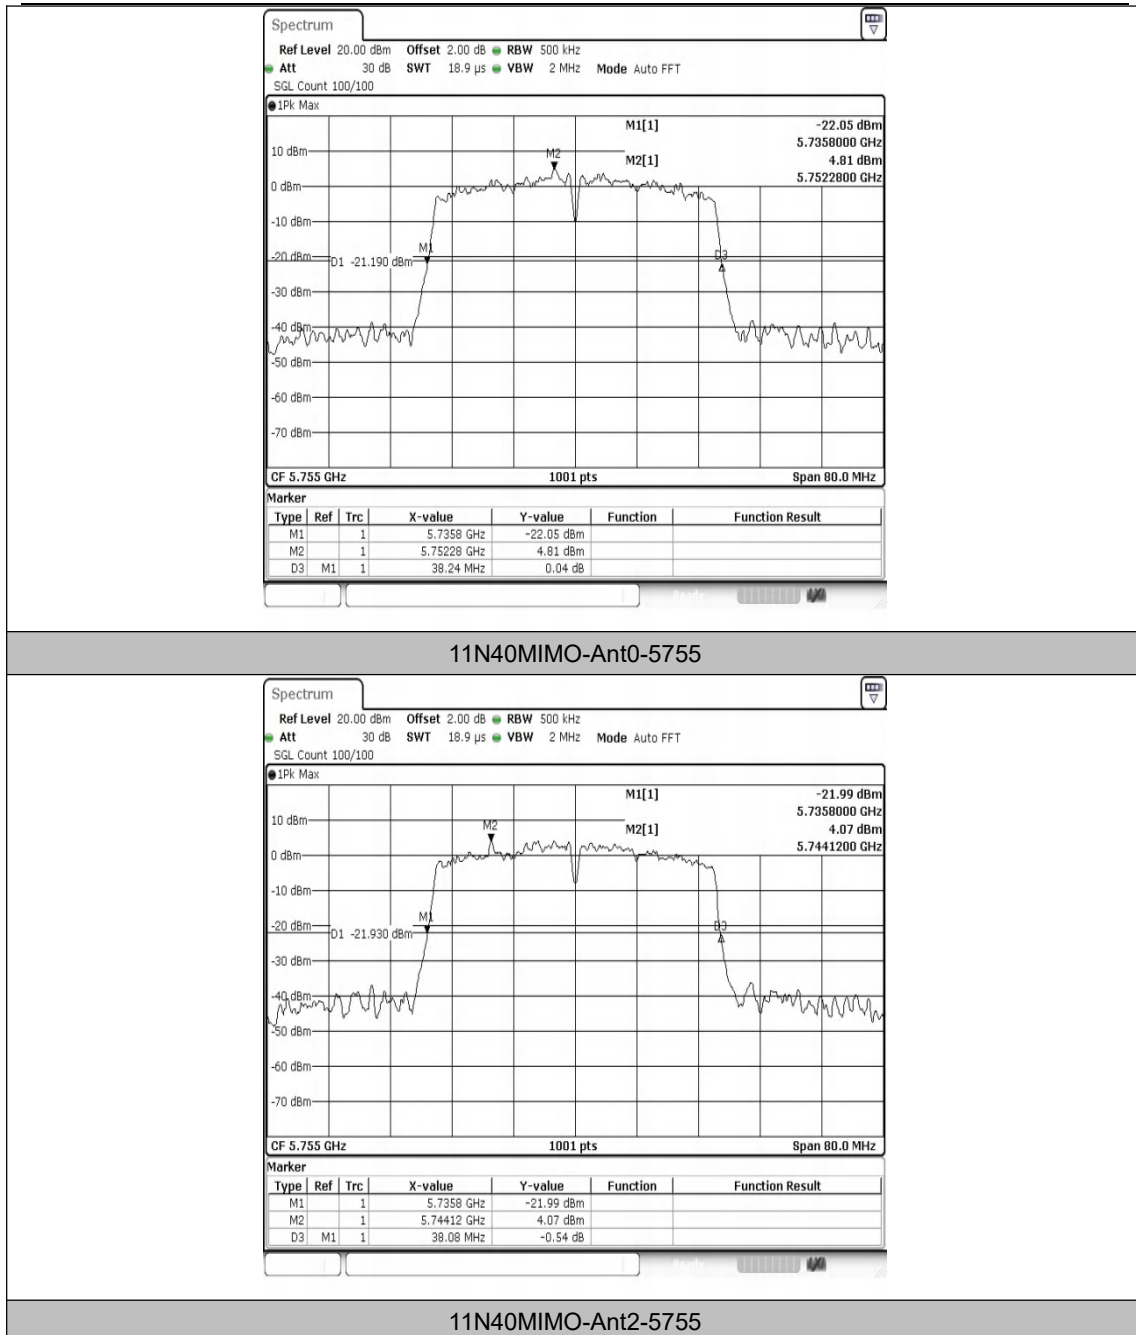

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

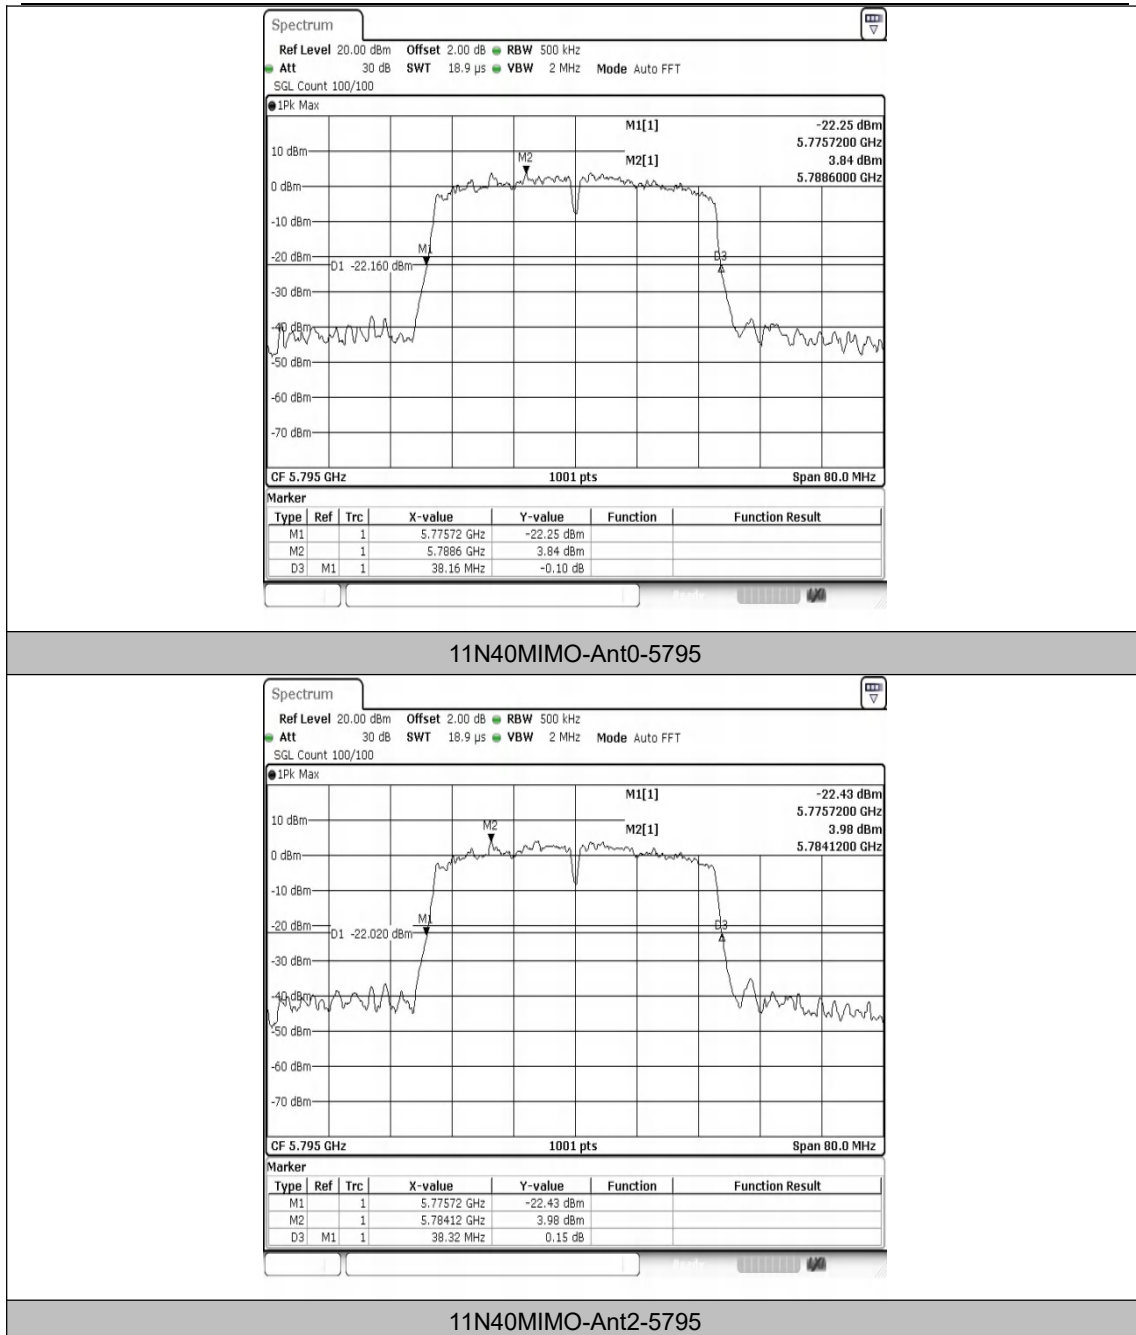

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

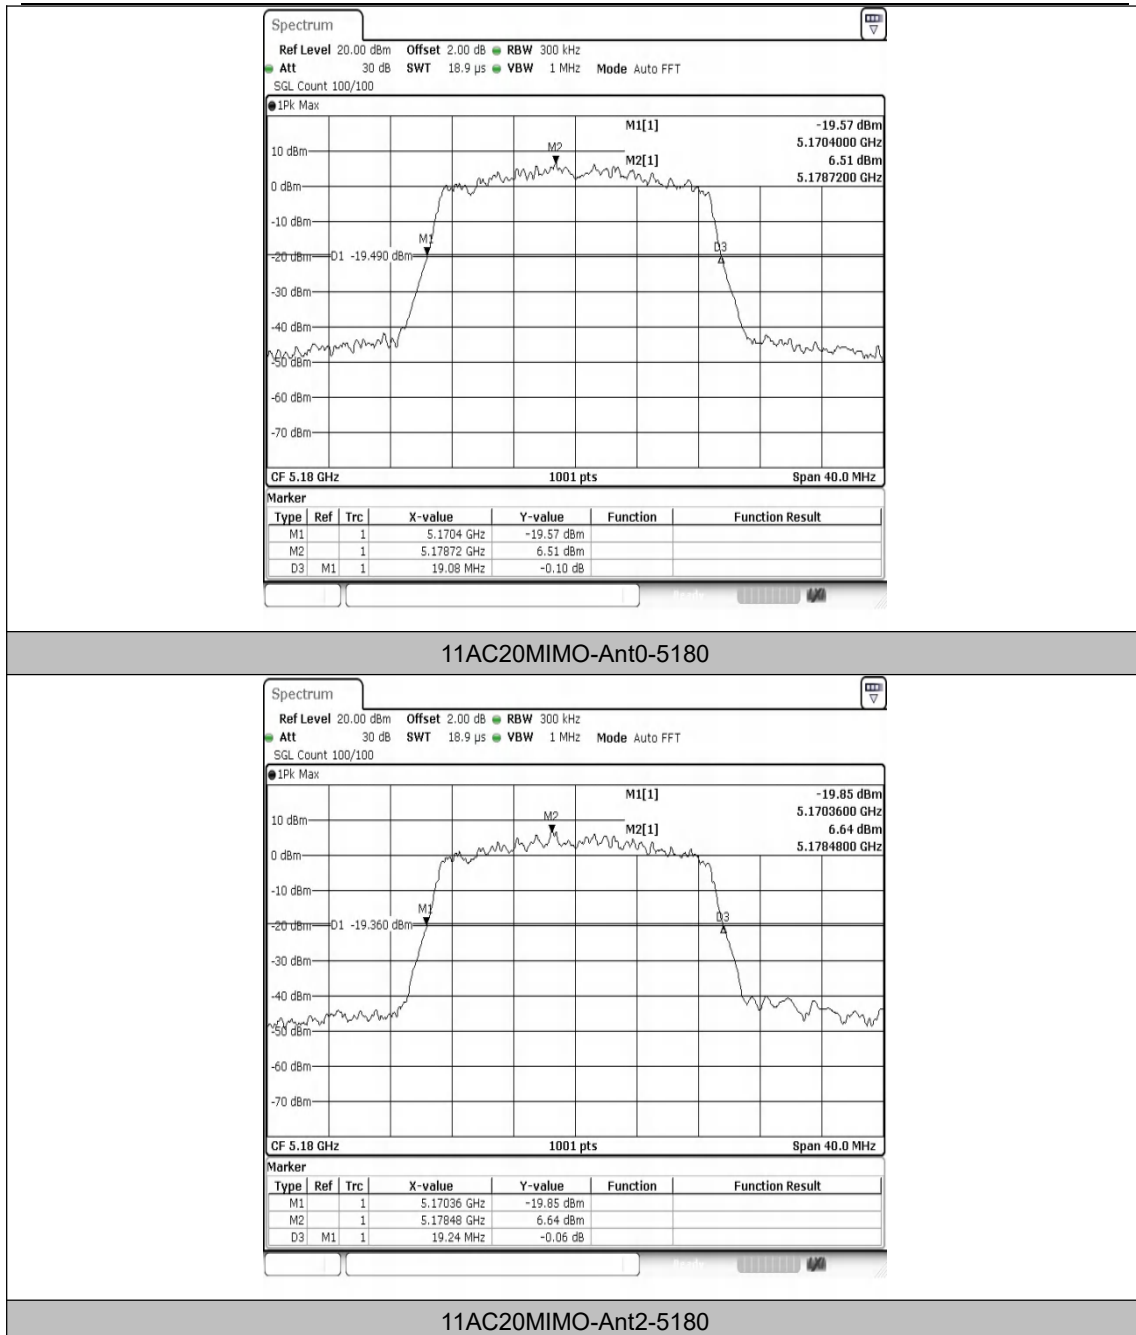


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

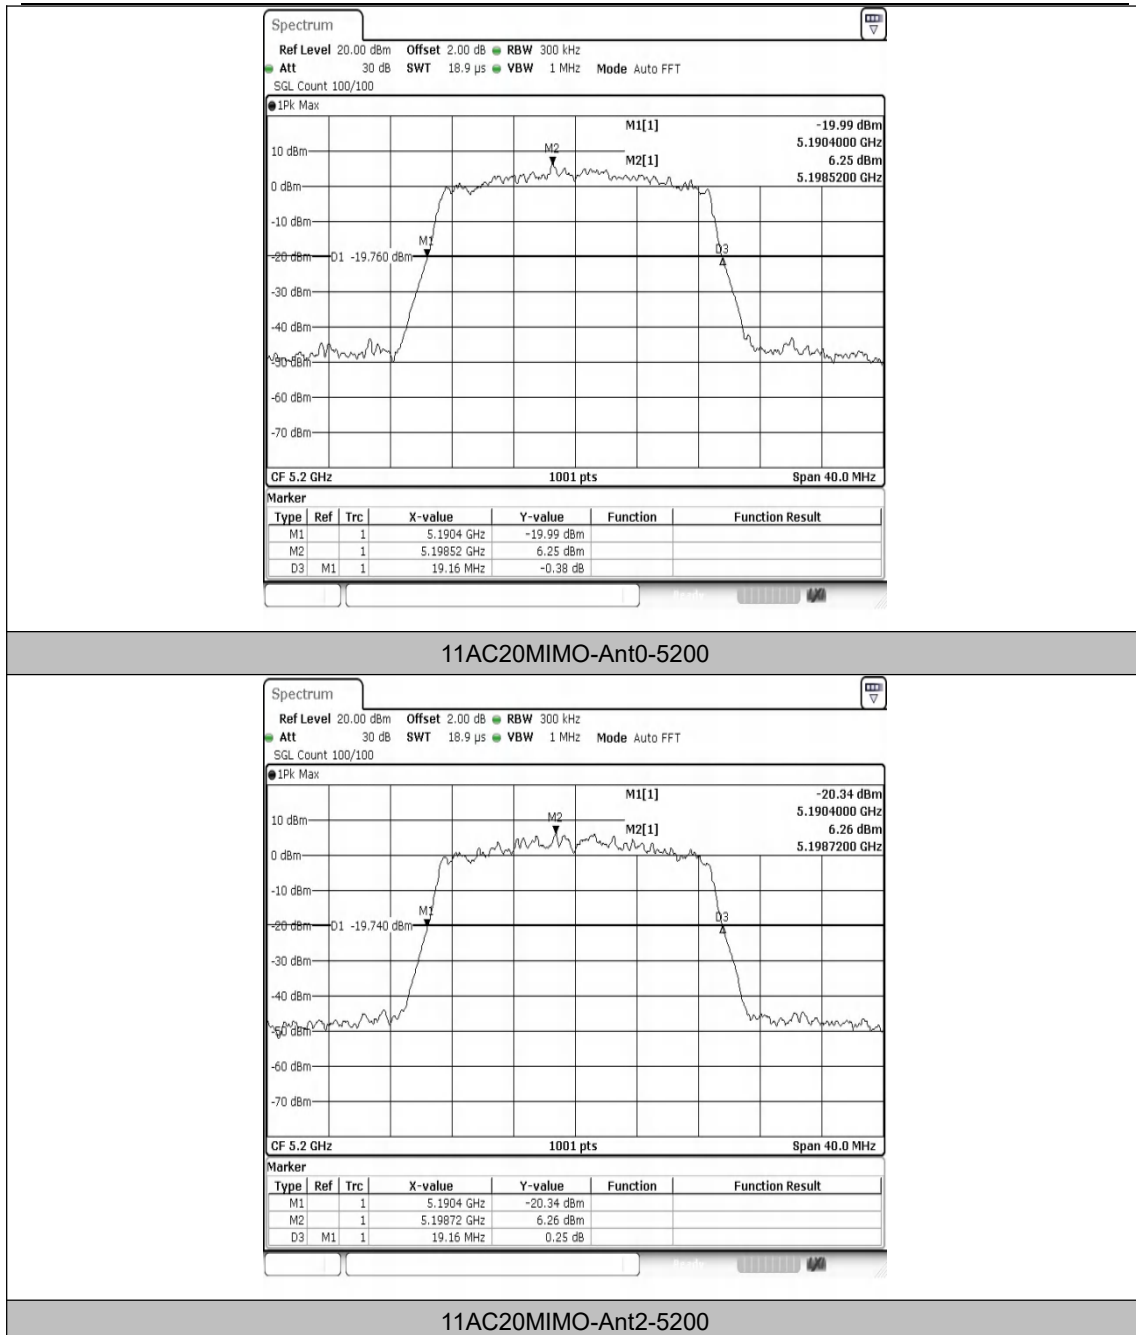

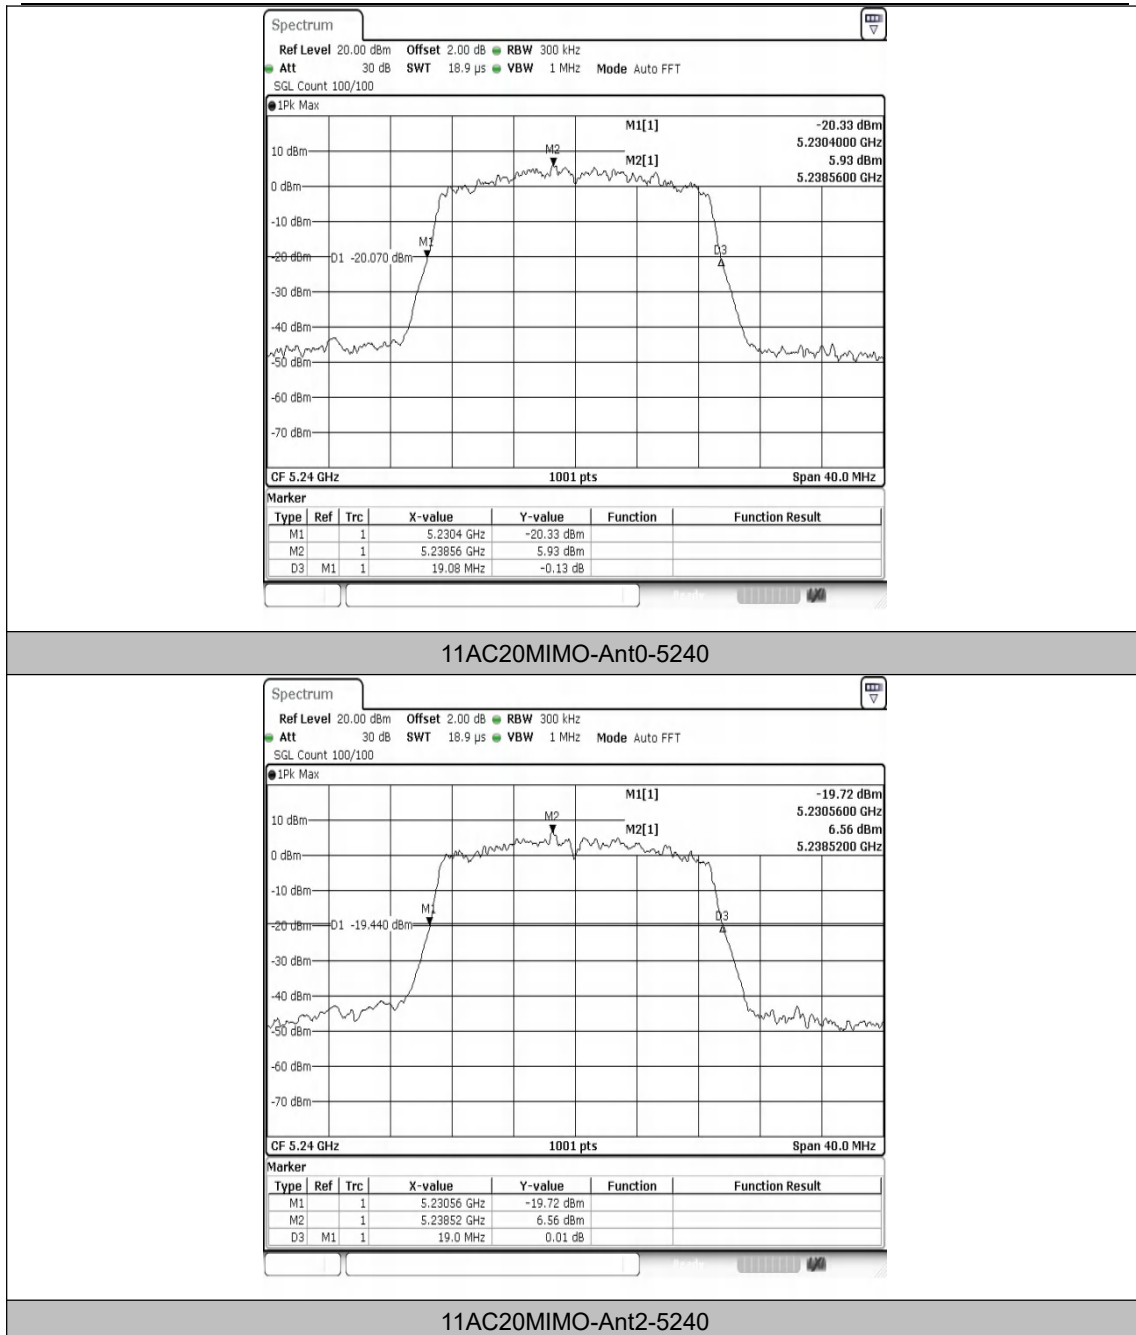



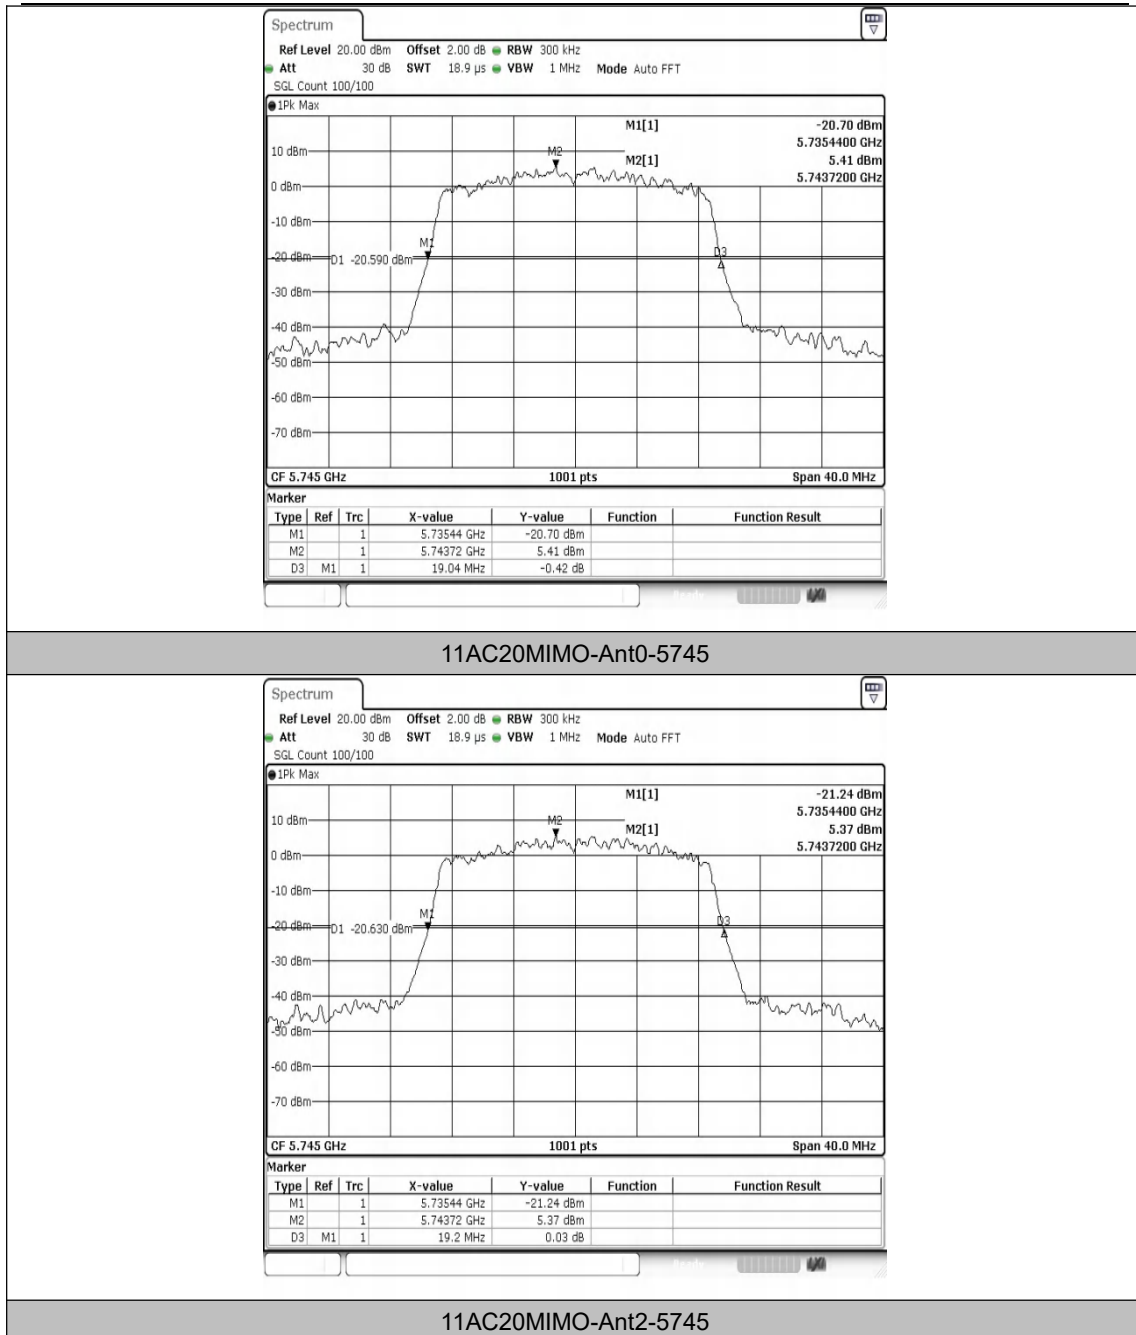


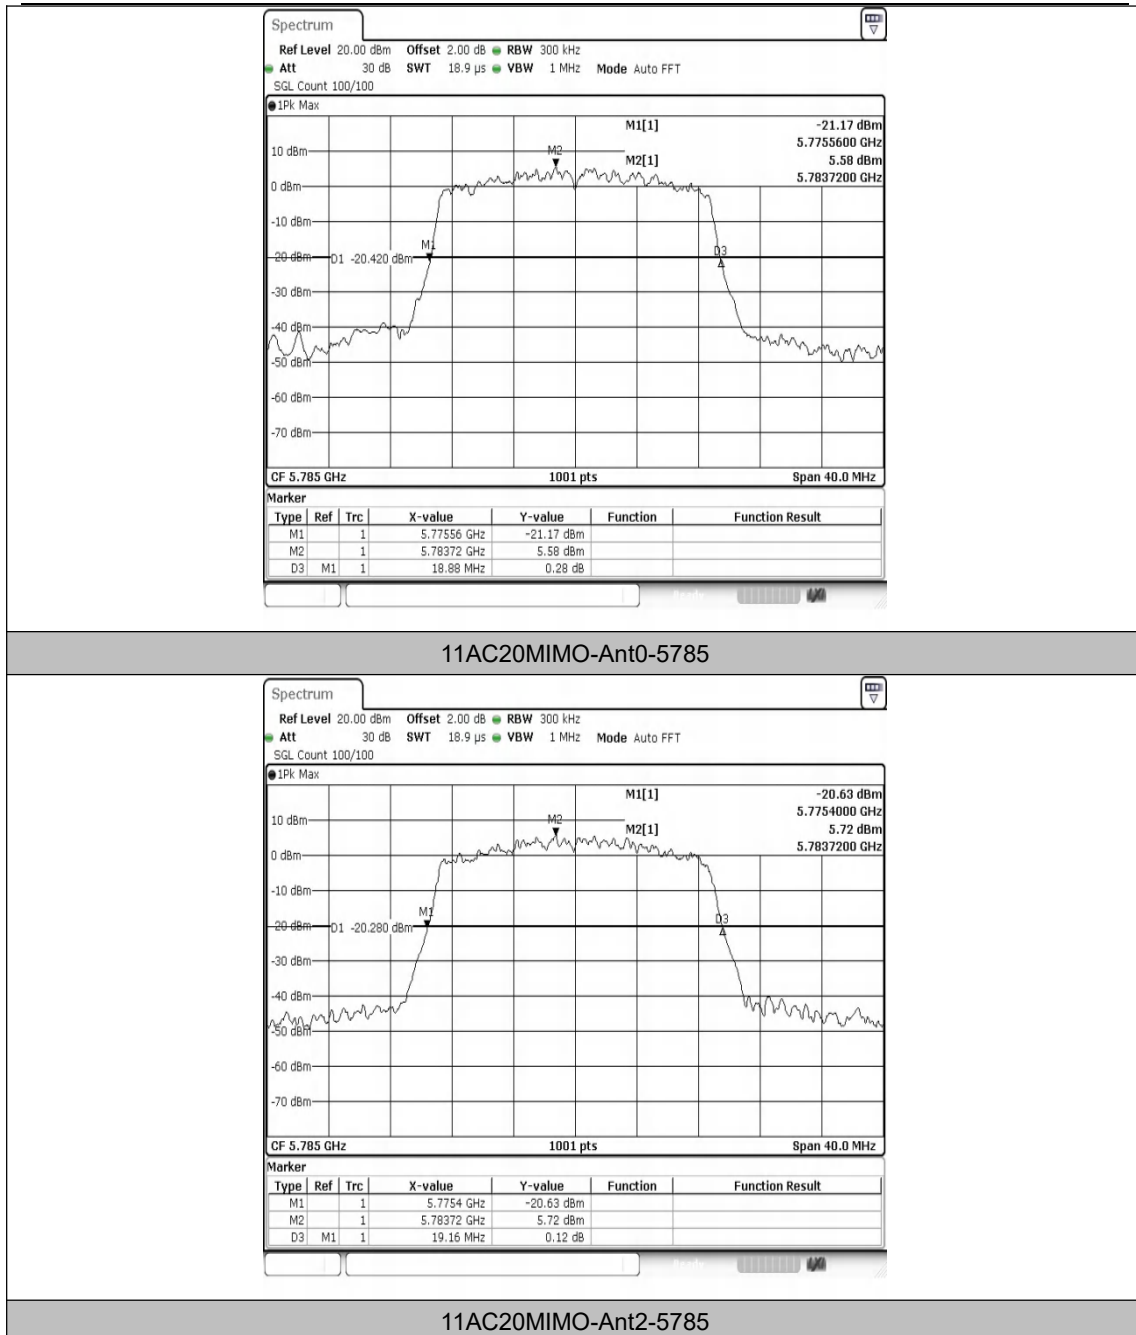

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

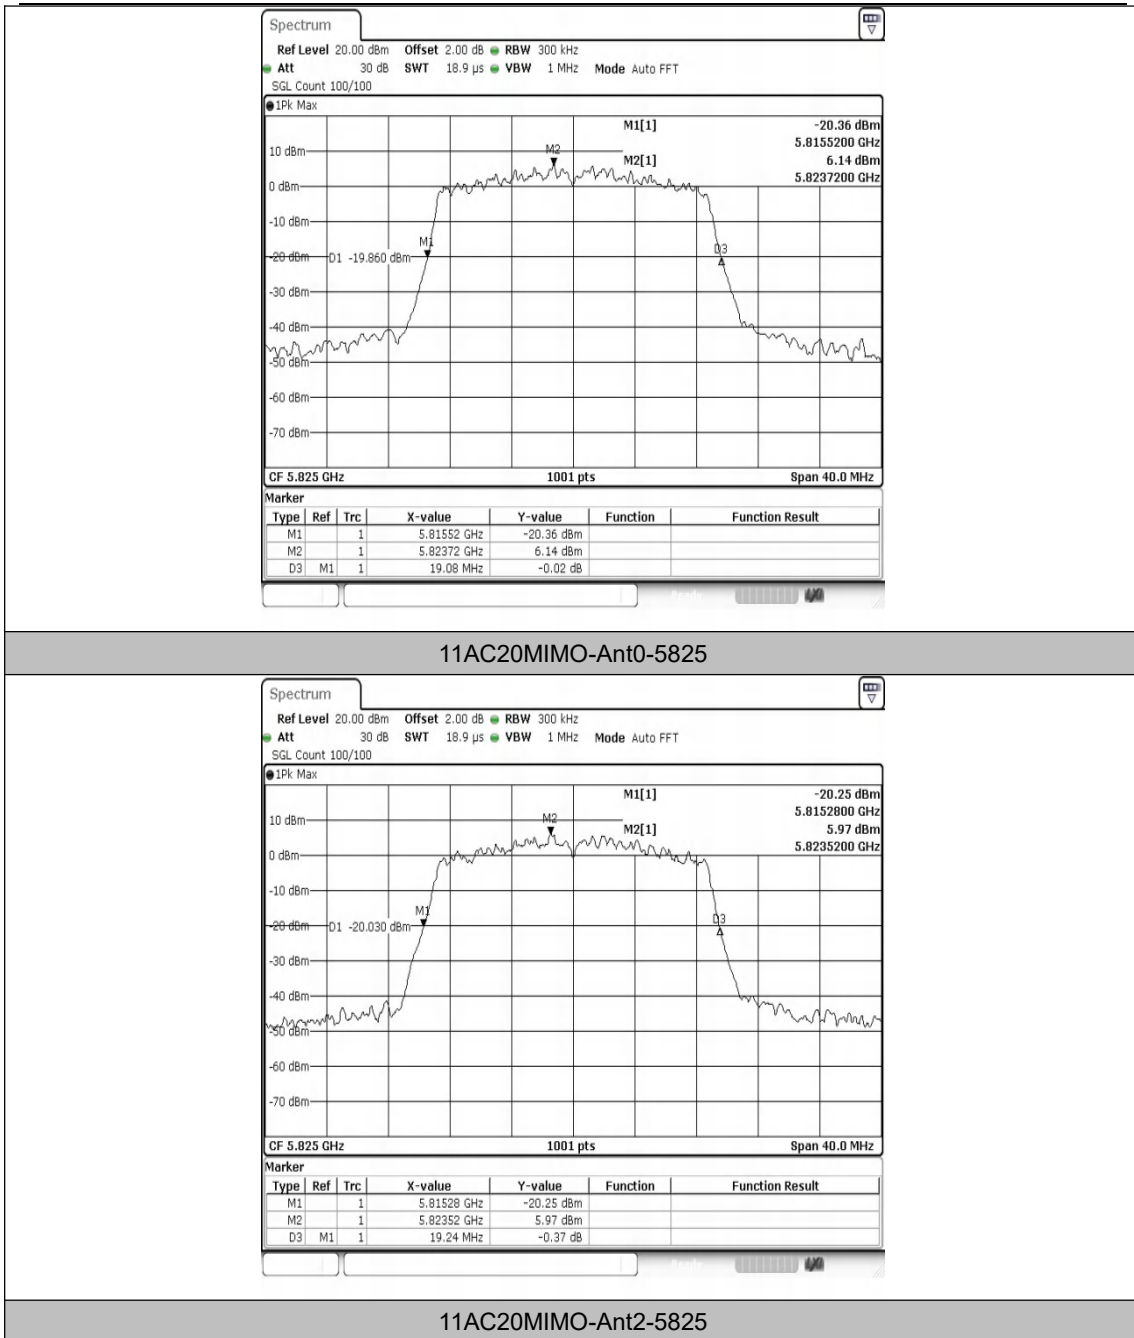



#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

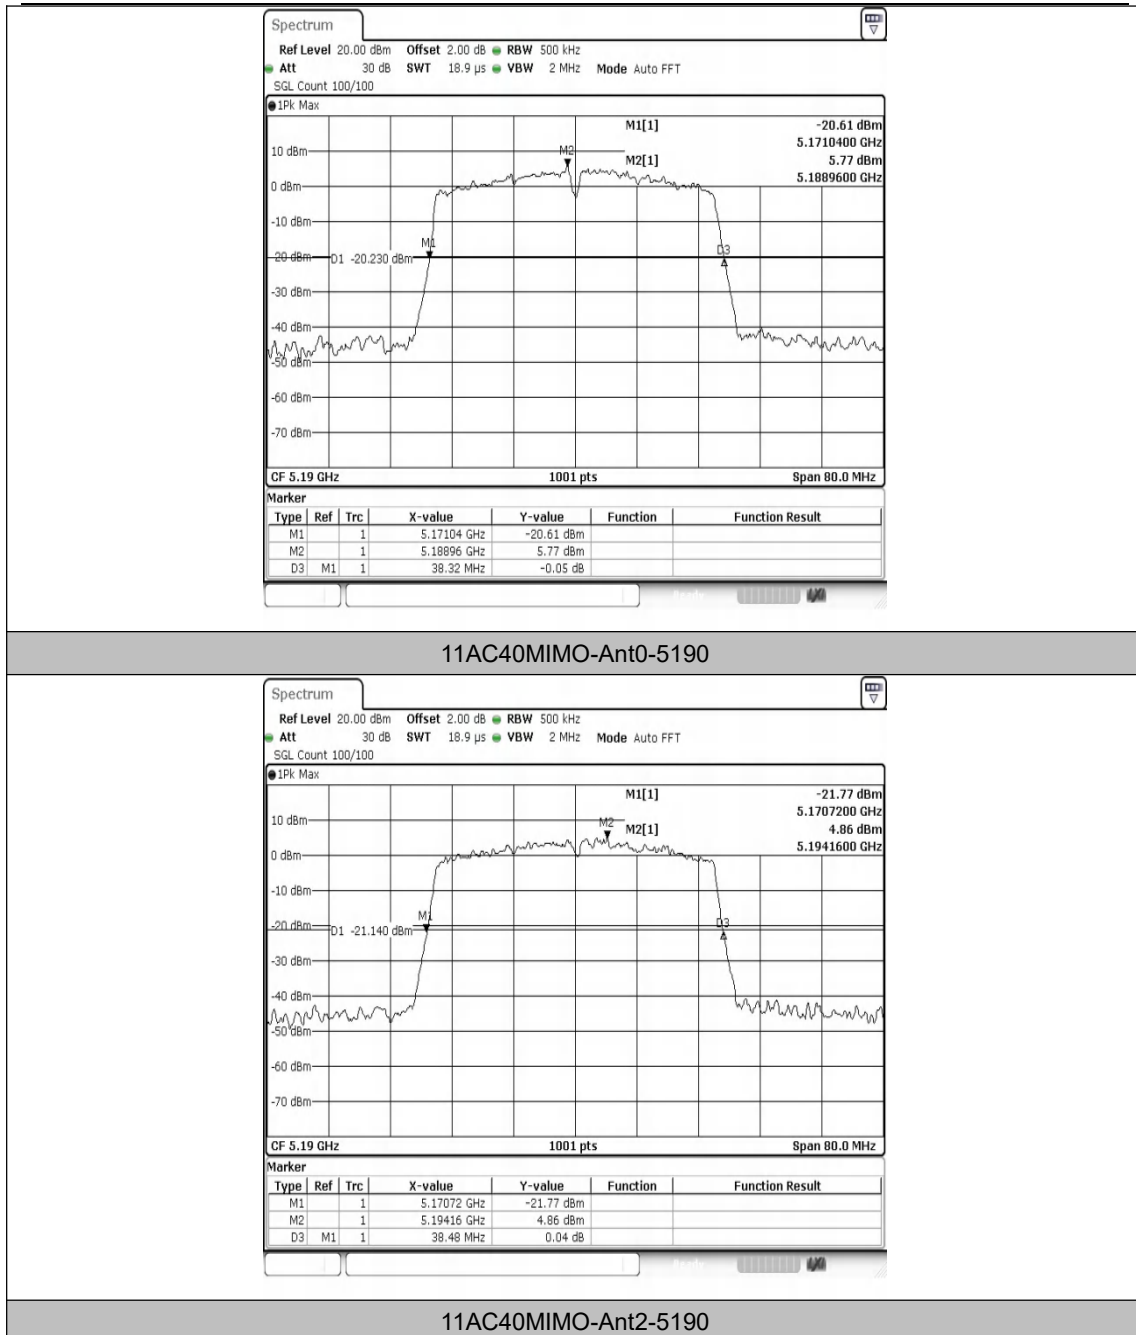

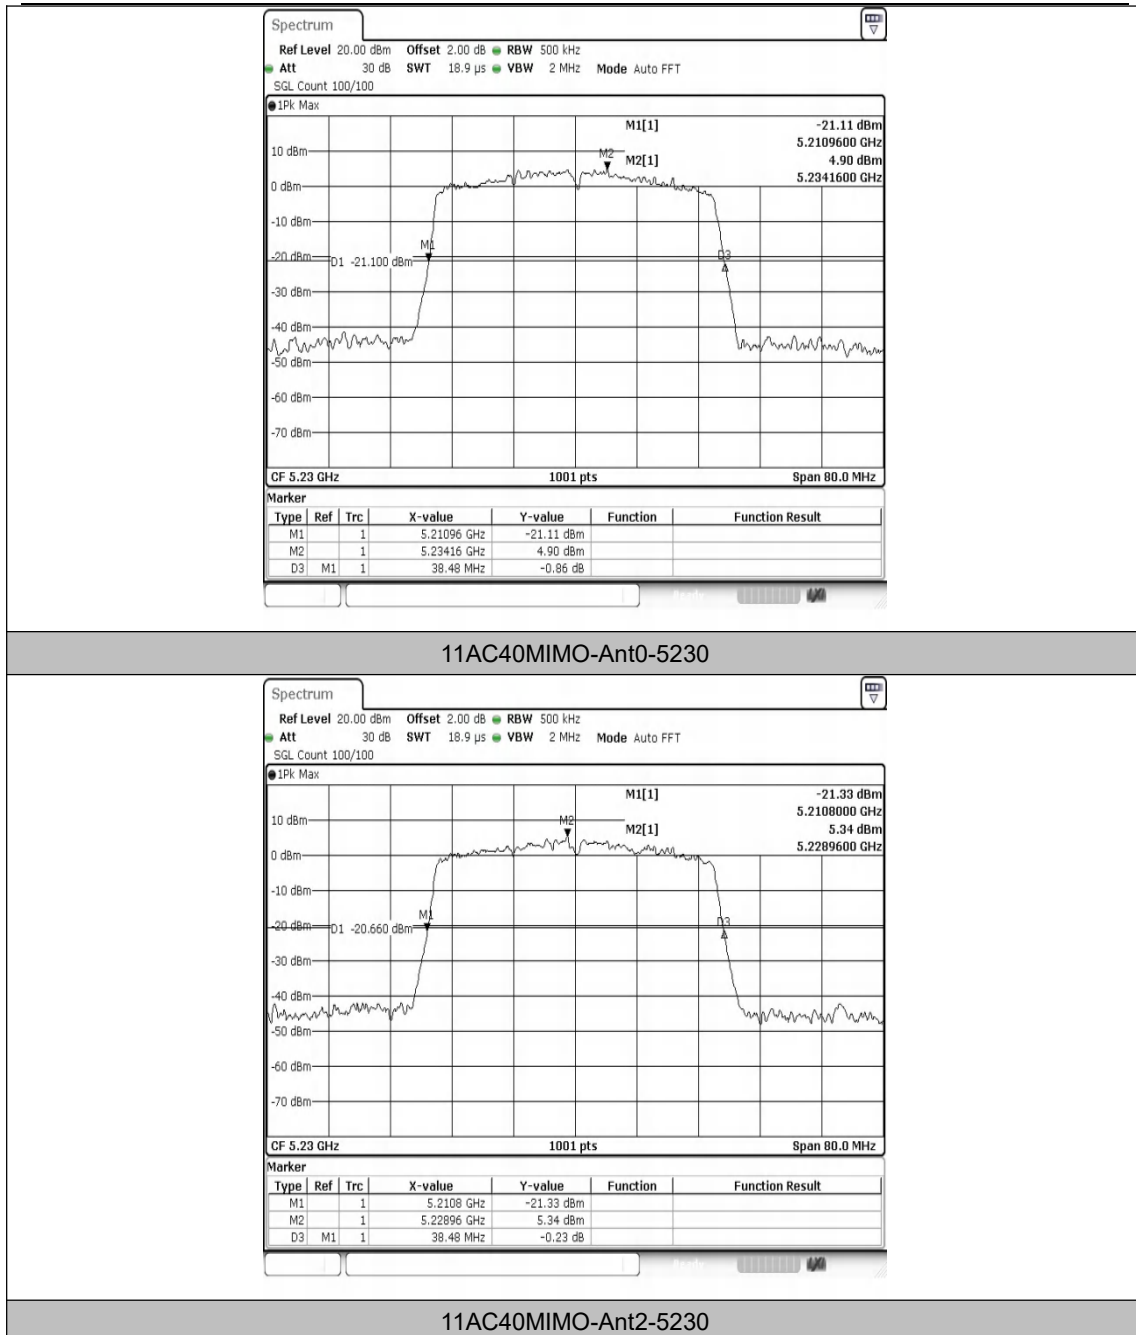


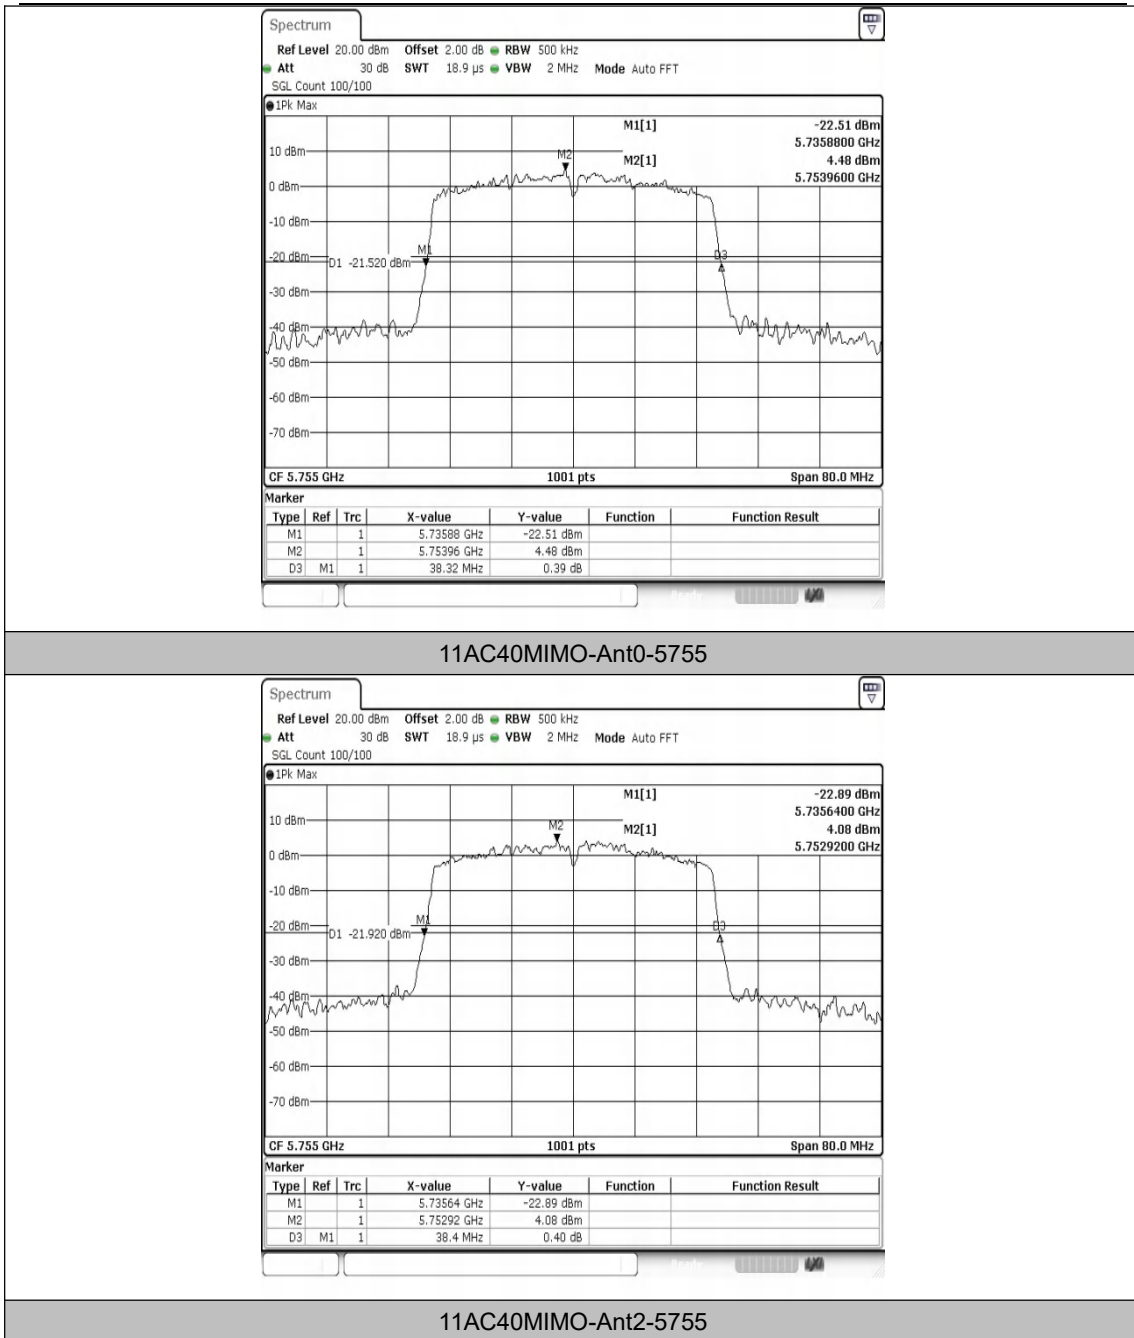


### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

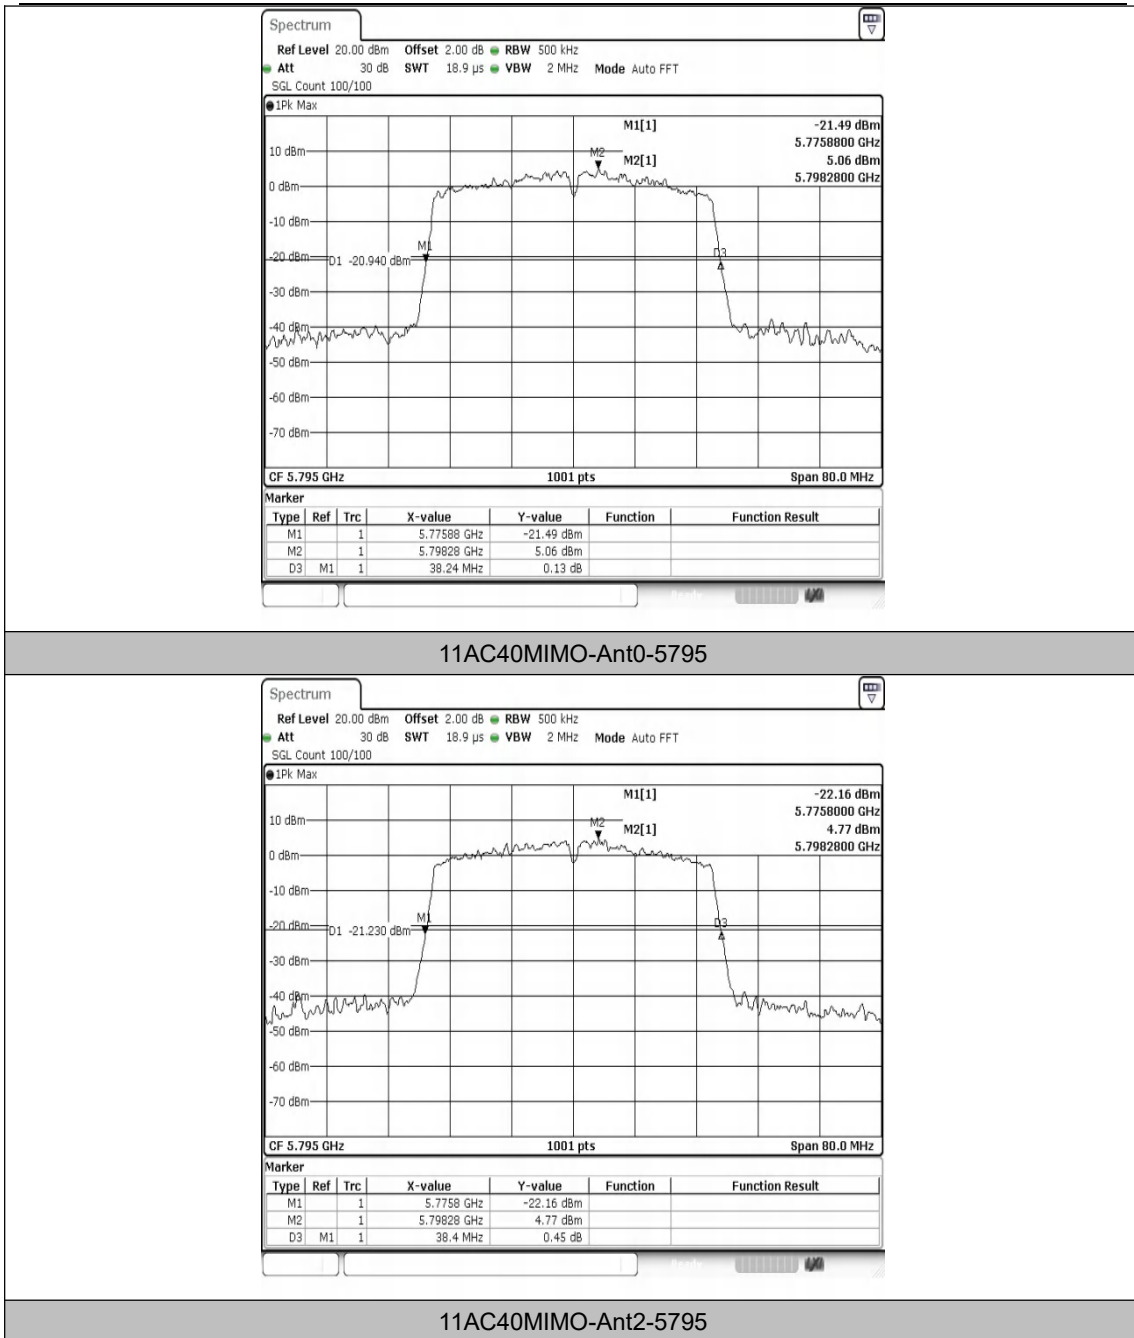



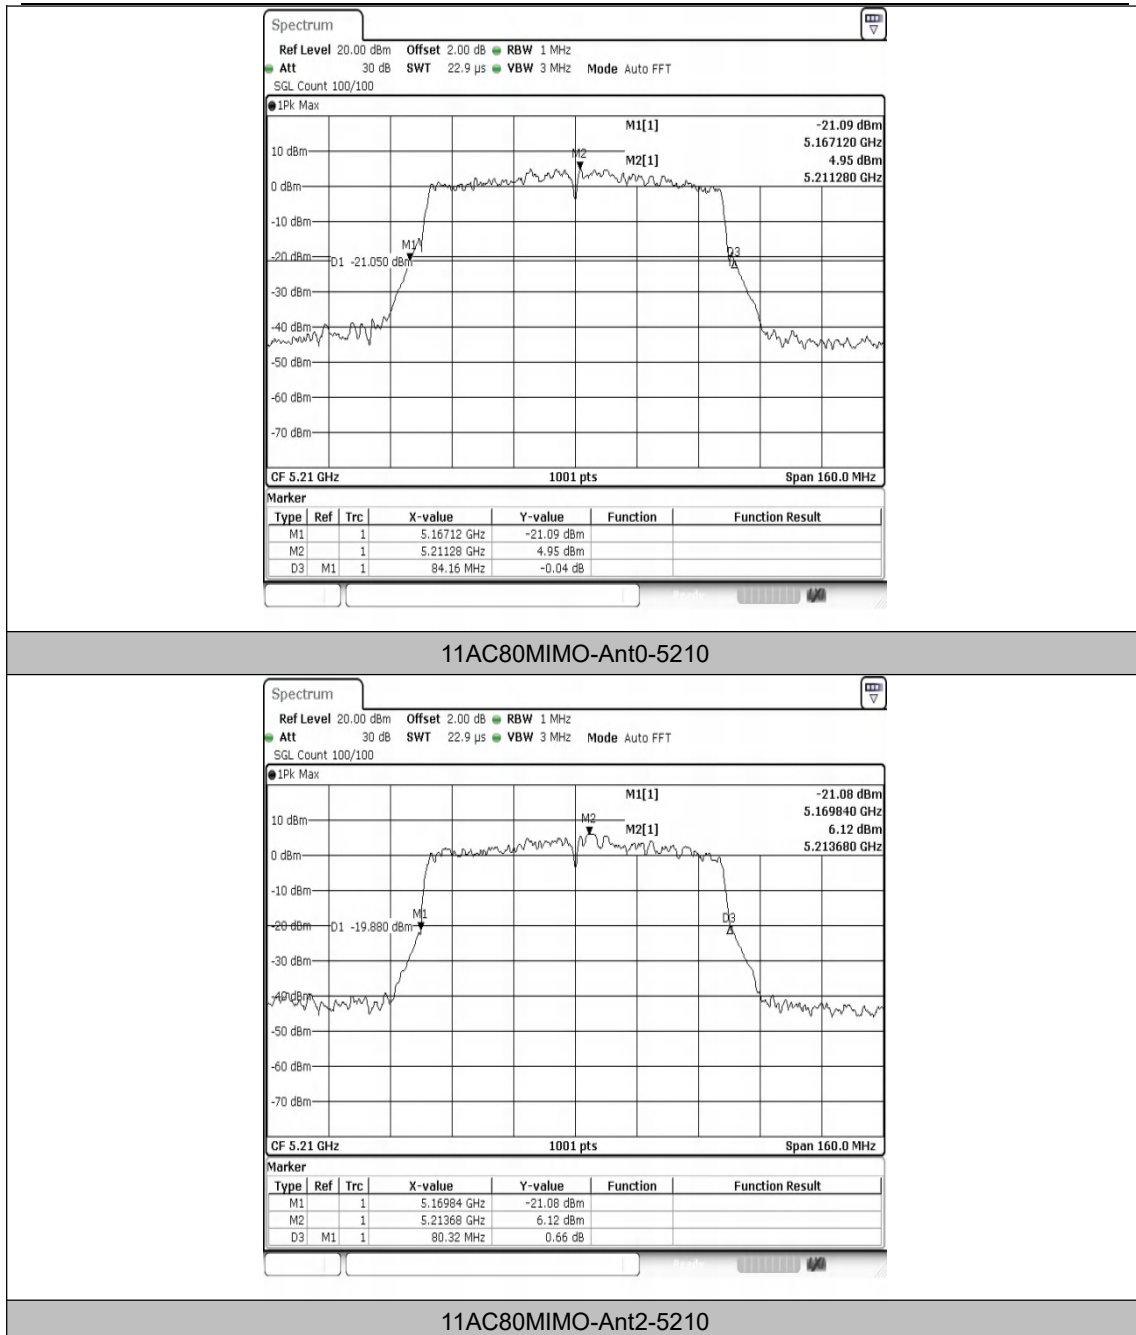

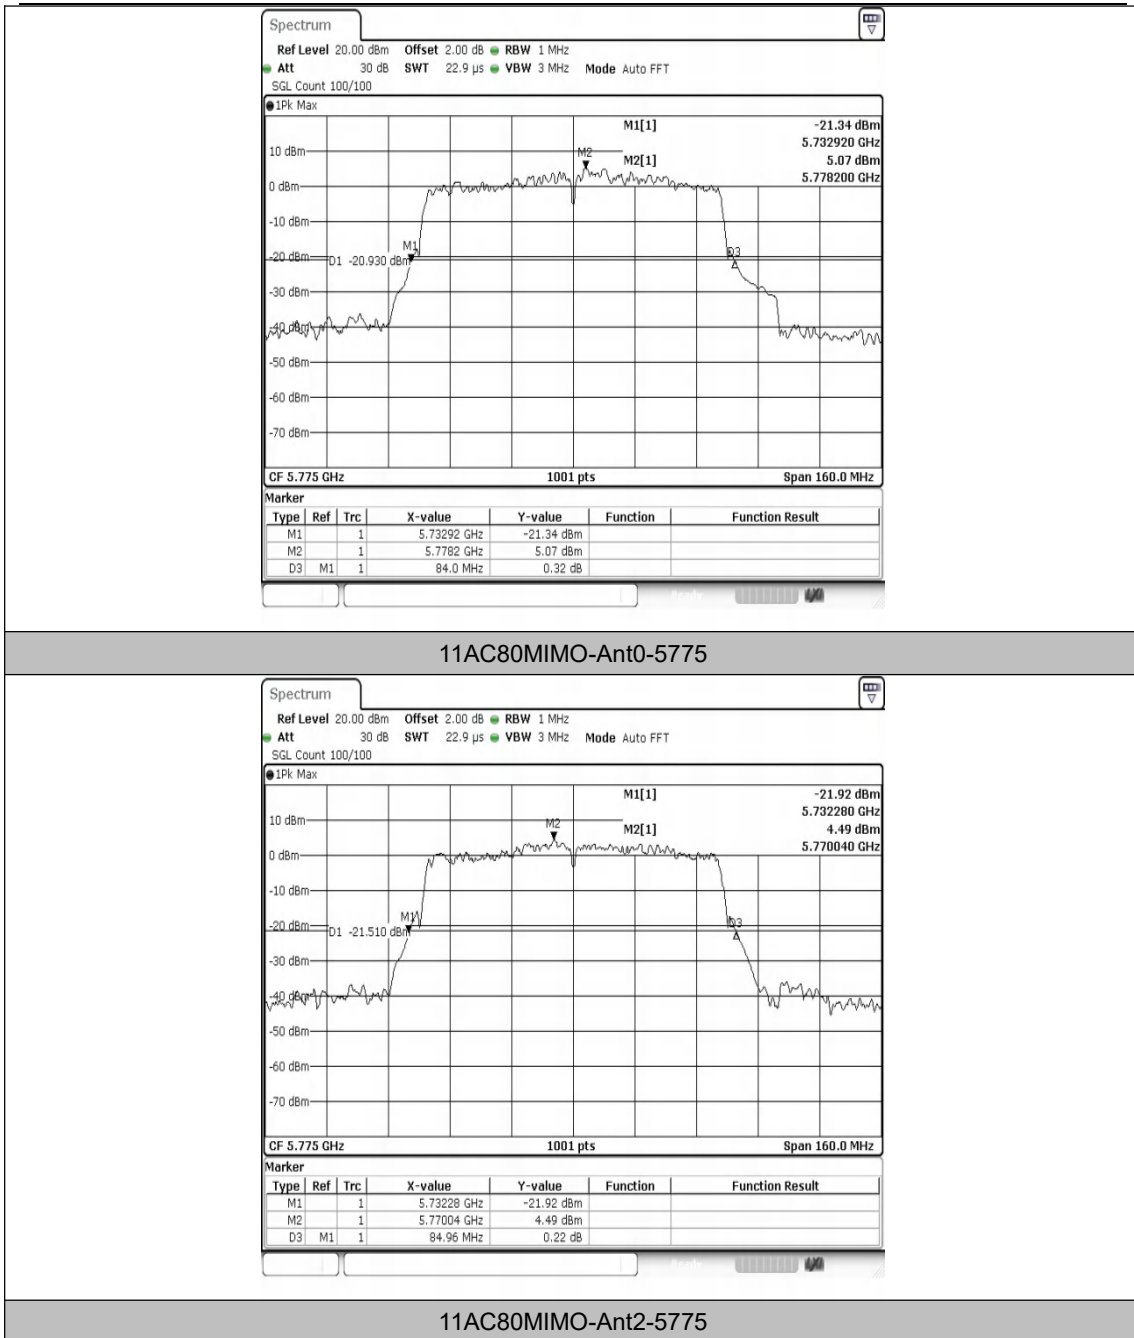


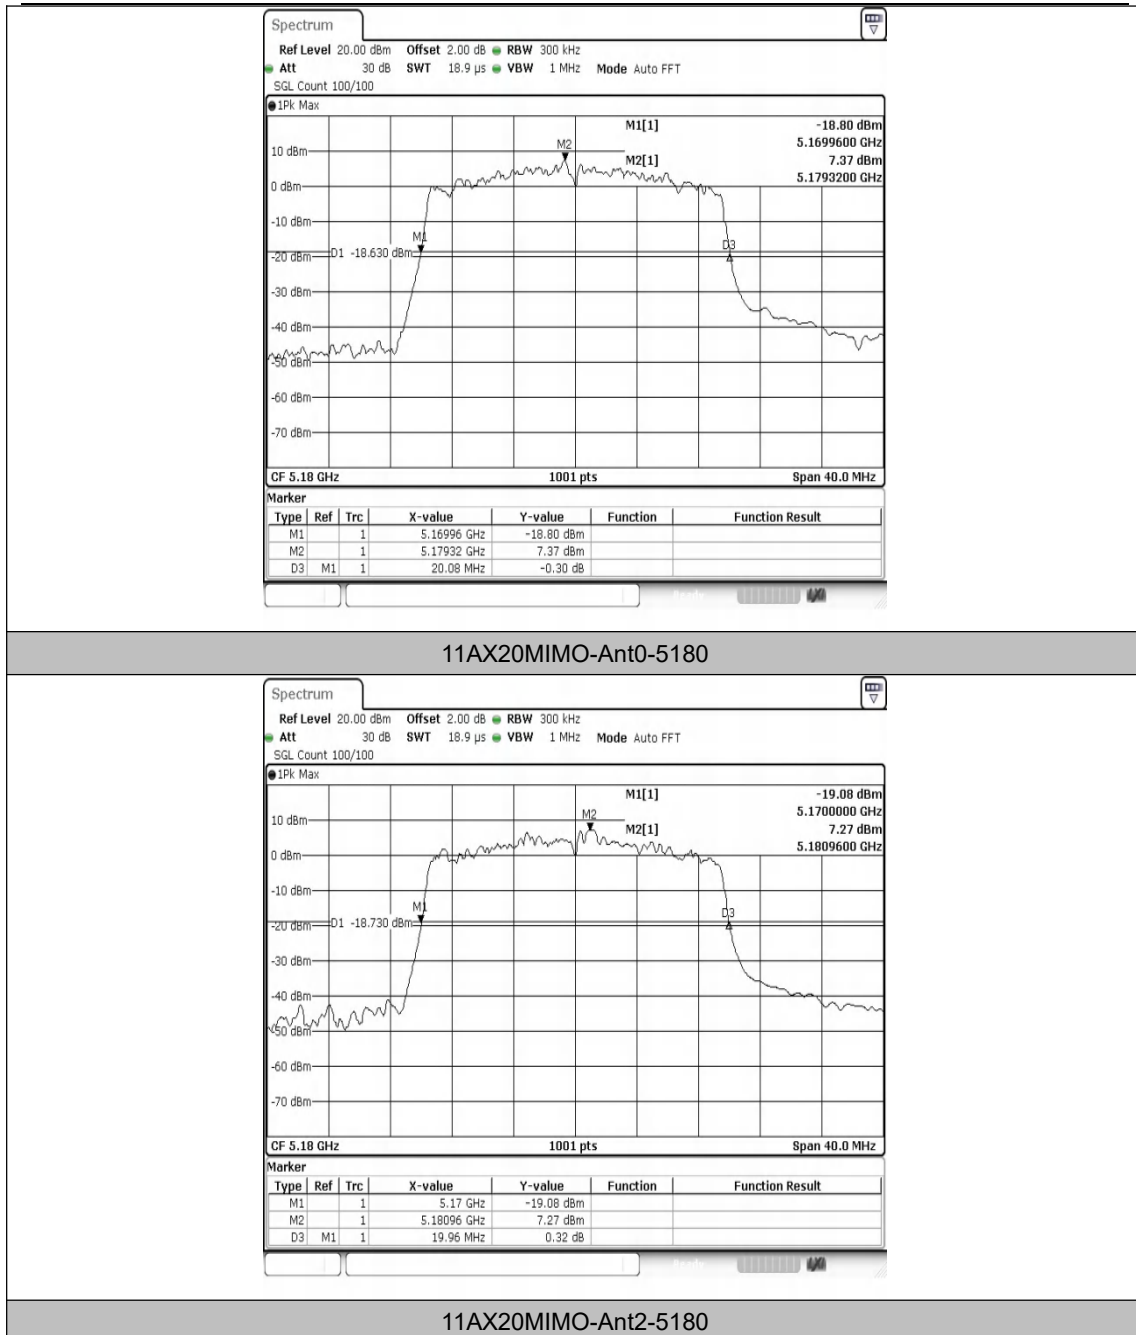

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

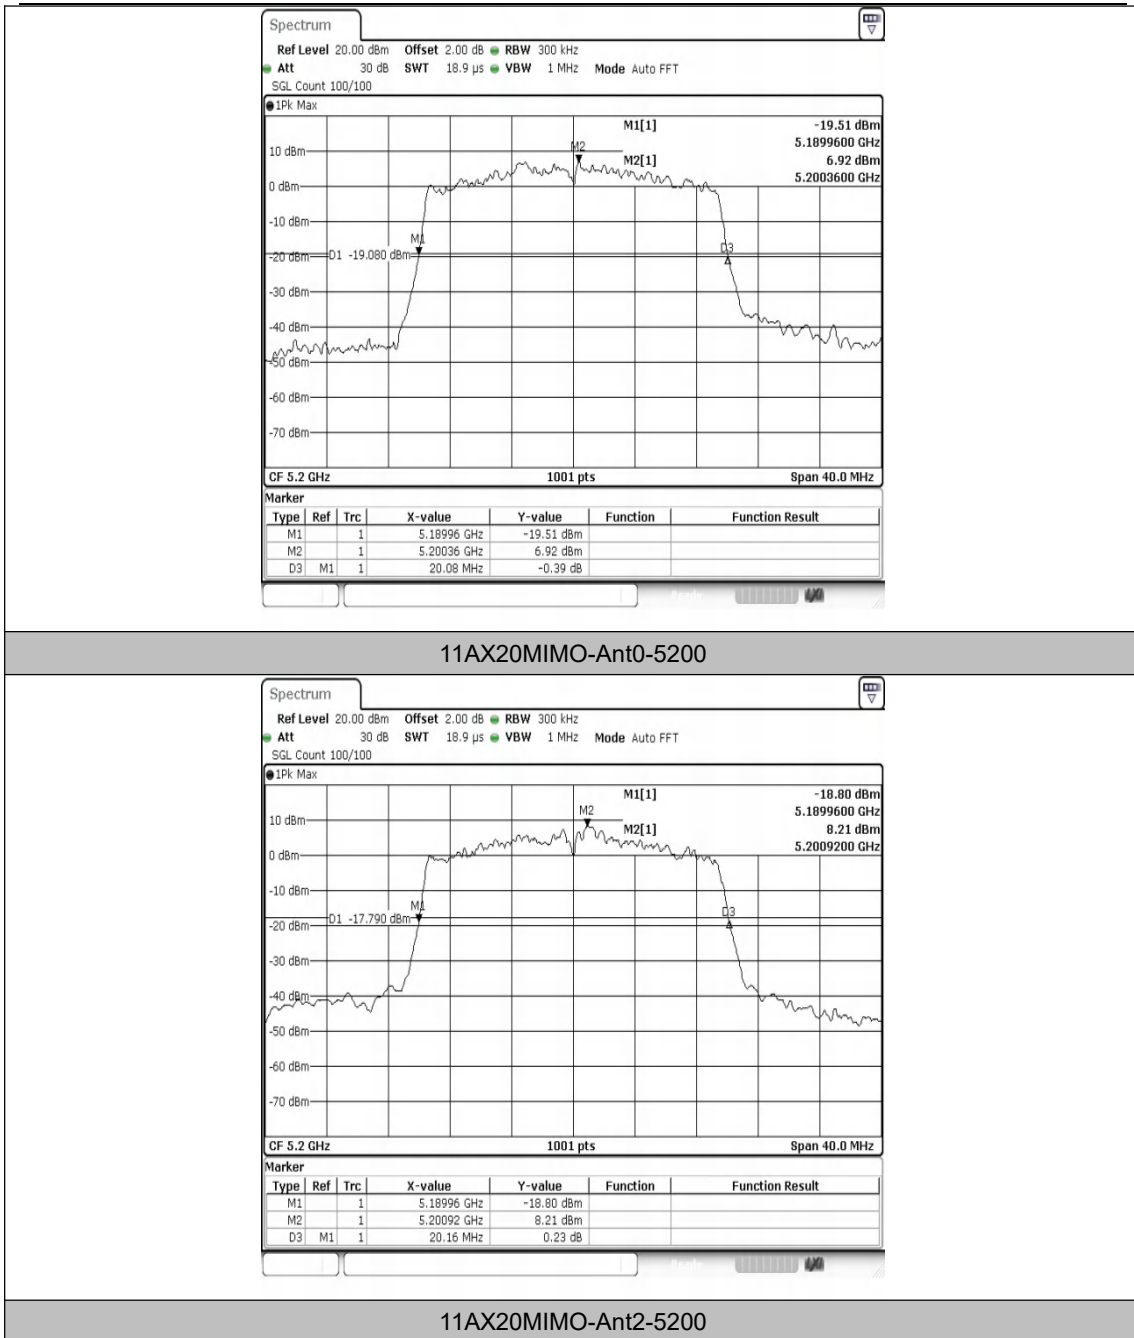



#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

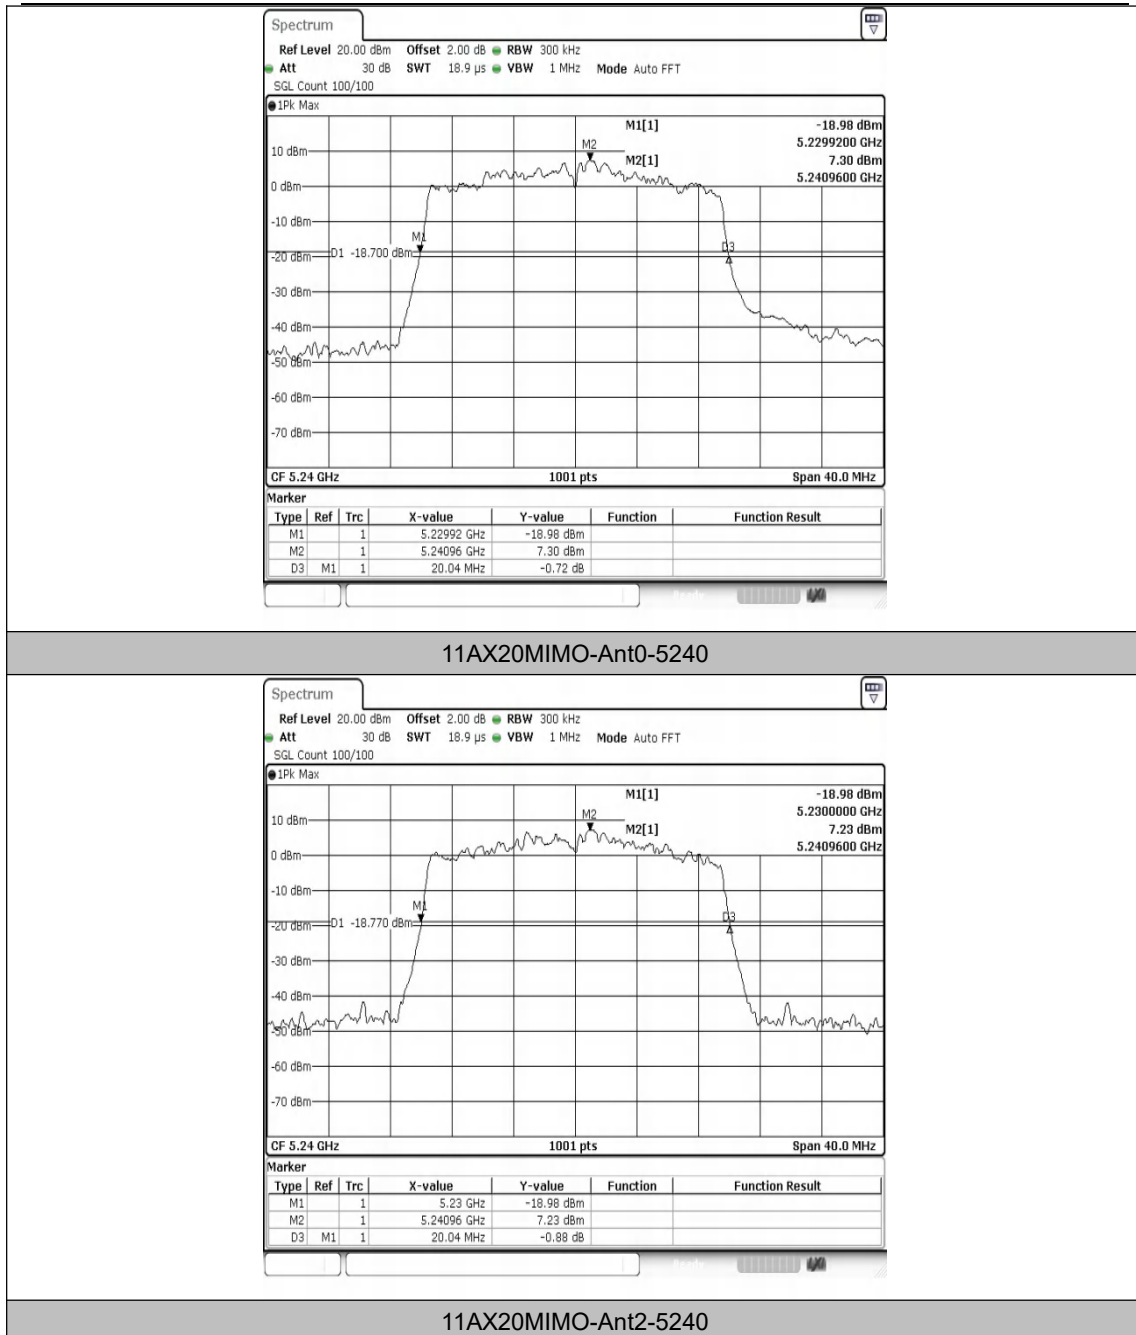

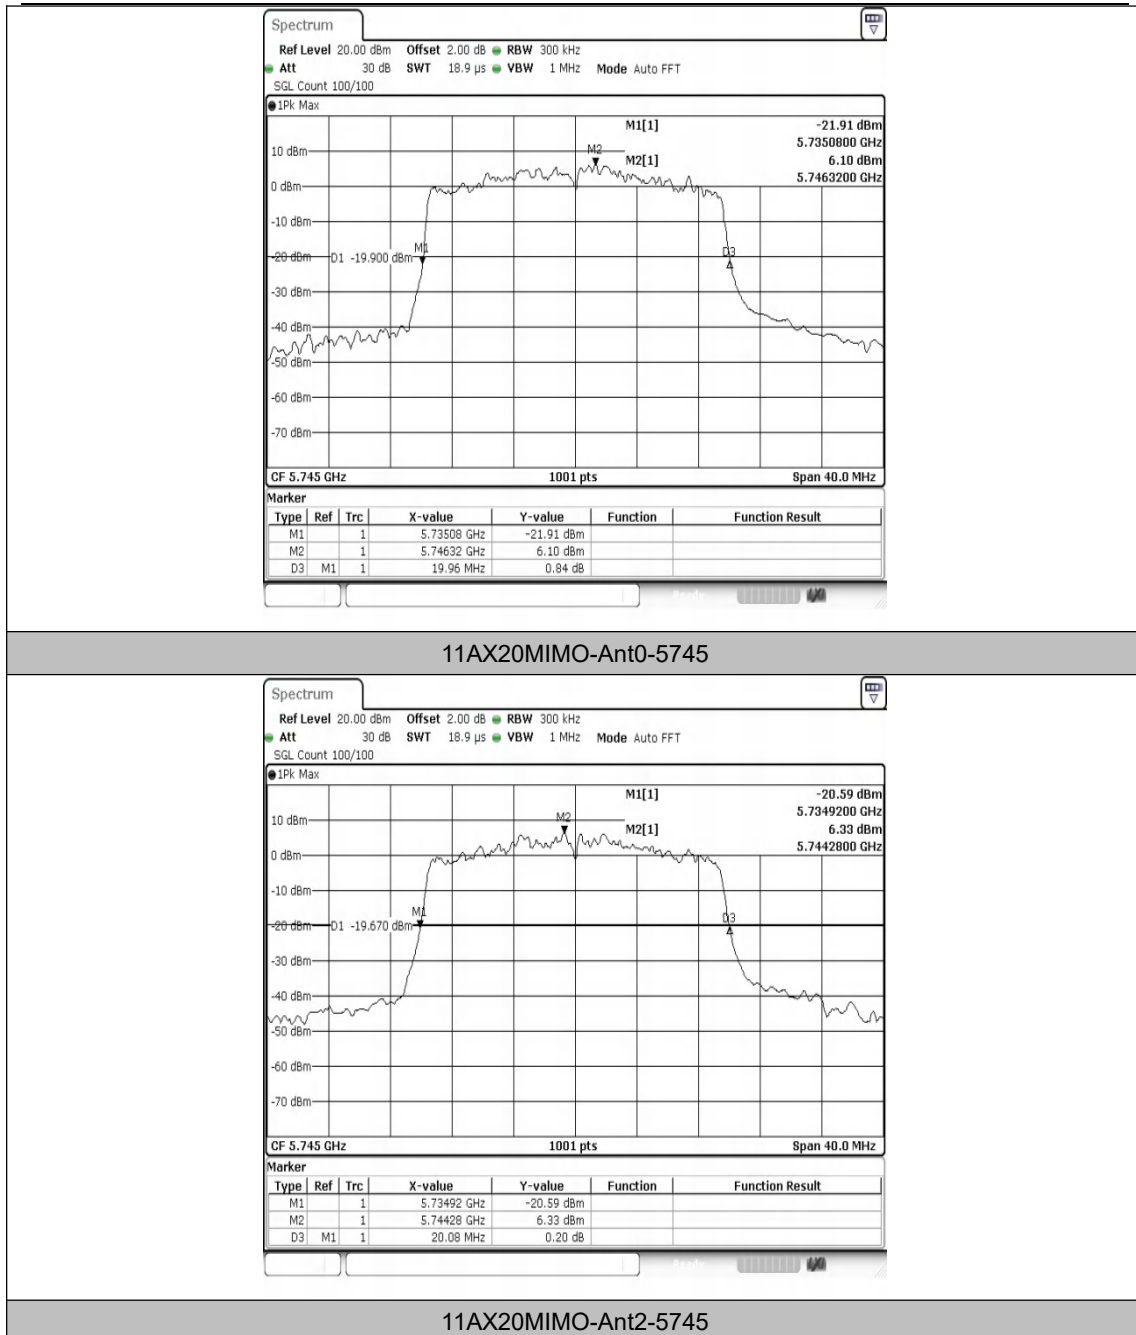

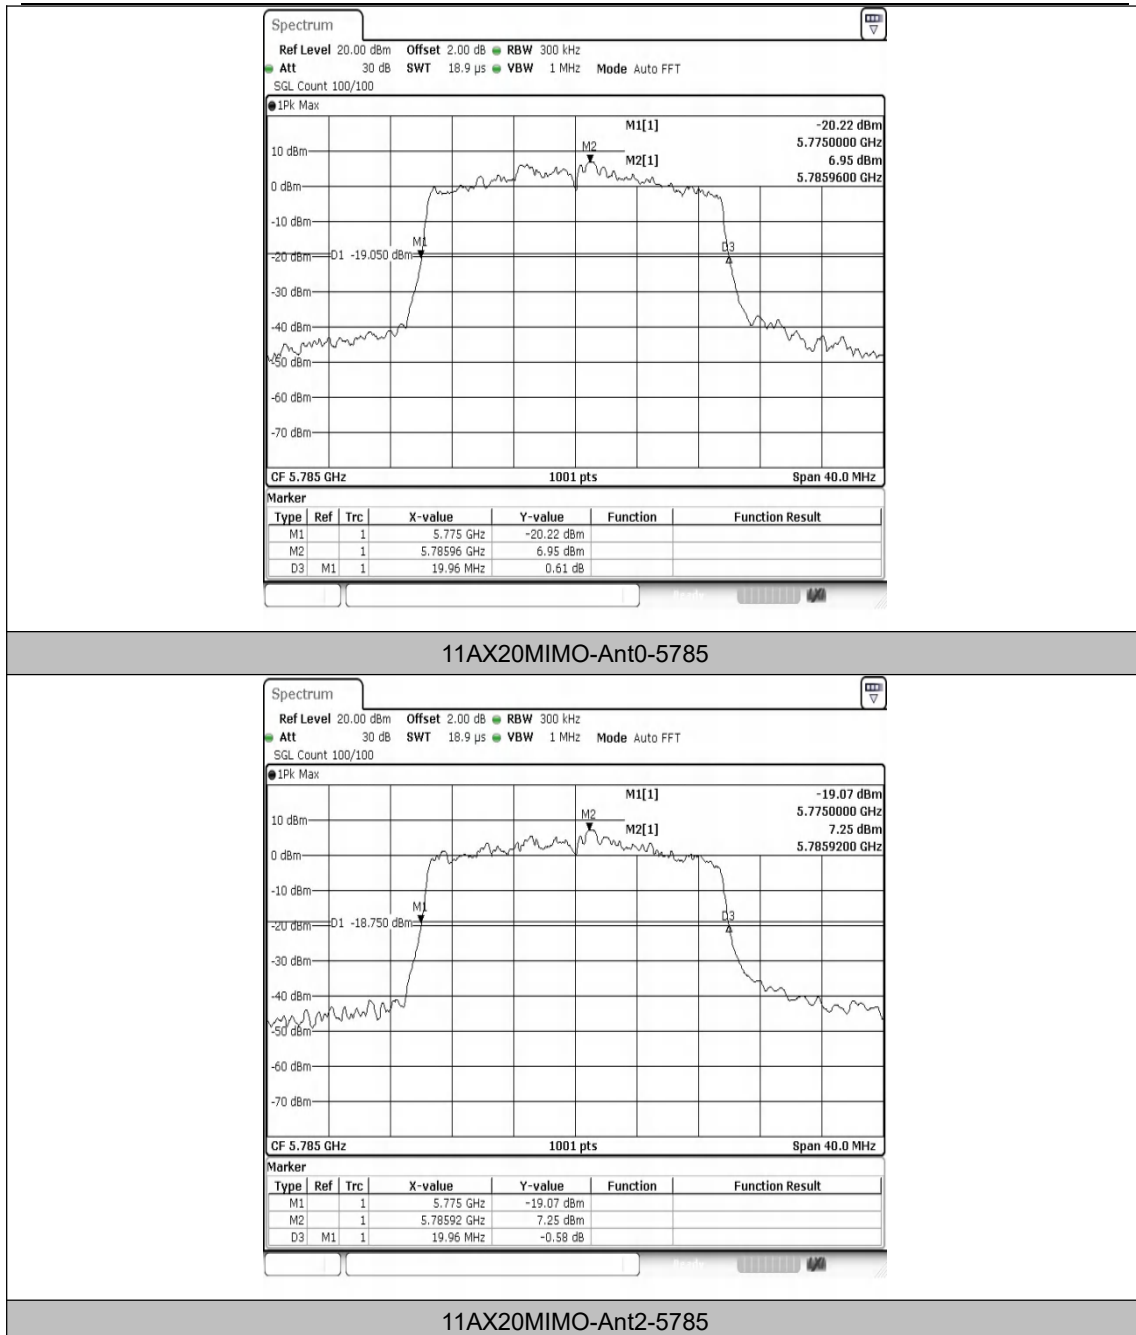



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



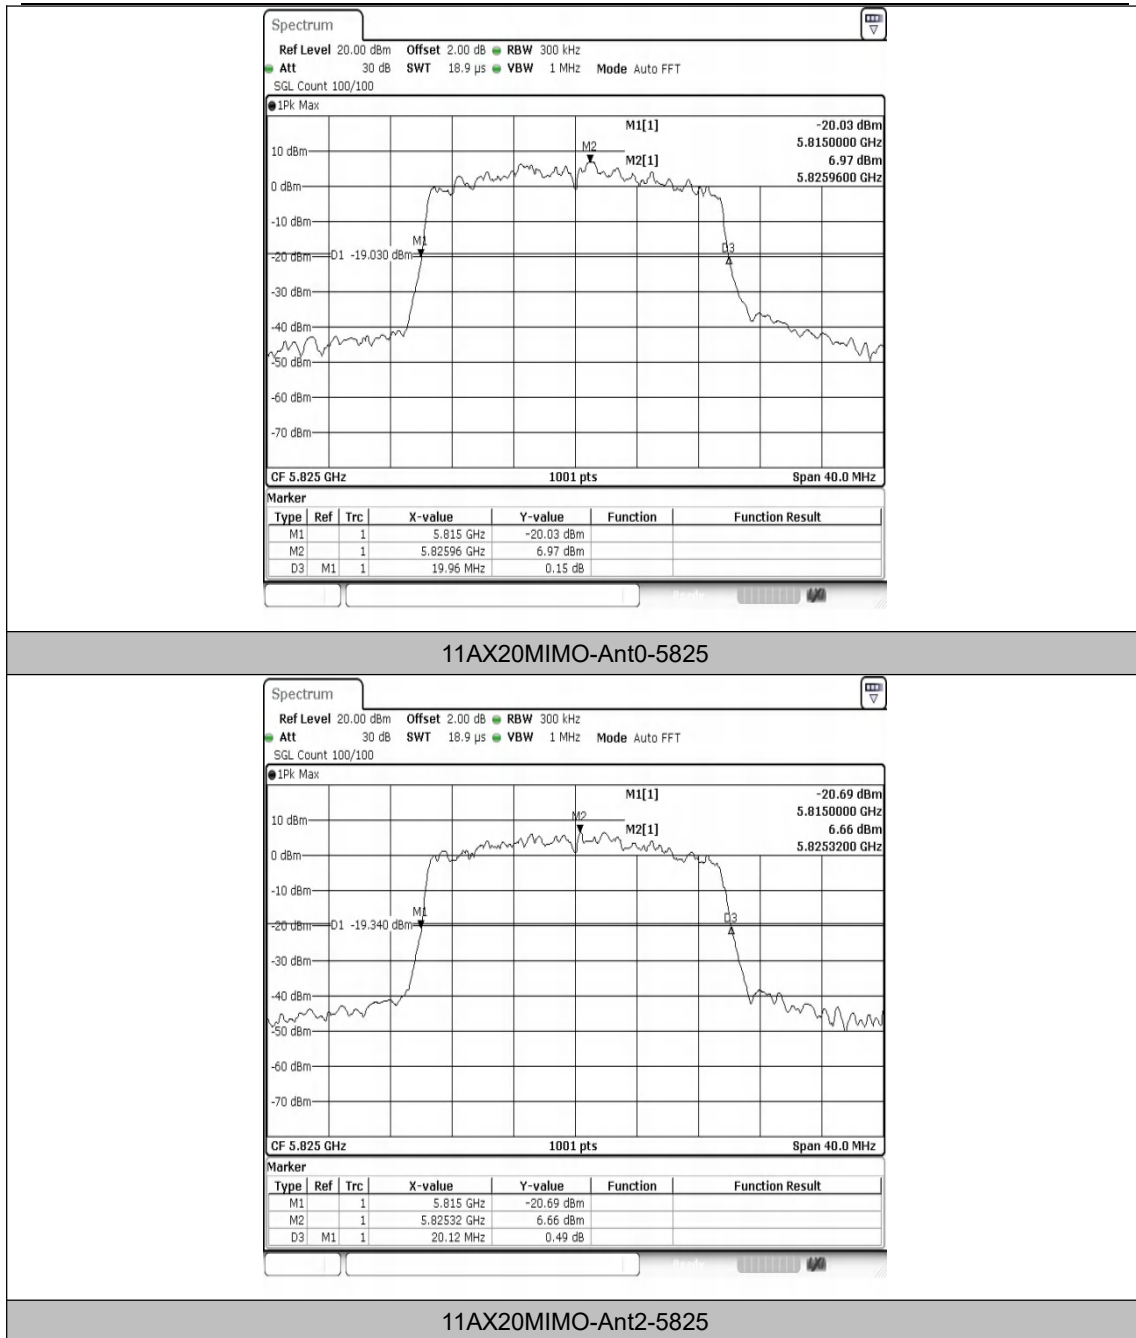

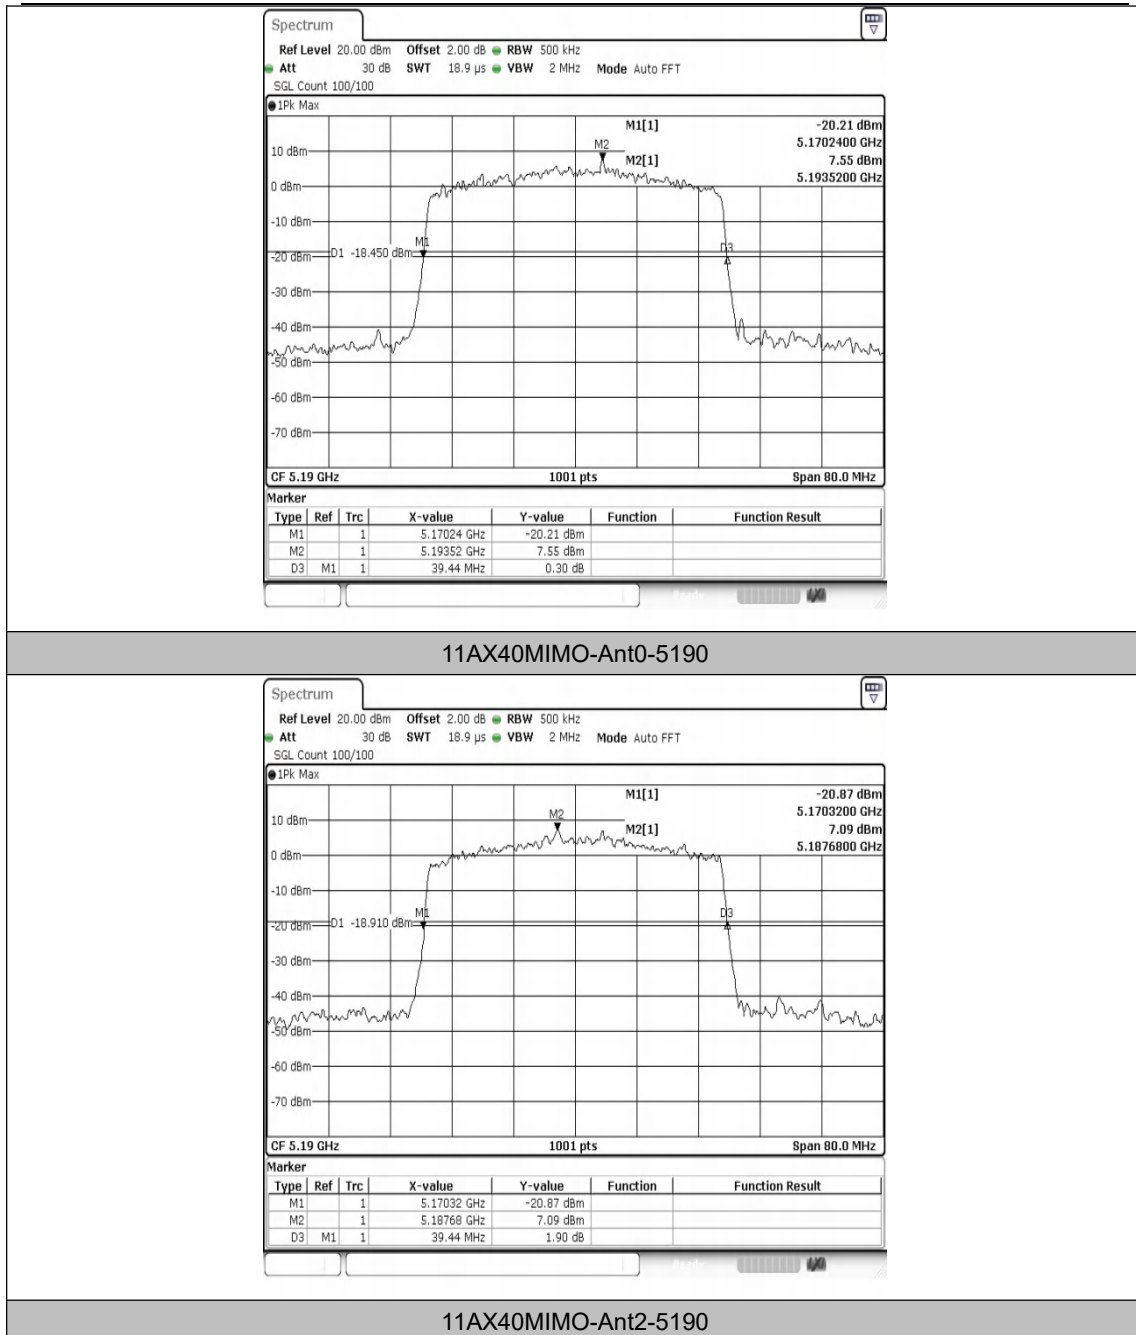


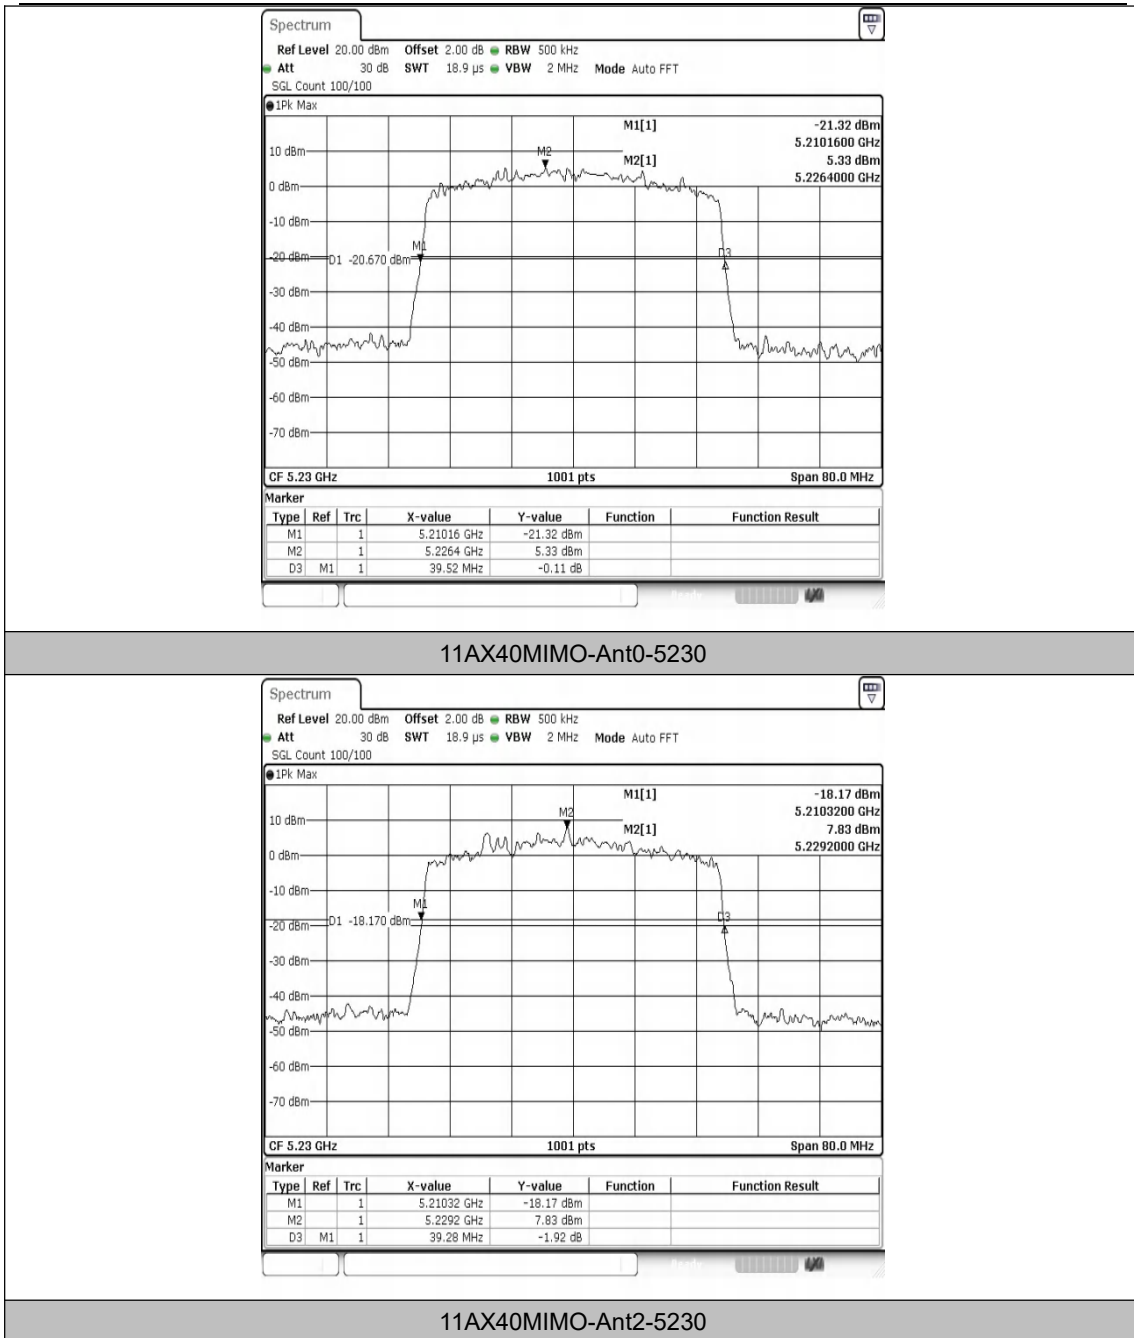


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

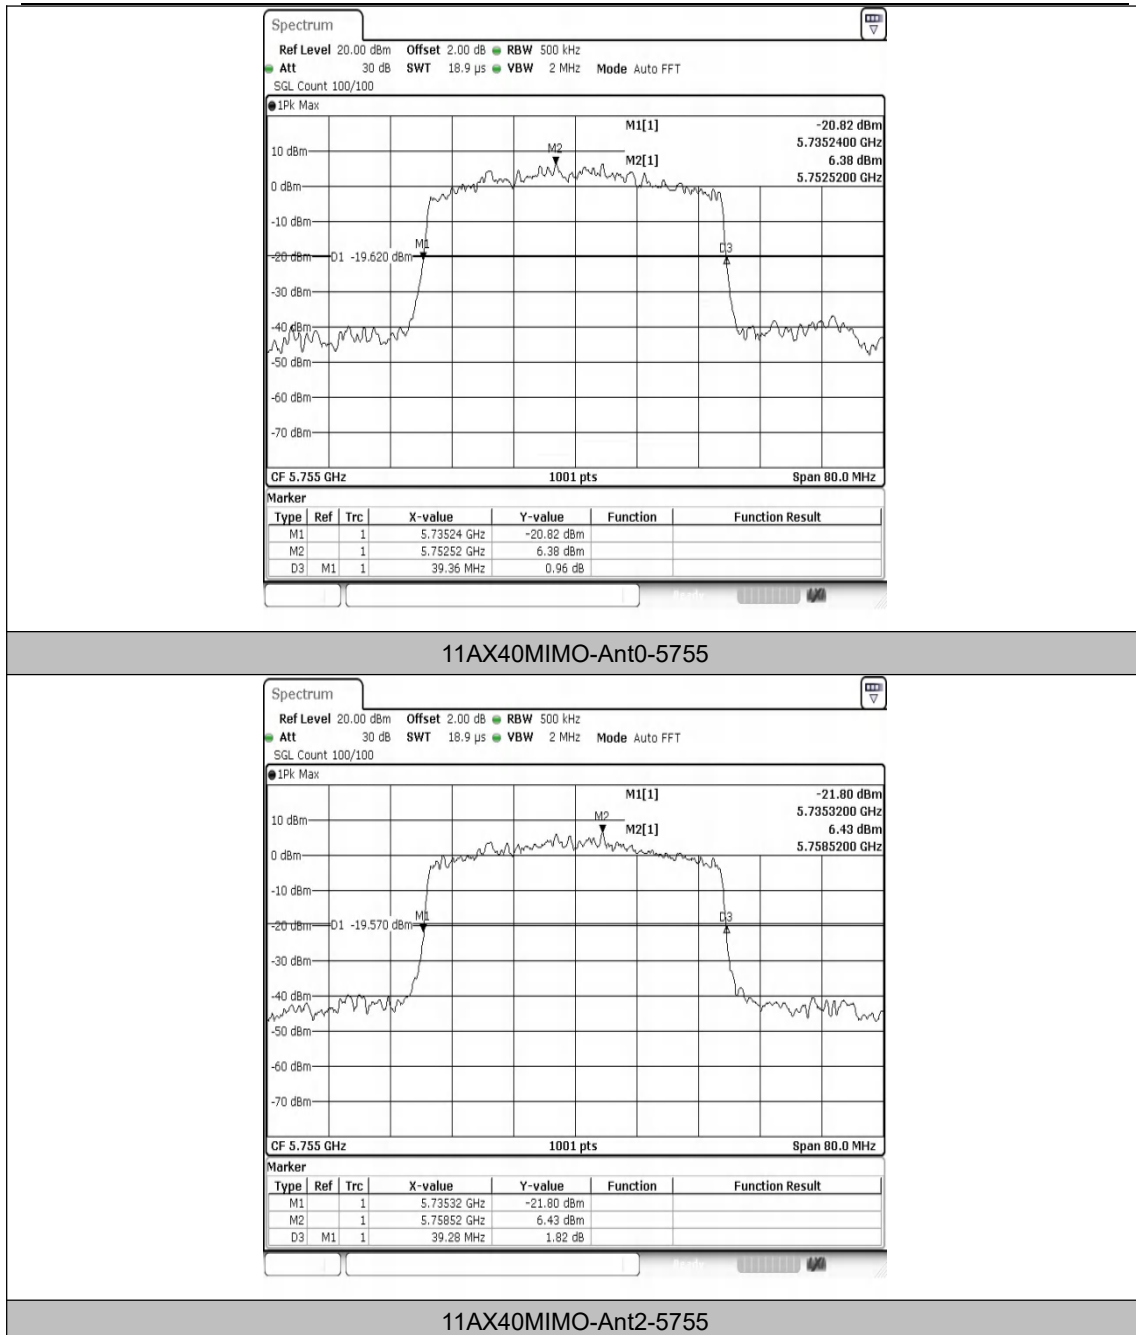


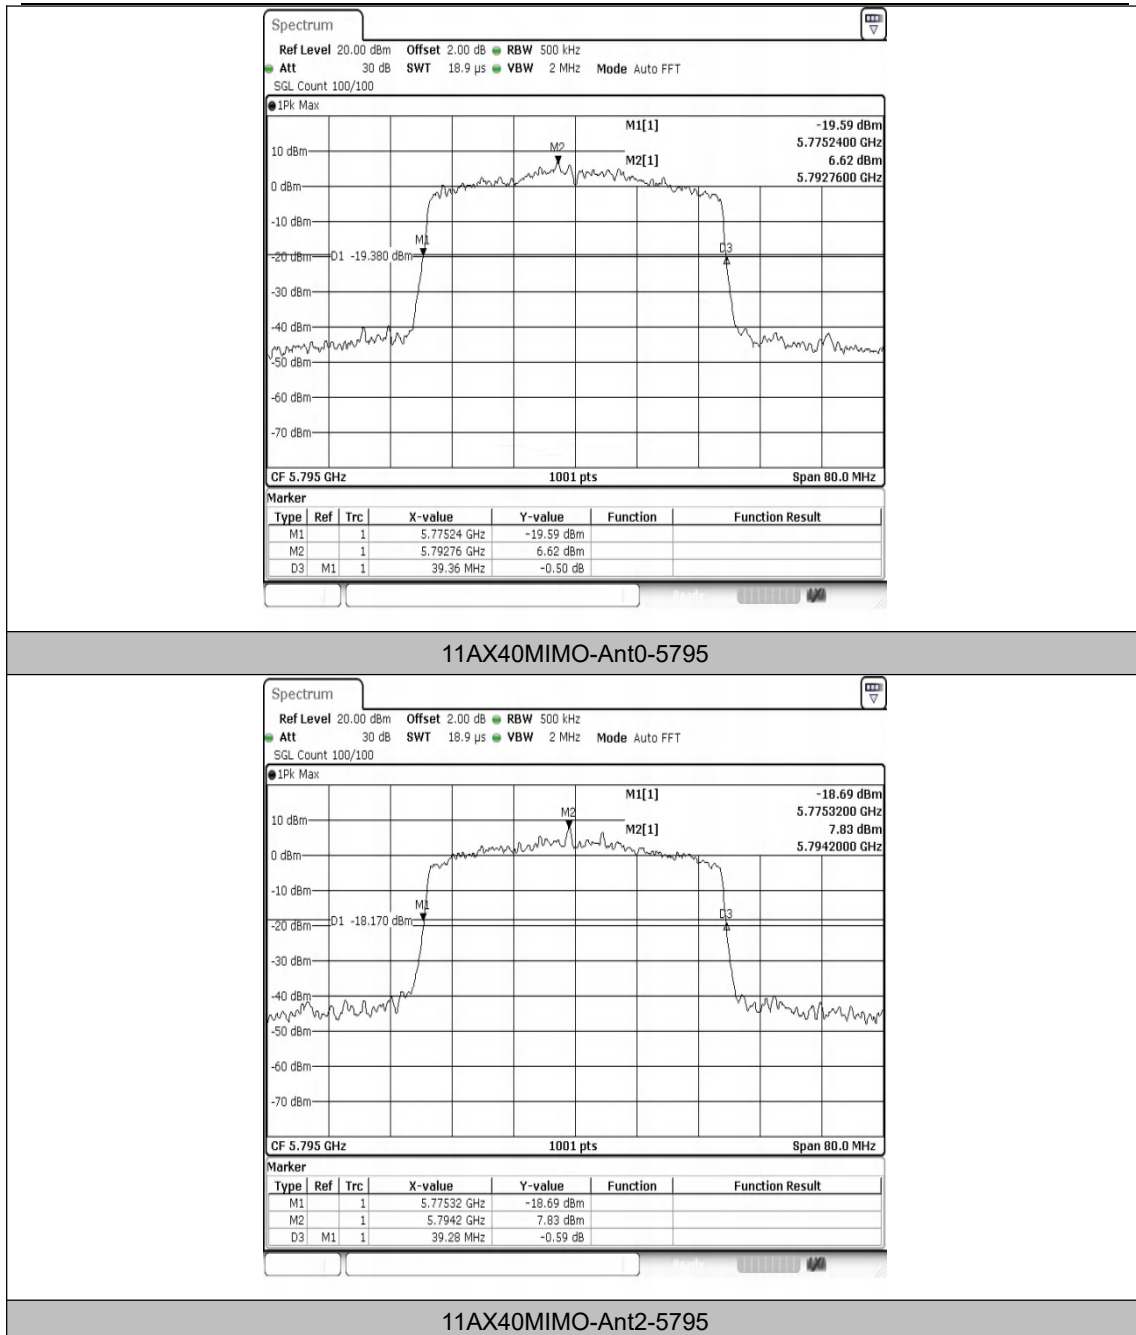

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

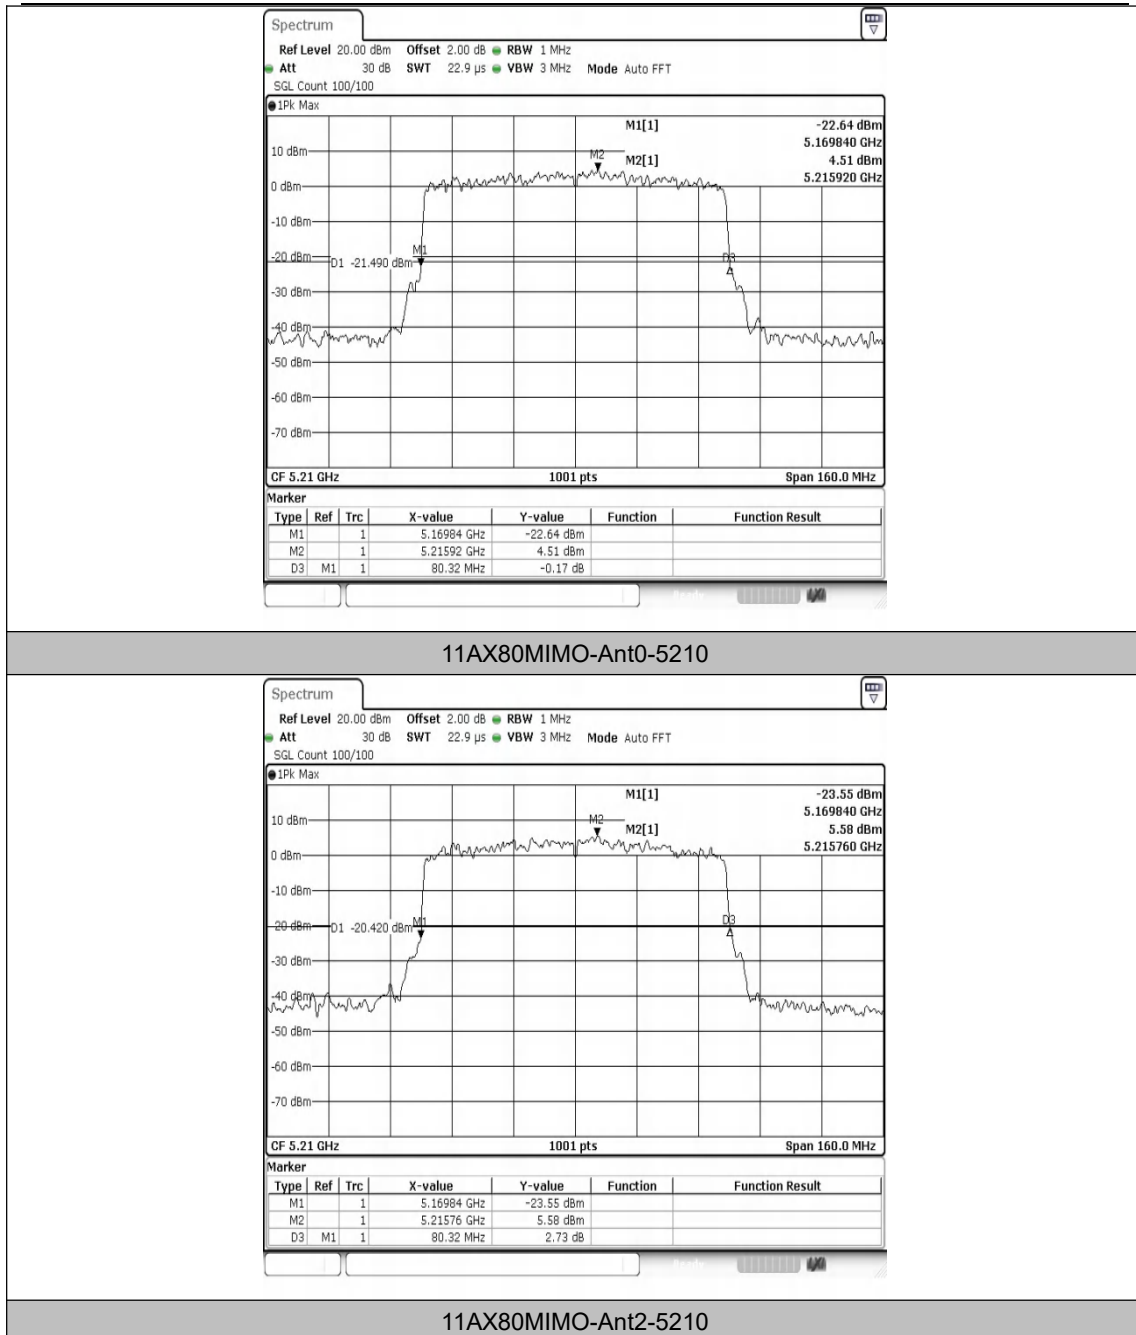

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

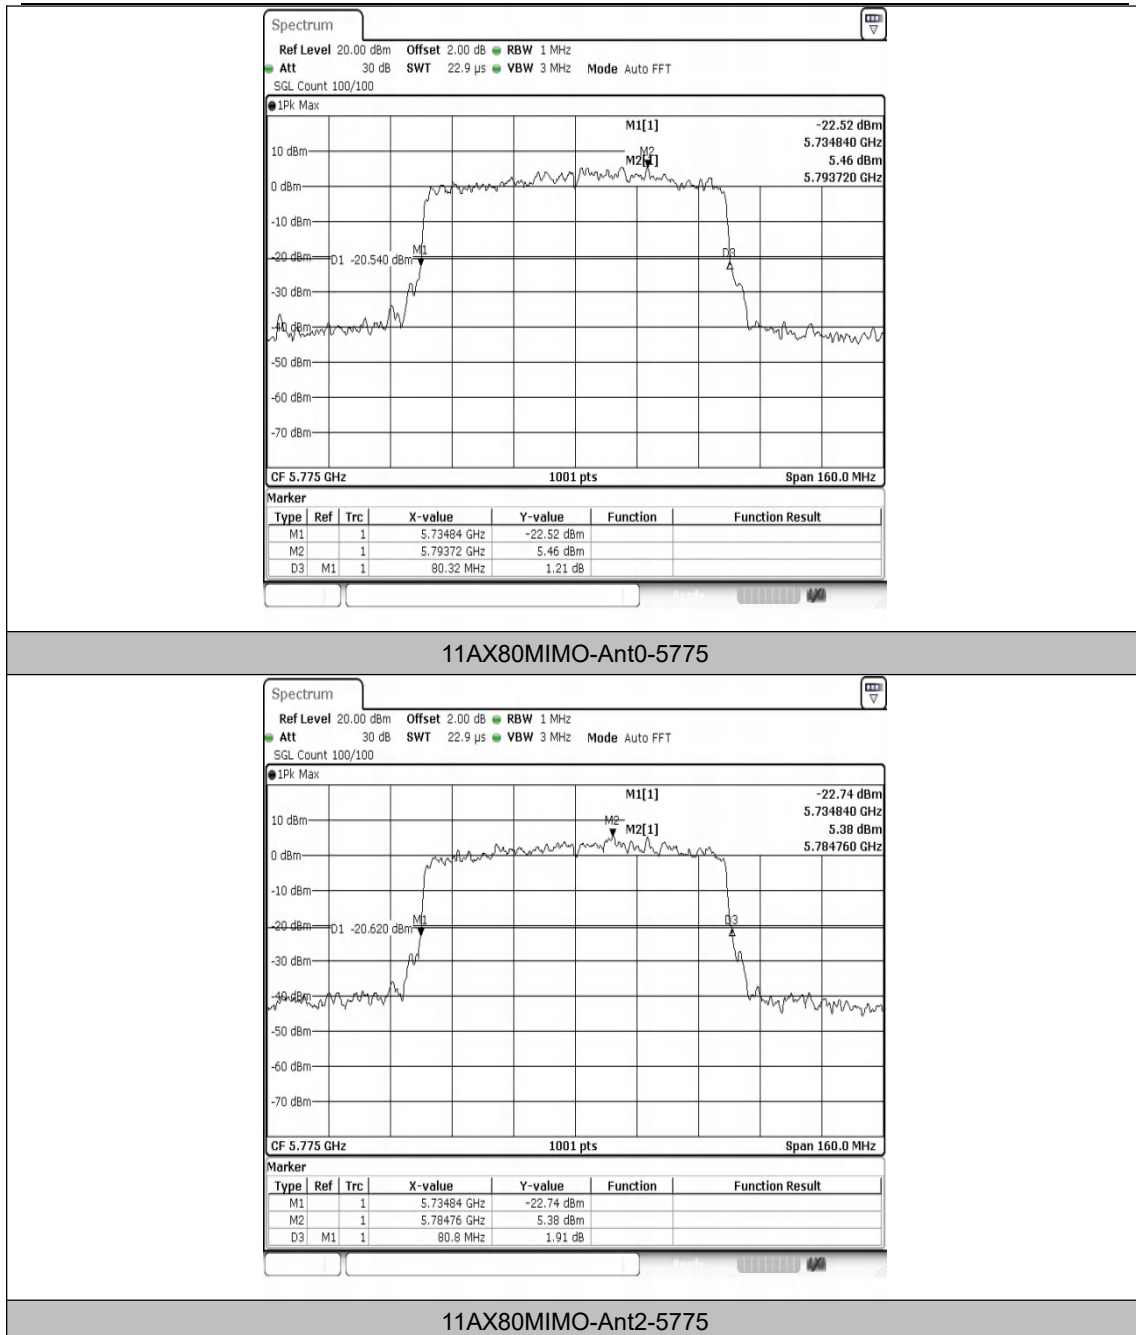



## Appendix A2: 99% Occupied Bandwidth

### Test Result

| Test Mode  | Antenna | Frequency [MHz] | OCB [MHz] | FL[MHz]   | FH[MHz]   | Limit[MHz] | Verdict |
|------------|---------|-----------------|-----------|-----------|-----------|------------|---------|
| 11A        | Ant0    | 5180            | 16.264    | 5171.8881 | 5188.1518 | ---        | ---     |
| 11A        | Ant2    | 5180            | 16.224    | 5171.8881 | 5188.1119 | ---        | ---     |
| 11A        | Ant0    | 5200            | 16.264    | 5191.8881 | 5208.1518 | ---        | ---     |
| 11A        | Ant2    | 5200            | 16.264    | 5191.8881 | 5208.1518 | ---        | ---     |
| 11A        | Ant0    | 5240            | 16.184    | 5231.8881 | 5248.0719 | ---        | ---     |
| 11A        | Ant2    | 5240            | 16.264    | 5231.8881 | 5248.1518 | ---        | ---     |
| 11A        | Ant0    | 5745            | 16.264    | 5736.8881 | 5753.1518 | ---        | ---     |
| 11A        | Ant2    | 5745            | 16.184    | 5736.8881 | 5753.0719 | ---        | ---     |
| 11A        | Ant0    | 5785            | 16.224    | 5776.8881 | 5793.1119 | ---        | ---     |
| 11A        | Ant2    | 5785            | 16.224    | 5776.8881 | 5793.1119 | ---        | ---     |
| 11A        | Ant0    | 5825            | 16.184    | 5816.8482 | 5833.0320 | ---        | ---     |
| 11A        | Ant2    | 5825            | 16.224    | 5816.8881 | 5833.1119 | ---        | ---     |
| 11N20MIMO  | Ant0    | 5180            | 17.343    | 5171.3287 | 5188.6713 | ---        | ---     |
| 11N20MIMO  | Ant2    | 5180            | 17.303    | 5171.3686 | 5188.6713 | ---        | ---     |
| 11N20MIMO  | Ant0    | 5200            | 17.343    | 5191.3287 | 5208.6713 | ---        | ---     |
| 11N20MIMO  | Ant2    | 5200            | 17.343    | 5191.3287 | 5208.6713 | ---        | ---     |
| 11N20MIMO  | Ant0    | 5240            | 17.343    | 5231.3287 | 5248.6713 | ---        | ---     |
| 11N20MIMO  | Ant2    | 5240            | 17.343    | 5231.3287 | 5248.6713 | ---        | ---     |
| 11N20MIMO  | Ant0    | 5745            | 17.303    | 5736.3287 | 5753.6314 | ---        | ---     |
| 11N20MIMO  | Ant2    | 5745            | 17.303    | 5736.3287 | 5753.6314 | ---        | ---     |
| 11N20MIMO  | Ant0    | 5785            | 17.343    | 5776.3287 | 5793.6713 | ---        | ---     |
| 11N20MIMO  | Ant2    | 5785            | 17.303    | 5776.3287 | 5793.6314 | ---        | ---     |
| 11N20MIMO  | Ant0    | 5825            | 17.303    | 5816.3287 | 5833.6314 | ---        | ---     |
| 11N20MIMO  | Ant2    | 5825            | 17.303    | 5816.3287 | 5833.6314 | ---        | ---     |
| 11N40MIMO  | Ant0    | 5190            | 35.724    | 5172.0979 | 5207.8222 | ---        | ---     |
| 11N40MIMO  | Ant2    | 5190            | 35.724    | 5172.0979 | 5207.8222 | ---        | ---     |
| 11N40MIMO  | Ant0    | 5230            | 35.724    | 5212.0180 | 5247.7423 | ---        | ---     |
| 11N40MIMO  | Ant2    | 5230            | 35.724    | 5212.0180 | 5247.7423 | ---        | ---     |
| 11N40MIMO  | Ant0    | 5755            | 35.724    | 5737.0180 | 5772.7423 | ---        | ---     |
| 11N40MIMO  | Ant2    | 5755            | 35.724    | 5737.0180 | 5772.7423 | ---        | ---     |
| 11N40MIMO  | Ant0    | 5795            | 35.724    | 5777.0180 | 5812.7423 | ---        | ---     |
| 11N40MIMO  | Ant2    | 5795            | 35.644    | 5777.0979 | 5812.7423 | ---        | ---     |
| 11AC20MIMO | Ant0    | 5180            | 17.423    | 5171.2887 | 5188.7113 | ---        | ---     |
| 11AC20MIMO | Ant2    | 5180            | 17.343    | 5171.3287 | 5188.6713 | ---        | ---     |
| 11AC20MIMO | Ant0    | 5200            | 17.383    | 5191.2887 | 5208.6713 | ---        | ---     |
| 11AC20MIMO | Ant2    | 5200            | 17.383    | 5191.2887 | 5208.6713 | ---        | ---     |
| 11AC20MIMO | Ant0    | 5240            | 17.383    | 5231.2488 | 5248.6314 | ---        | ---     |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|            |      |      |        |           |           |     |     |
|------------|------|------|--------|-----------|-----------|-----|-----|
| 11AC20MIMO | Ant2 | 5240 | 17.423 | 5231.2488 | 5248.6713 | --- | --- |
| 11AC20MIMO | Ant0 | 5745 | 17.423 | 5736.2488 | 5753.6713 | --- | --- |
| 11AC20MIMO | Ant2 | 5745 | 17.383 | 5736.2887 | 5753.6713 | --- | --- |
| 11AC20MIMO | Ant0 | 5785 | 17.383 | 5776.2887 | 5793.6713 | --- | --- |
| 11AC20MIMO | Ant2 | 5785 | 17.423 | 5776.2488 | 5793.6713 | --- | --- |
| 11AC20MIMO | Ant0 | 5825 | 17.423 | 5816.2488 | 5833.6713 | --- | --- |
| 11AC20MIMO | Ant2 | 5825 | 17.343 | 5816.2887 | 5833.6314 | --- | --- |
| 11AC40MIMO | Ant0 | 5190 | 35.564 | 5172.2577 | 5207.8222 | --- | --- |
| 11AC40MIMO | Ant2 | 5190 | 35.485 | 5172.2577 | 5207.7423 | --- | --- |
| 11AC40MIMO | Ant0 | 5230 | 35.485 | 5212.1778 | 5247.6623 | --- | --- |
| 11AC40MIMO | Ant2 | 5230 | 35.485 | 5212.1778 | 5247.6623 | --- | --- |
| 11AC40MIMO | Ant0 | 5755 | 35.564 | 5737.1778 | 5772.7423 | --- | --- |
| 11AC40MIMO | Ant2 | 5755 | 35.564 | 5737.1778 | 5772.7423 | --- | --- |
| 11AC40MIMO | Ant0 | 5795 | 35.485 | 5777.2577 | 5812.7423 | --- | --- |
| 11AC40MIMO | Ant2 | 5795 | 35.564 | 5777.1778 | 5812.7423 | --- | --- |
| 11AC80MIMO | Ant0 | 5210 | 76.084 | 5171.6384 | 5247.7223 | --- | --- |
| 11AC80MIMO | Ant2 | 5210 | 75.924 | 5171.7982 | 5247.7223 | --- | --- |
| 11AC80MIMO | Ant0 | 5775 | 76.084 | 5736.9580 | 5813.0420 | --- | --- |
| 11AC80MIMO | Ant2 | 5775 | 76.244 | 5736.9580 | 5813.2018 | --- | --- |
| 11AX20MIMO | Ant0 | 5180 | 18.661 | 5170.6094 | 5189.2707 | --- | --- |
| 11AX20MIMO | Ant2 | 5180 | 18.621 | 5170.6494 | 5189.2707 | --- | --- |
| 11AX20MIMO | Ant0 | 5200 | 18.621 | 5190.6094 | 5209.2308 | --- | --- |
| 11AX20MIMO | Ant2 | 5200 | 18.661 | 5190.6094 | 5209.2707 | --- | --- |
| 11AX20MIMO | Ant0 | 5240 | 18.581 | 5230.6494 | 5249.2308 | --- | --- |
| 11AX20MIMO | Ant2 | 5240 | 18.621 | 5230.6094 | 5249.2308 | --- | --- |
| 11AX20MIMO | Ant0 | 5745 | 18.621 | 5735.6094 | 5754.2308 | --- | --- |
| 11AX20MIMO | Ant2 | 5745 | 18.621 | 5735.6094 | 5754.2308 | --- | --- |
| 11AX20MIMO | Ant0 | 5785 | 18.581 | 5775.6094 | 5794.1908 | --- | --- |
| 11AX20MIMO | Ant2 | 5785 | 18.621 | 5775.6094 | 5794.2308 | --- | --- |
| 11AX20MIMO | Ant0 | 5825 | 18.541 | 5815.6494 | 5834.1908 | --- | --- |
| 11AX20MIMO | Ant2 | 5825 | 18.581 | 5815.6094 | 5834.1908 | --- | --- |
| 11AX40MIMO | Ant0 | 5190 | 36.923 | 5171.6184 | 5208.5415 | --- | --- |
| 11AX40MIMO | Ant2 | 5190 | 36.923 | 5171.6184 | 5208.5415 | --- | --- |
| 11AX40MIMO | Ant0 | 5230 | 37.003 | 5211.4585 | 5248.4615 | --- | --- |
| 11AX40MIMO | Ant2 | 5230 | 36.843 | 5211.5385 | 5248.3816 | --- | --- |
| 11AX40MIMO | Ant0 | 5755 | 37.003 | 5736.5385 | 5773.5415 | --- | --- |
| 11AX40MIMO | Ant2 | 5755 | 36.923 | 5736.5385 | 5773.4615 | --- | --- |
| 11AX40MIMO | Ant0 | 5795 | 36.923 | 5776.5385 | 5813.4615 | --- | --- |
| 11AX40MIMO | Ant2 | 5795 | 36.923 | 5776.5385 | 5813.4615 | --- | --- |
| 11AX80MIMO | Ant0 | 5210 | 76.883 | 5171.6384 | 5248.5215 | --- | --- |
| 11AX80MIMO | Ant2 | 5210 | 76.563 | 5171.7982 | 5248.3616 | --- | --- |
| 11AX80MIMO | Ant0 | 5775 | 76.563 | 5737.1179 | 5813.6813 | --- | --- |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


|            |      |      |        |           |           |     |     |
|------------|------|------|--------|-----------|-----------|-----|-----|
| 11AX80MIMO | Ant2 | 5775 | 76.563 | 5736.9580 | 5813.5215 | --- | --- |
|------------|------|------|--------|-----------|-----------|-----|-----|

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs

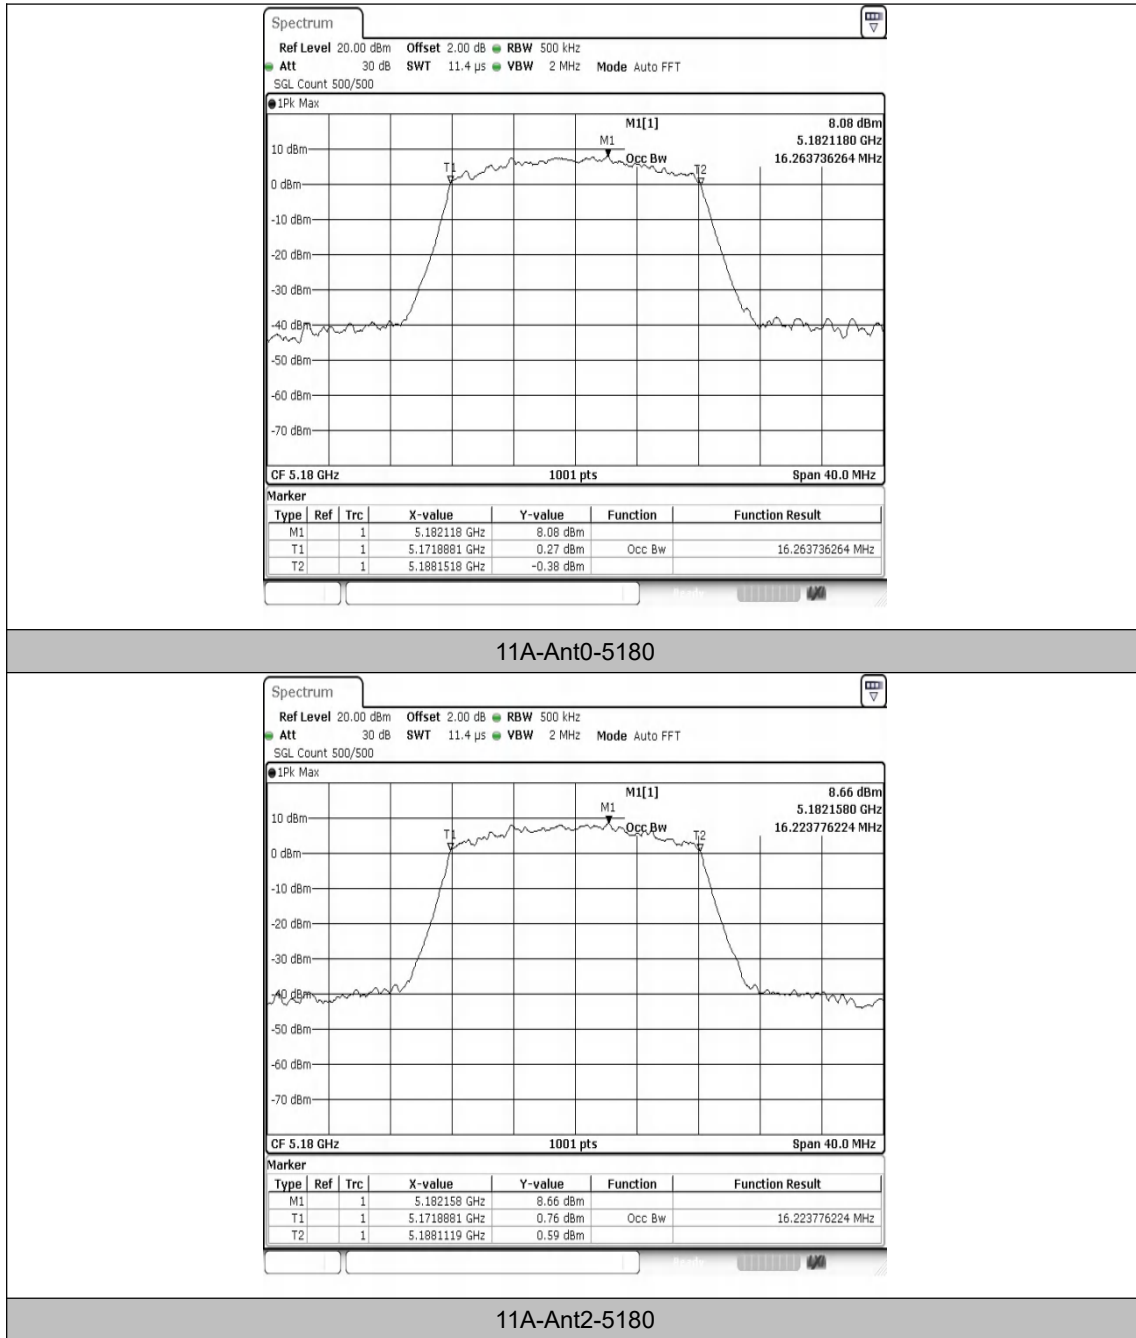

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

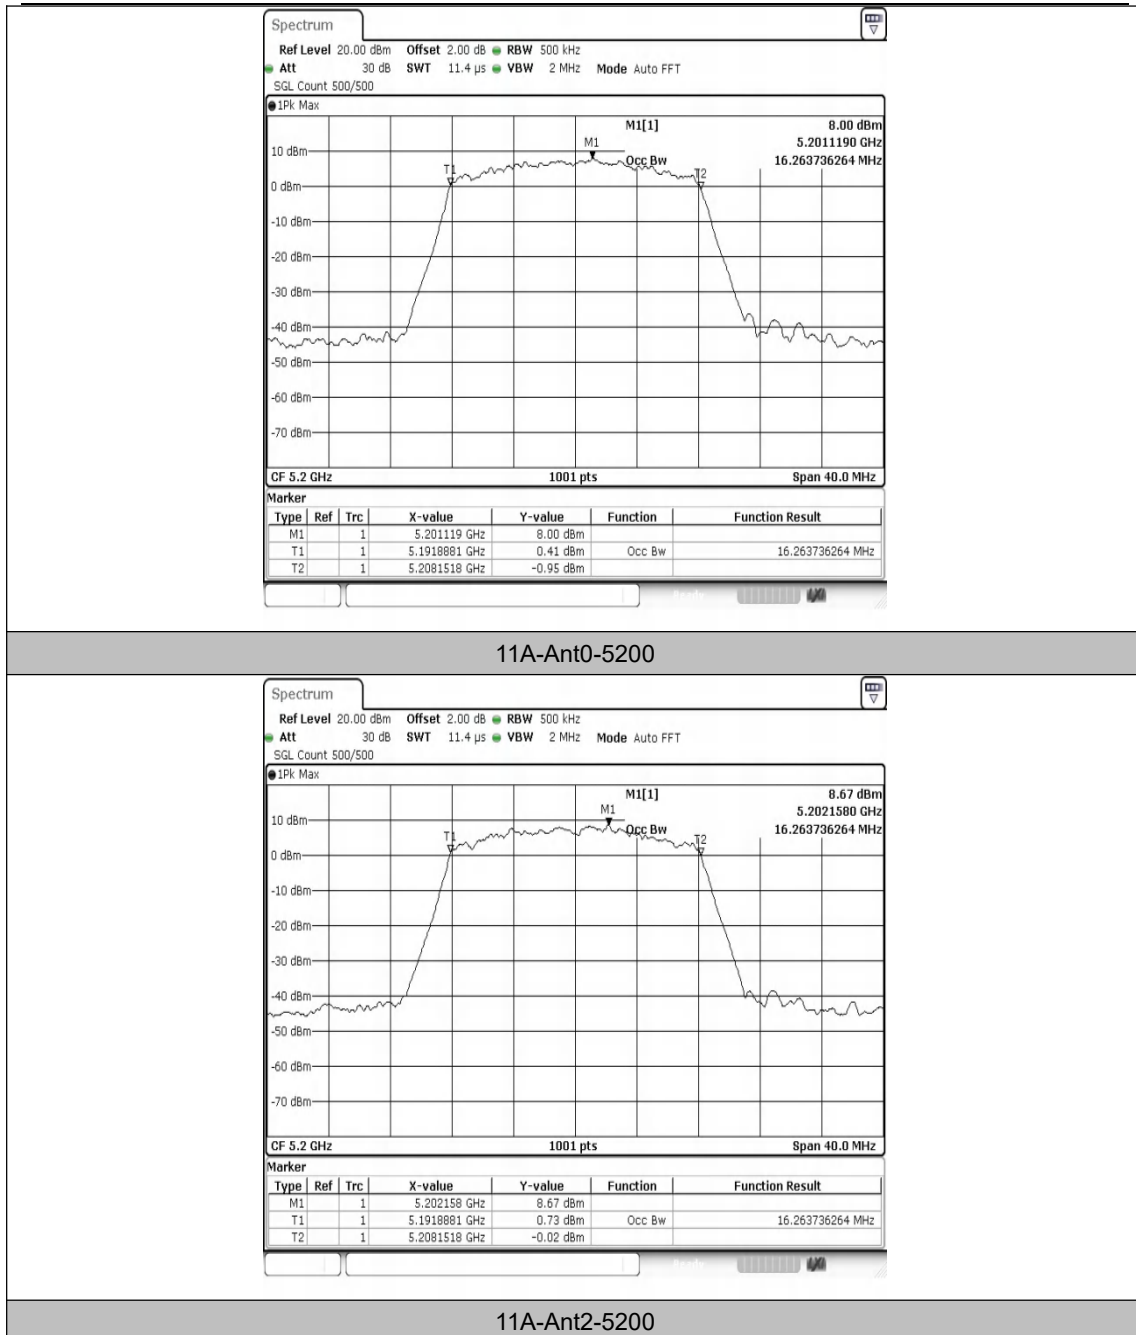


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

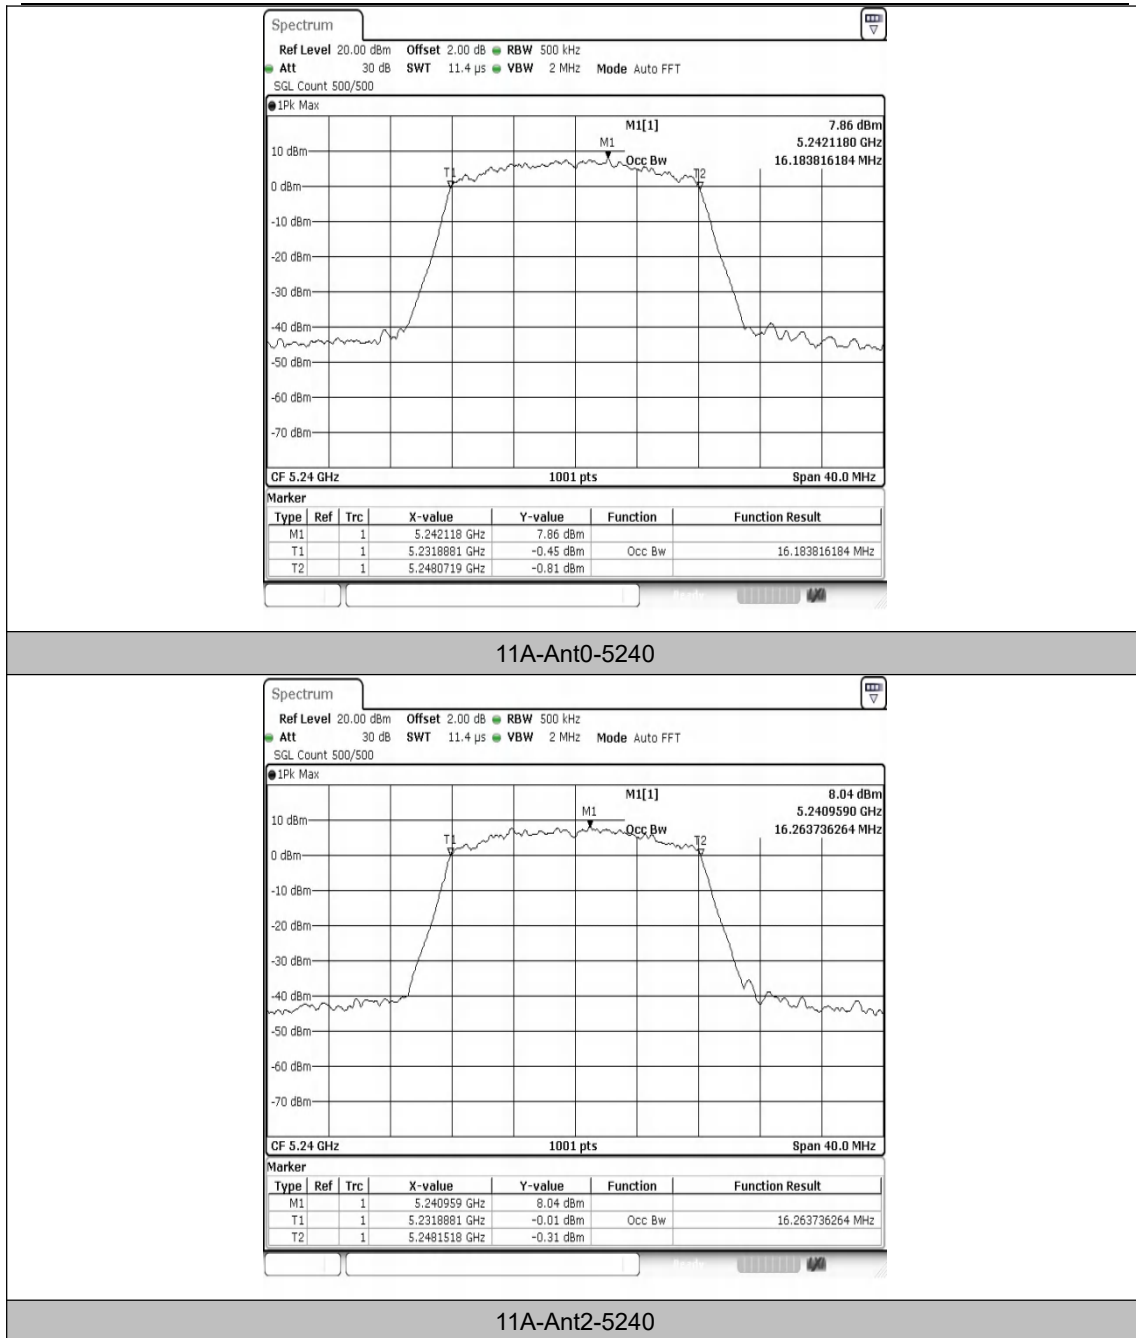

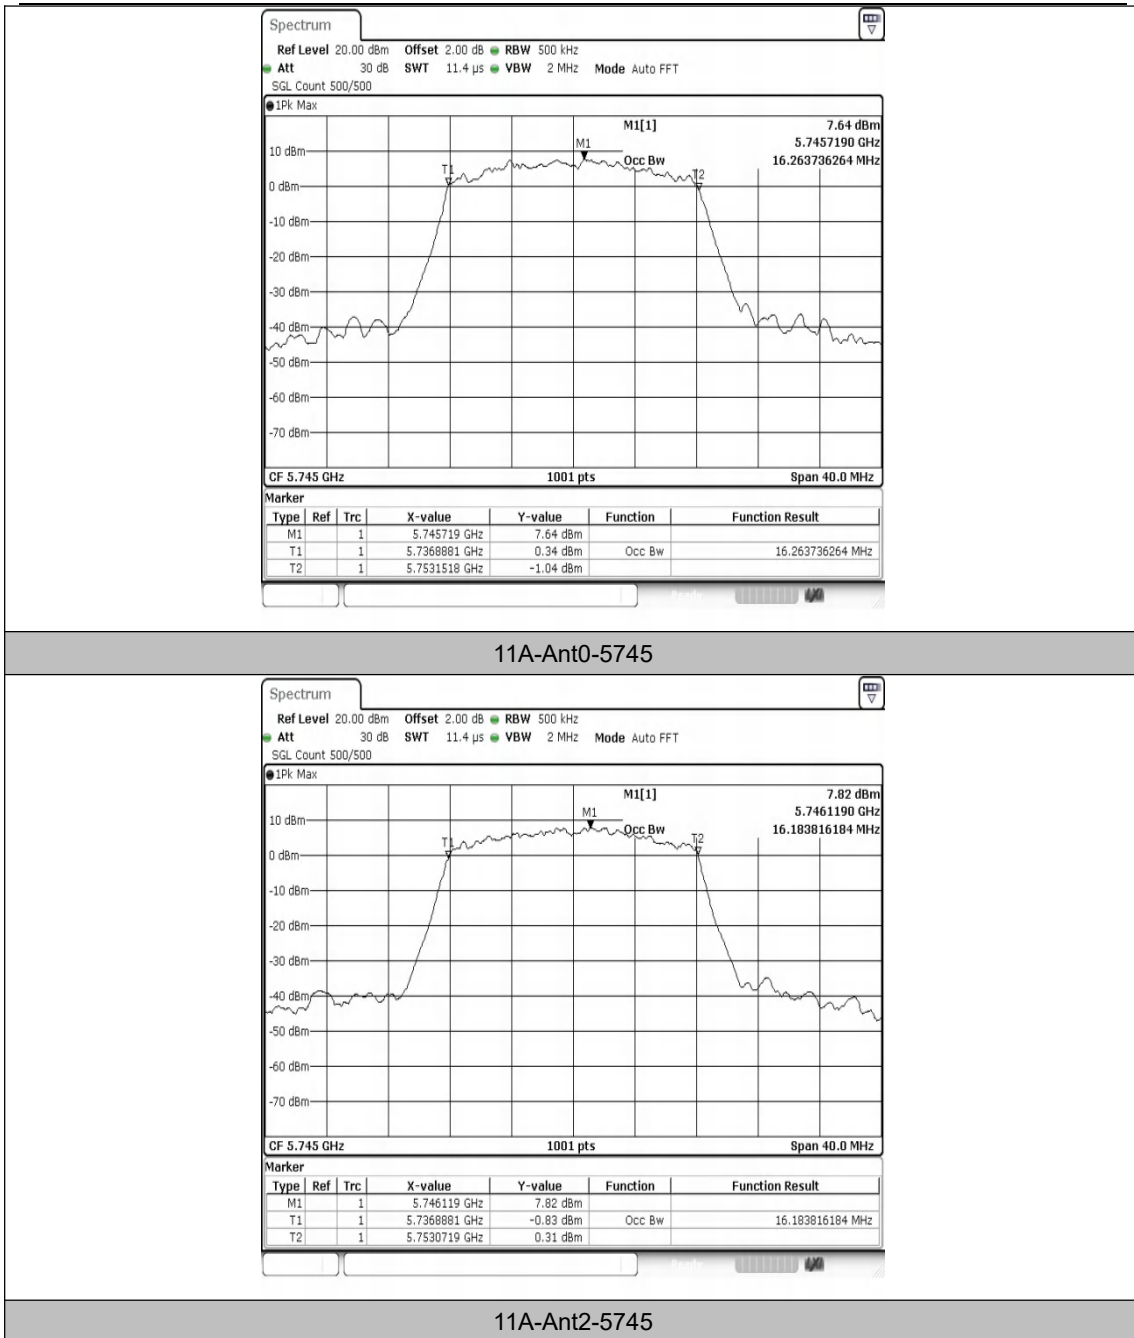




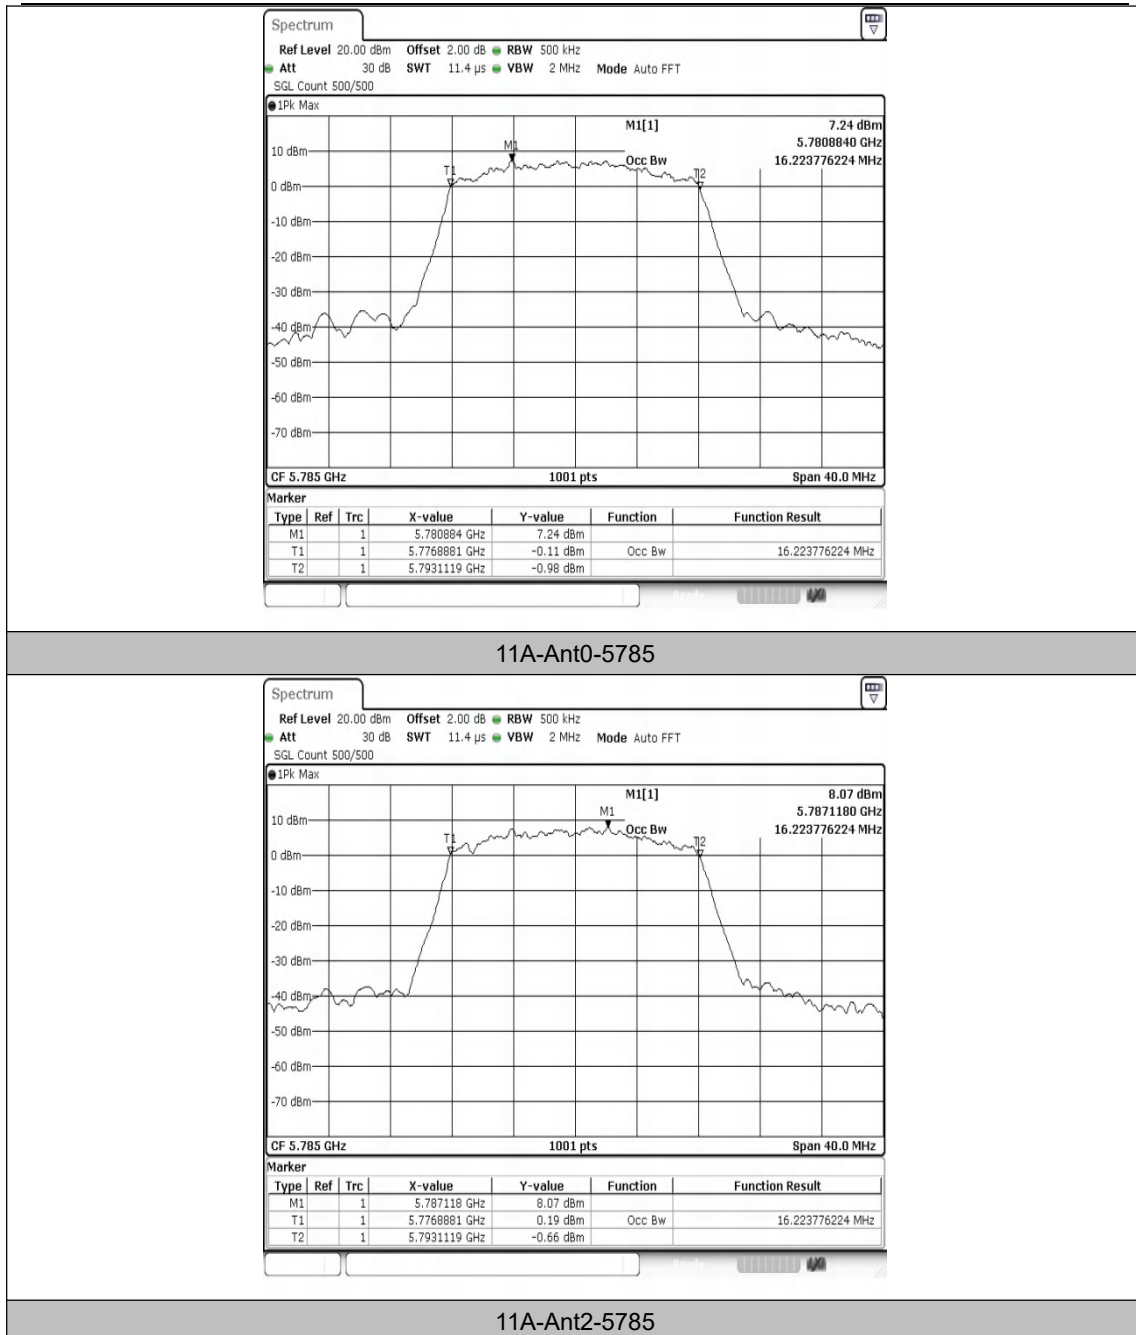


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

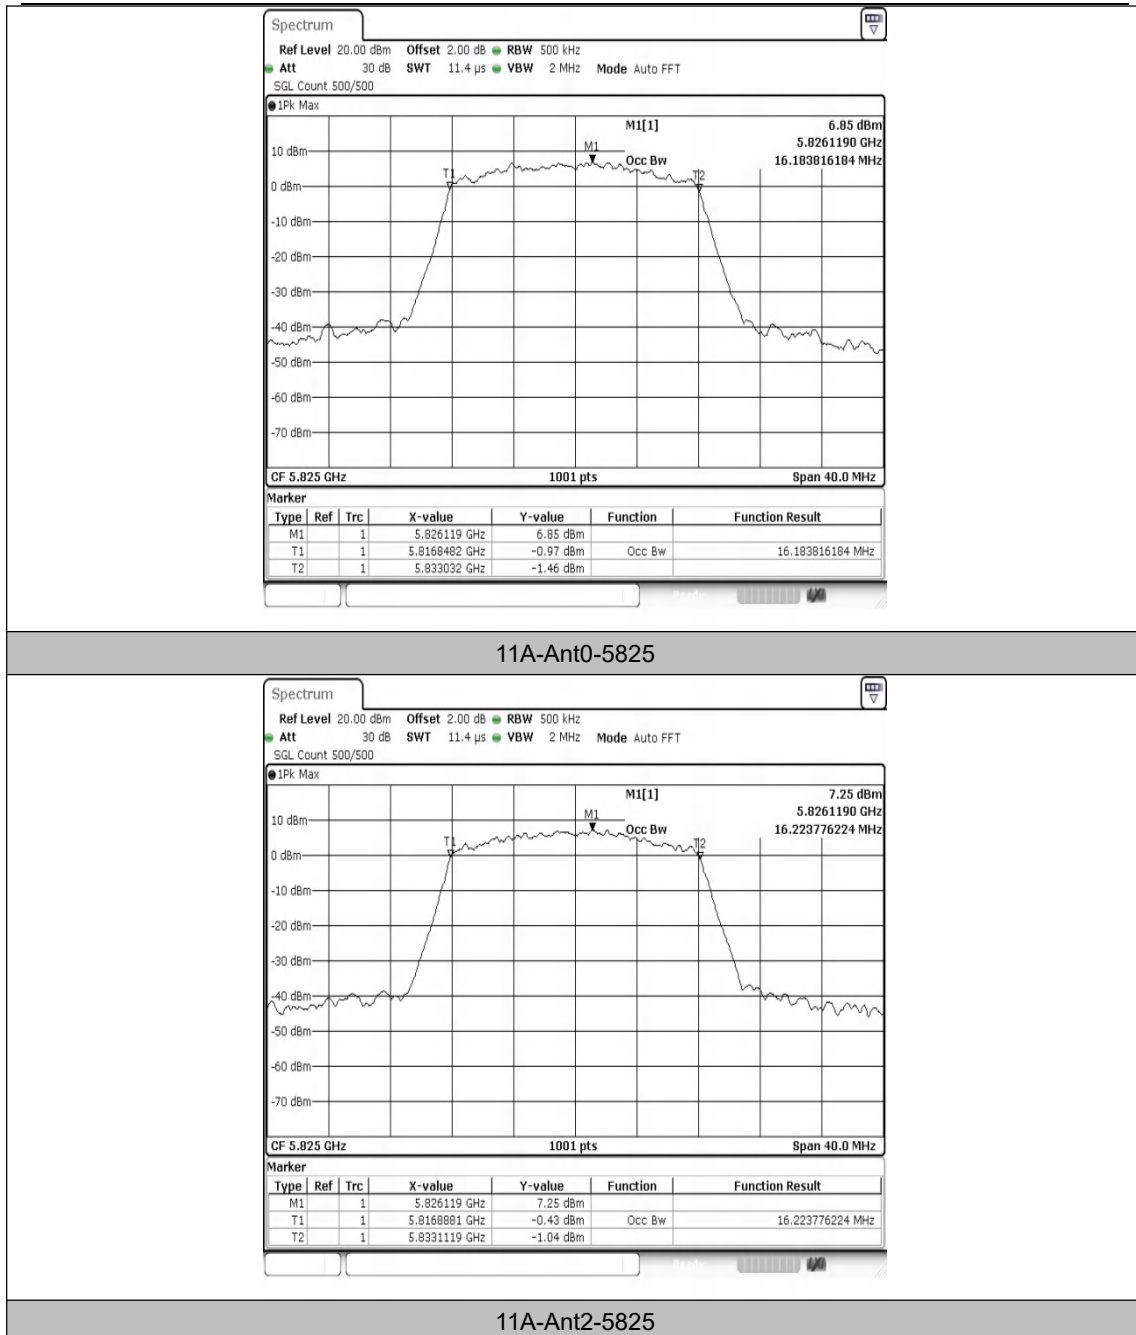


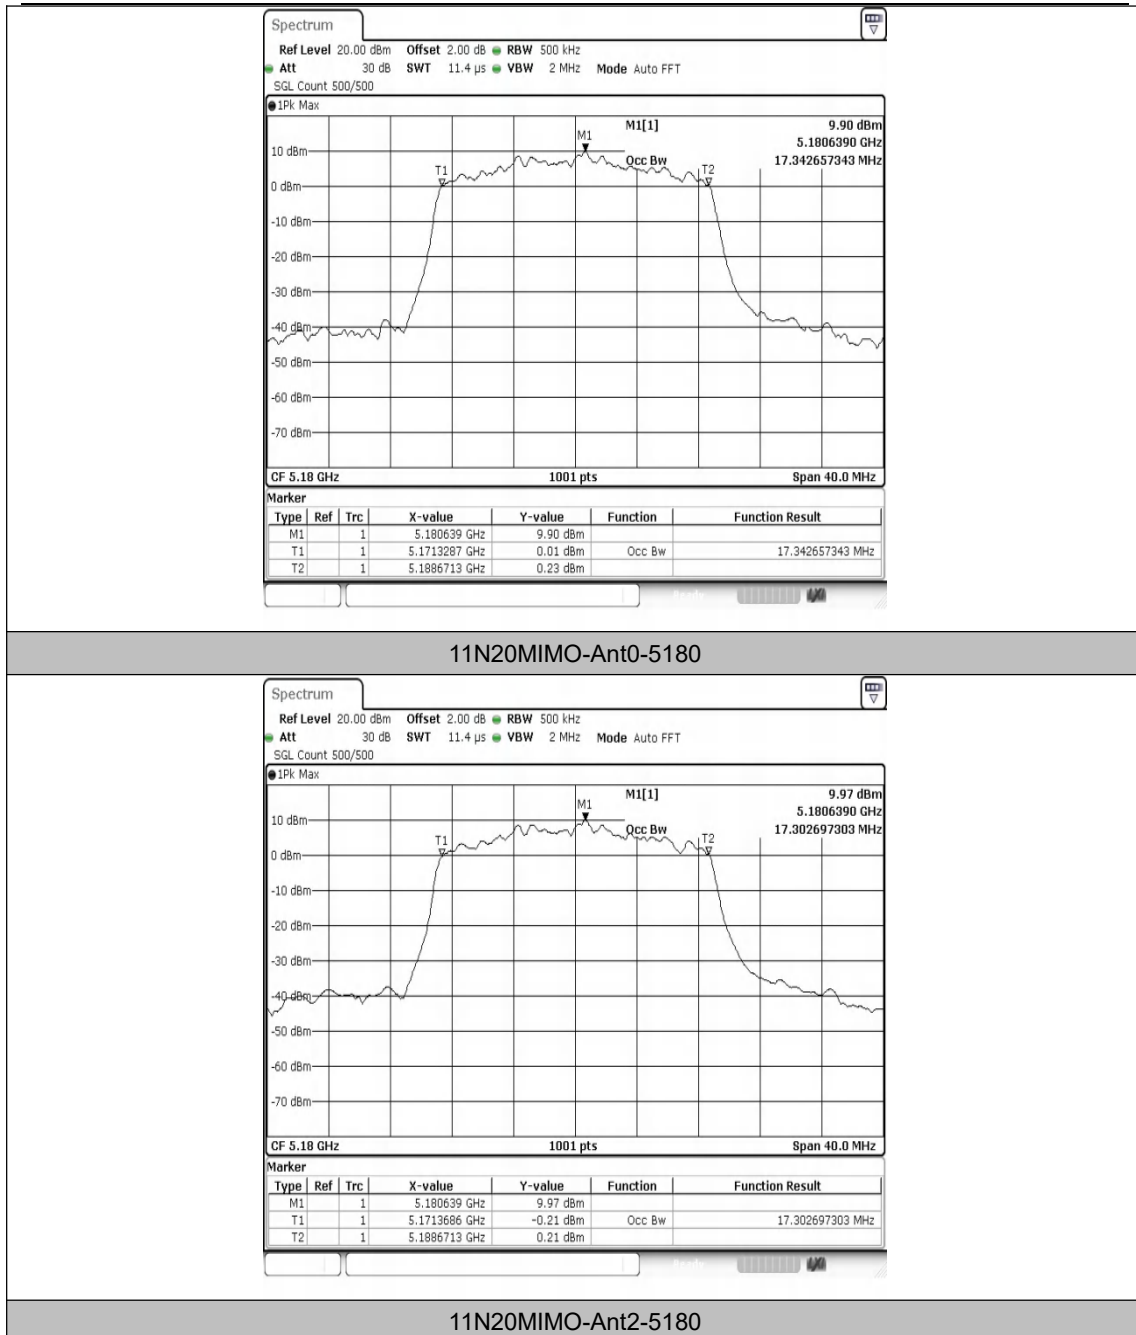

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

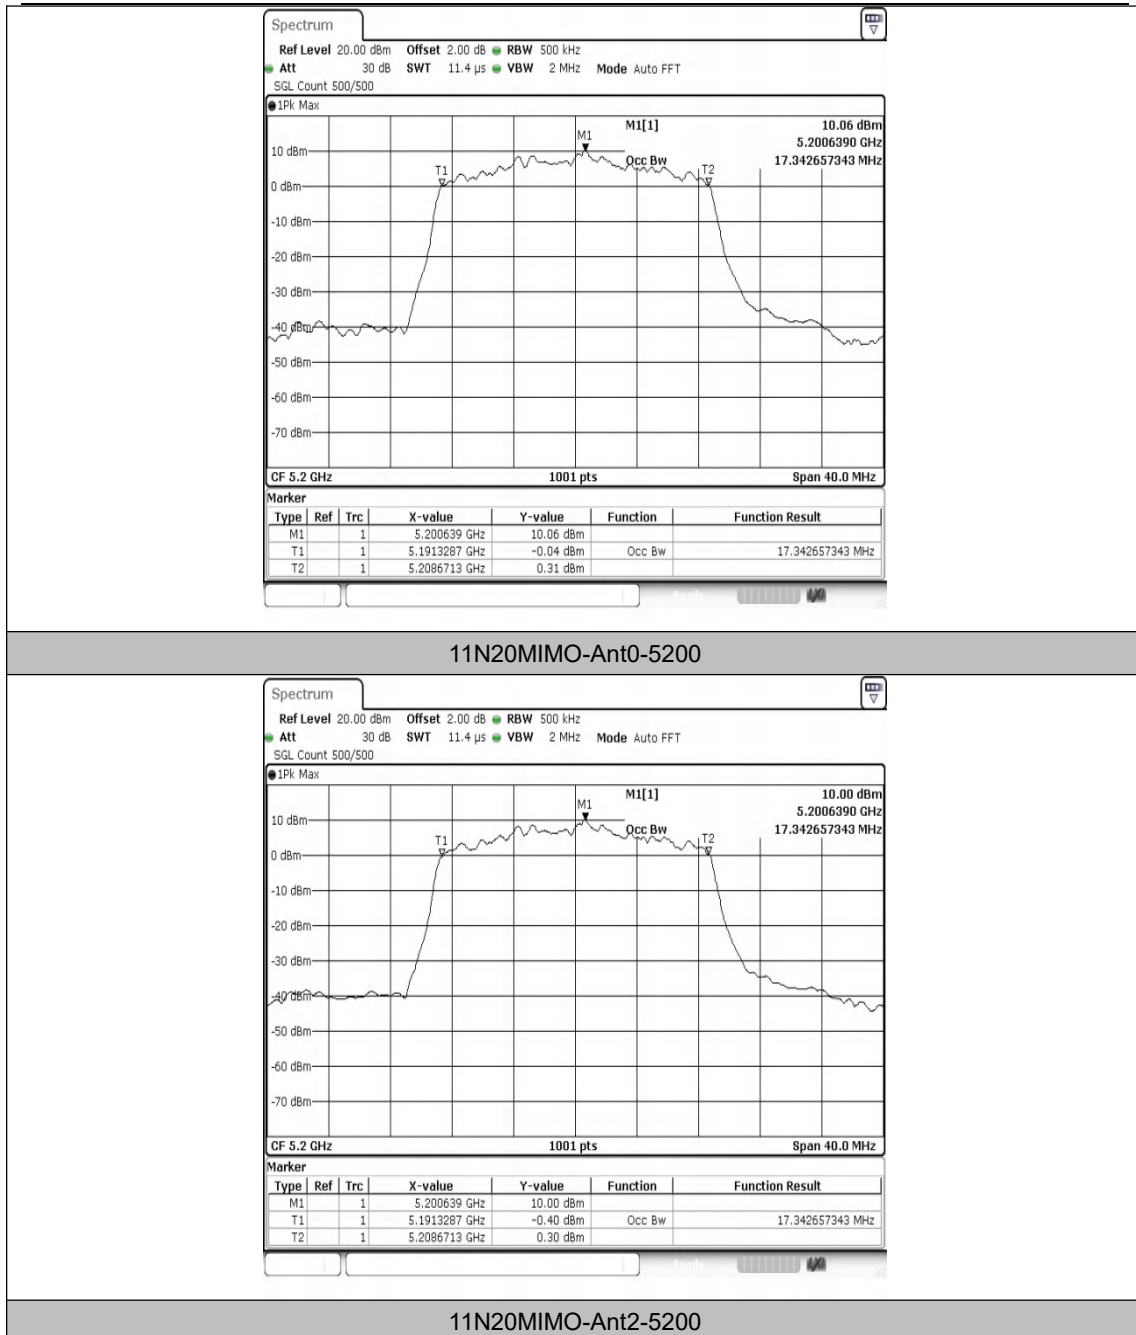

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

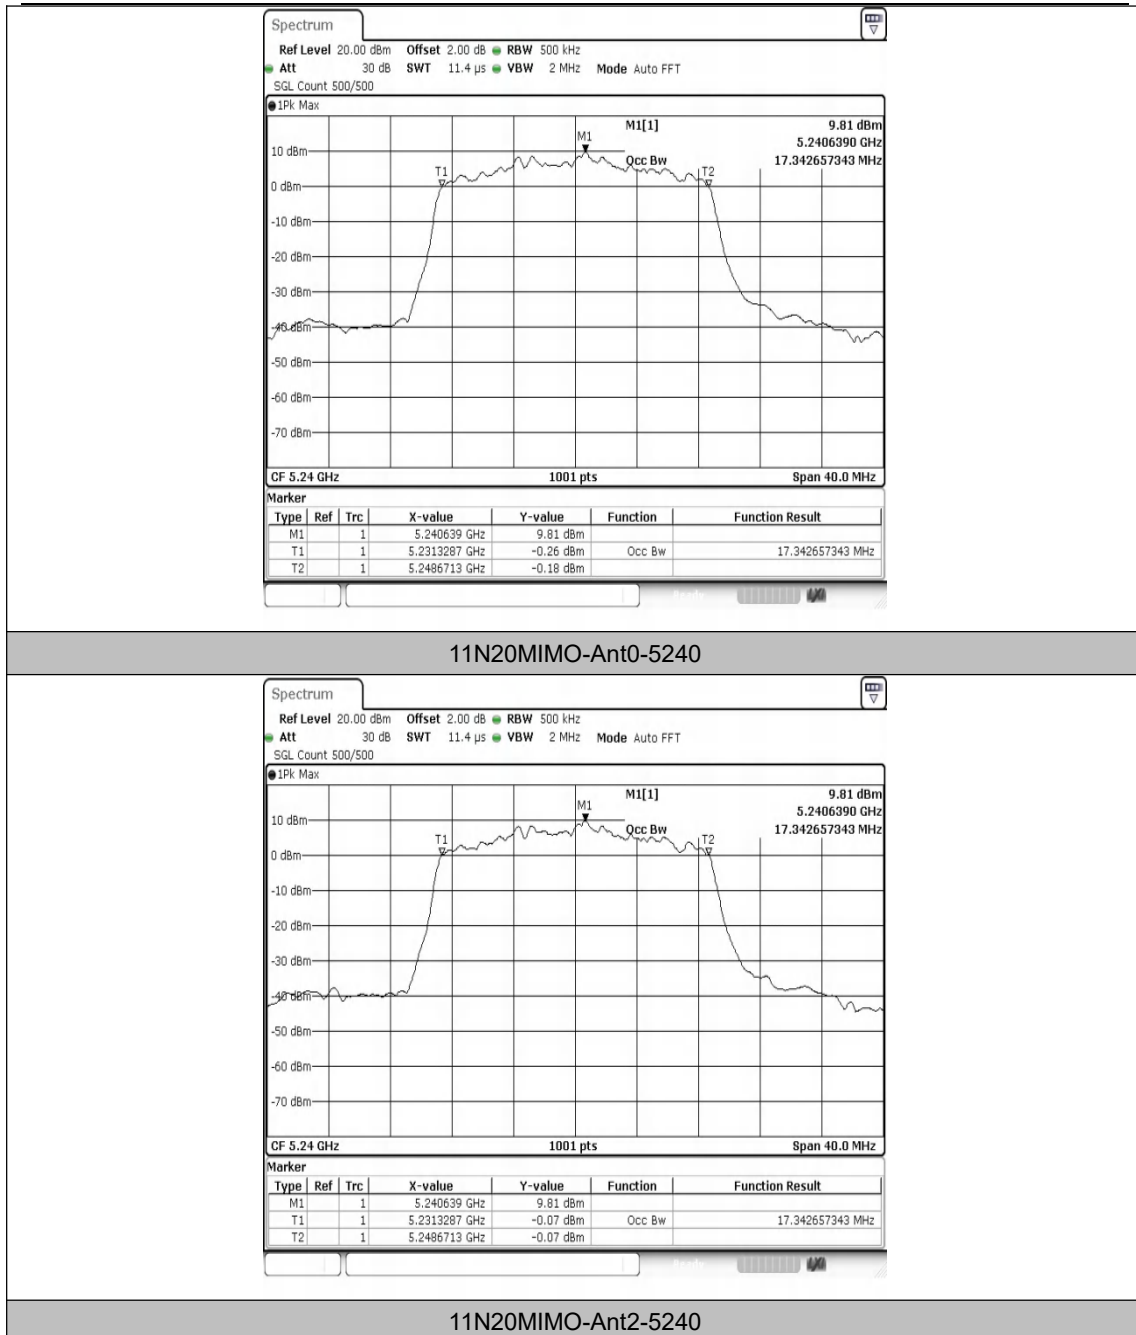

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

