

SGS-CSTC Standards Technical Services Co., Ltd. Shenzhen Branch

SZEMC-TRF-01 Rev. A/2

Report No.: SZCR251000471505

Page: 196 of 277

					9	10.74	-19.26	Pass
802.11g	SISO	2412	/	/	8	7.24	-22.76	Pass
					9	8.14	-21.86	Pass
		2437	/	/	8	7.24	-22.76	Pass
					9	8.14	-21.86	Pass
		2462	/	/	8	7.24	-22.76	Pass
					9	8.14	-21.86	Pass
802.11n (HT20)	MIMO	2412	/	/	8	5.47	-24.53	Pass
					9	6.00	-24.00	Pass
		2437	/	/	8	5.47	-24.53	Pass
					9	6.00	-24.00	Pass
		2462	/	/	8	5.47	-24.53	Pass
					9	6.00	-24.00	Pass
802.11n (HT40)	MIMO	2422	/	/	8	2.83	-27.17	Pass
					9	3.53	-26.47	Pass
		2437	/	/	8	2.83	-27.17	Pass
					9	3.53	-26.47	Pass
		2452	/	/	8	2.83	-27.17	Pass
					9	3.53	-26.47	Pass
802.11ax (HEW20)	MIMO	2412	RU26	Left	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
			RU52	Left	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
			RU106	Left	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
			RU242	Left	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
		2437	RU26	Mid	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
			RU52	Mid	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
			RU106	Left	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
			RU242	Left	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
		2462	RU26	Right	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
			RU52	Right	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
			RU106	Right	8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch Testing Laboratory

No.1 Workshop, M-10, Middle Section, Science & Technology Park, Nanshan District, Shenzhen, Guangdong, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com.cn
中国·广东·深圳市南山区科技园中区M-10栋1号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd. Shenzhen Branch

SZEMC-TRF-01 Rev. A/2

Report No.: SZCR251000471505

Page: 197 of 277

802.11ax (HEW40)	MIMO		RU242	Left	9	6.47	-23.53	Pass
					8	6.84	-23.16	Pass
					9	6.47	-23.53	Pass
		2422	RU242	Left	8	5.23	-24.77	Pass
					9	5.13	-24.87	Pass
					8	5.23	-24.77	Pass
		2437	RU484	Left	9	5.13	-24.87	Pass
					8	5.23	-24.77	Pass
					9	5.13	-24.87	Pass
		2452	RU242	Left	8	5.23	-24.77	Pass
					9	5.13	-24.87	Pass
					8	5.23	-24.77	Pass
		2452	RU484	Left	9	5.13	-24.87	Pass
					8	5.23	-24.77	Pass
					9	5.13	-24.87	Pass

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2020, the channel contains the maximum PSD level was used to establish the reference level.



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch (Shenzhen) Laboratory


No.1 Workshop, M-10, Middle Section, Science & Technology Park, Nanshan District, Shenzhen, Guangdong, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com.cn
中国·广东·深圳市南山区科技园中区M-10栋1号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

5.2 Test Graph


5.2.1 Ref

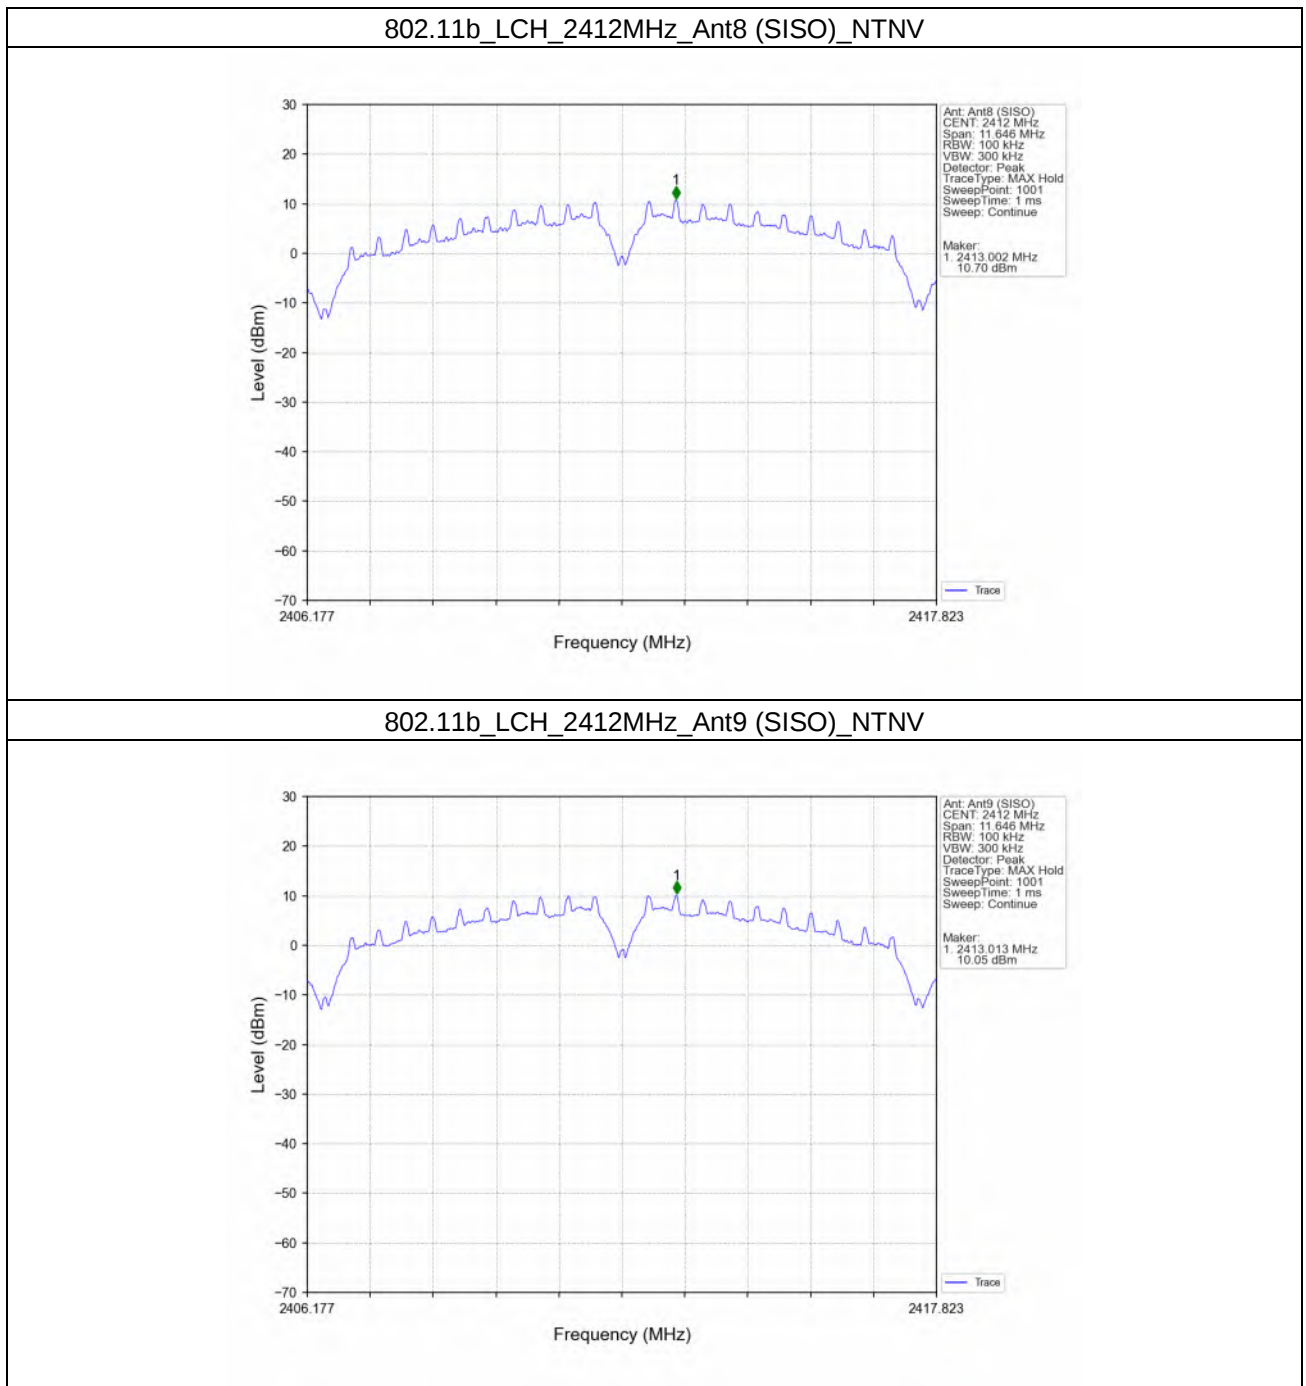

802.11b_MCH_2437MHz_Ant8 (SISO)_NTNV

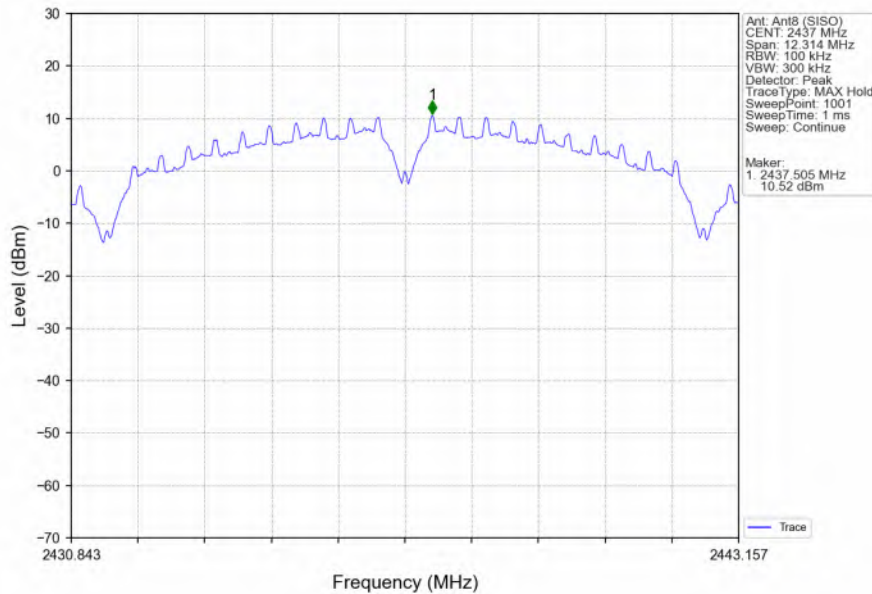


802.11b_MCH_2437MHz_Ant9 (SISO)_NTNV

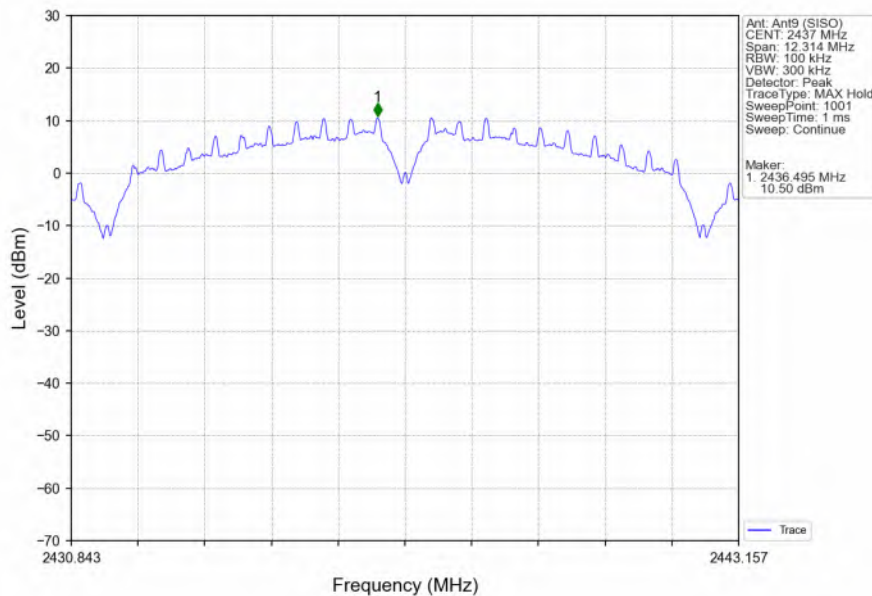


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

802.11b_HCH_2462MHz_Ant8 (SISO)_NTNV

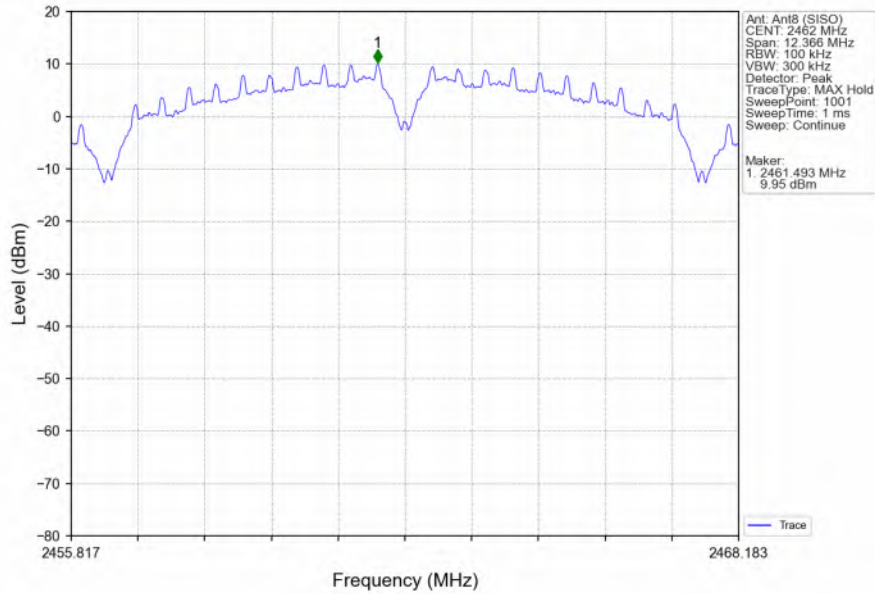


802.11b_HCH_2462MHz_Ant9 (SISO)_NTNV

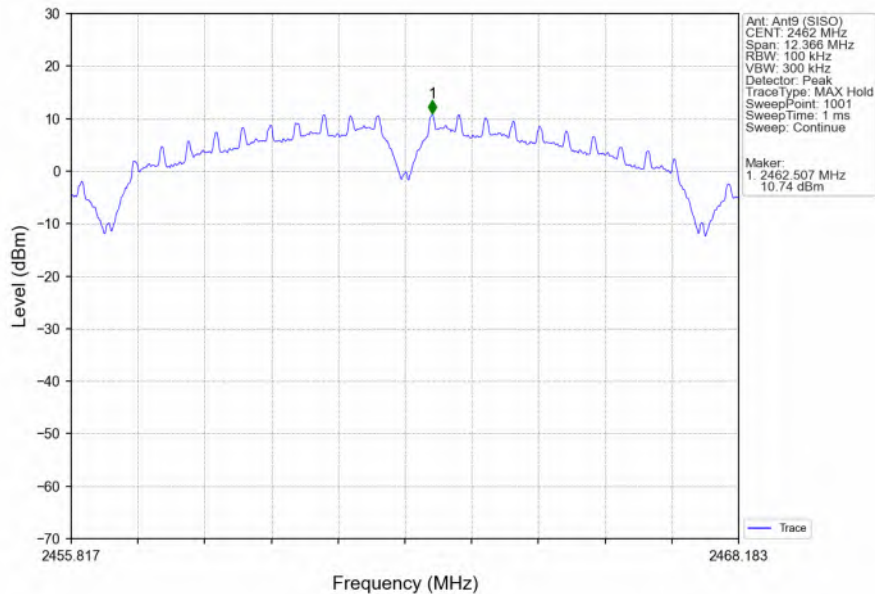


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


802.11g_LCH_2412MHz_Ant8 (SISO)_NTNV

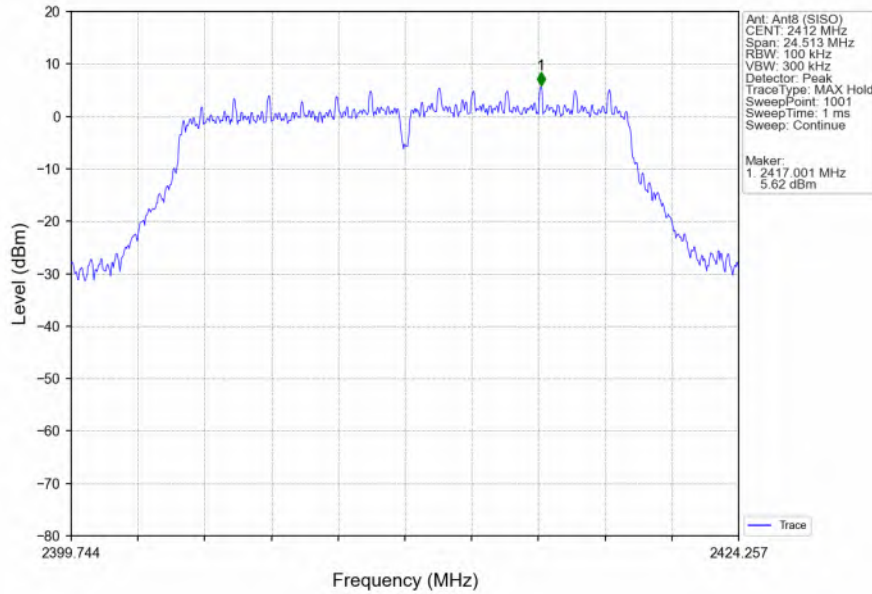


802.11g_LCH_2412MHz_Ant9 (SISO)_NTNV

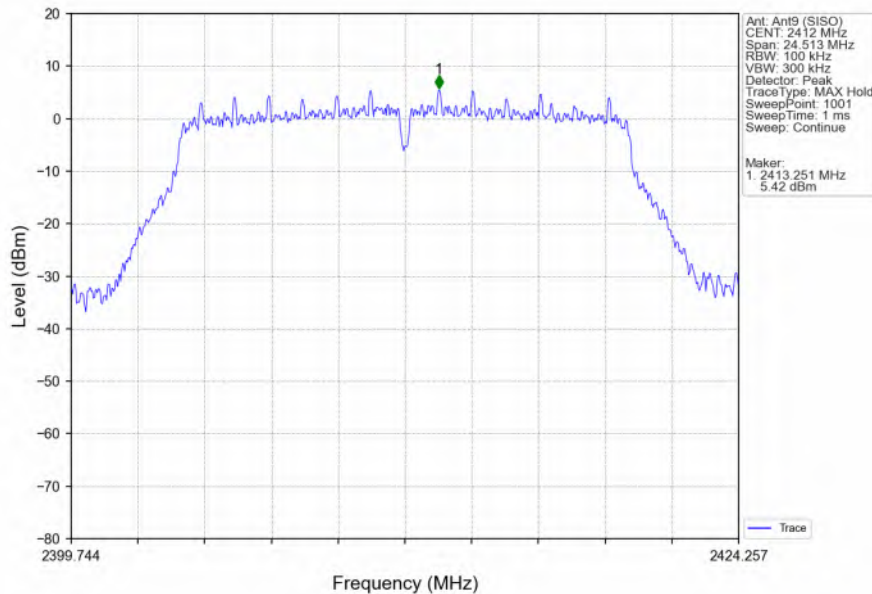


802.11g_MCH_2437MHz_Ant8 (SISO)_NTNV

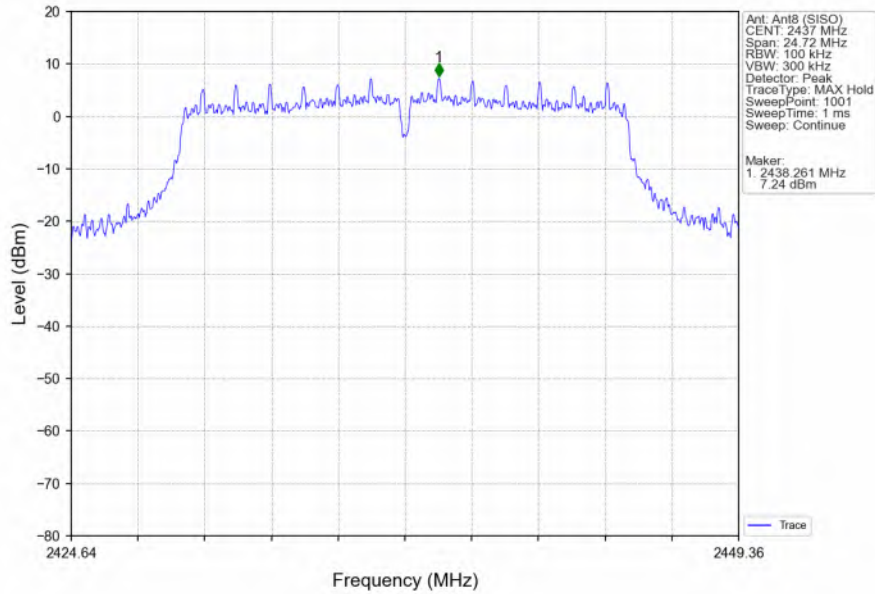


802.11g_MCH_2437MHz_Ant9 (SISO)_NTNV

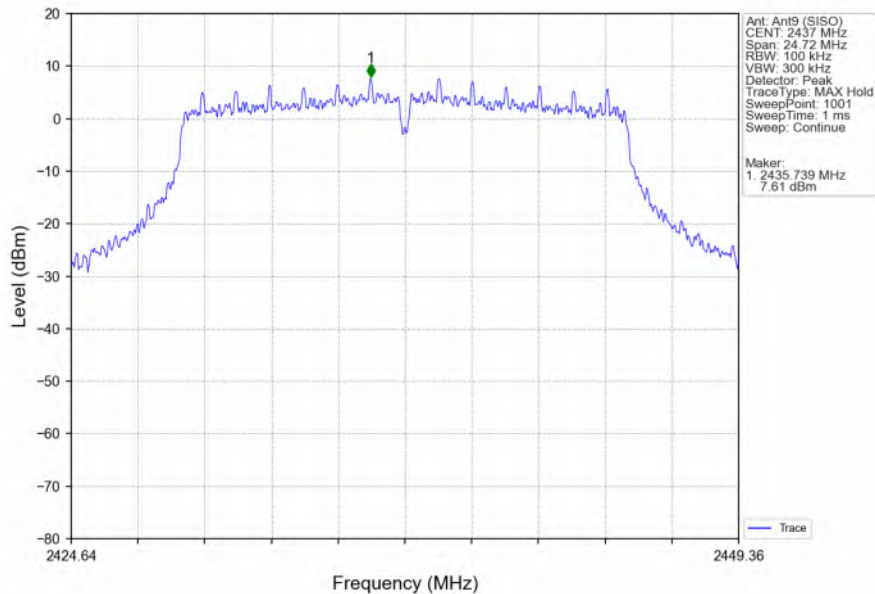


802.11g_HCH_2462MHz_Ant8 (SISO)_NTNV

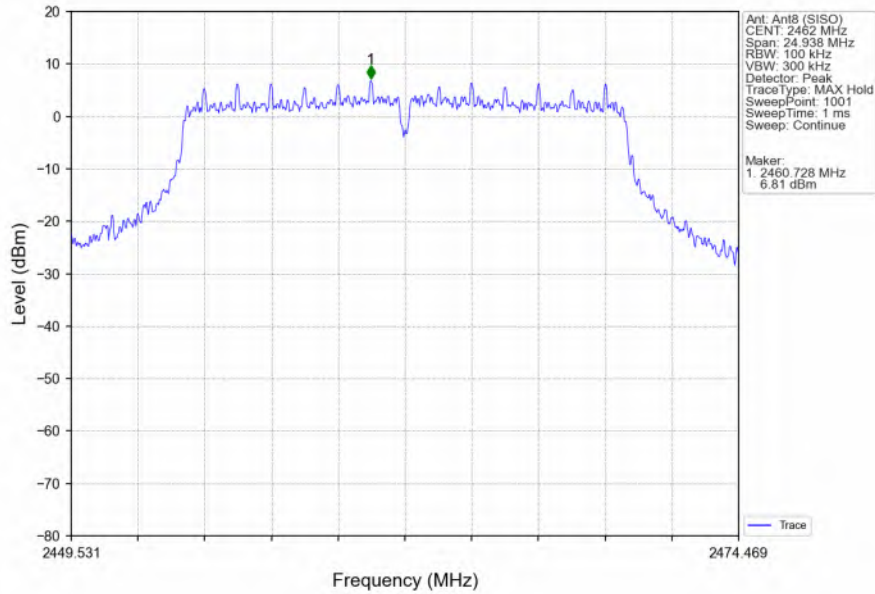


802.11g_HCH_2462MHz_Ant9 (SISO)_NTNV

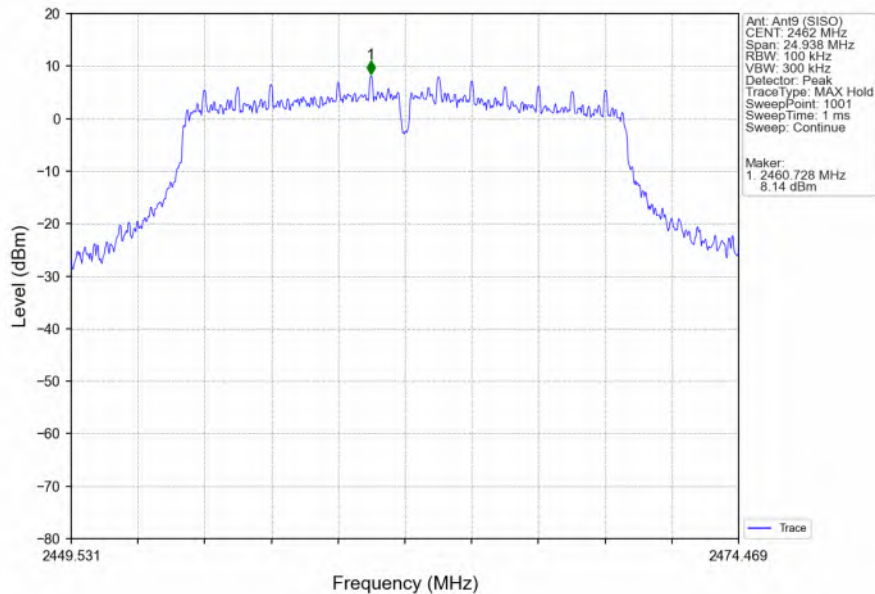


802.11n(HT20)_LCH_2412MHz_Ant8 (MIMO)_NTNV

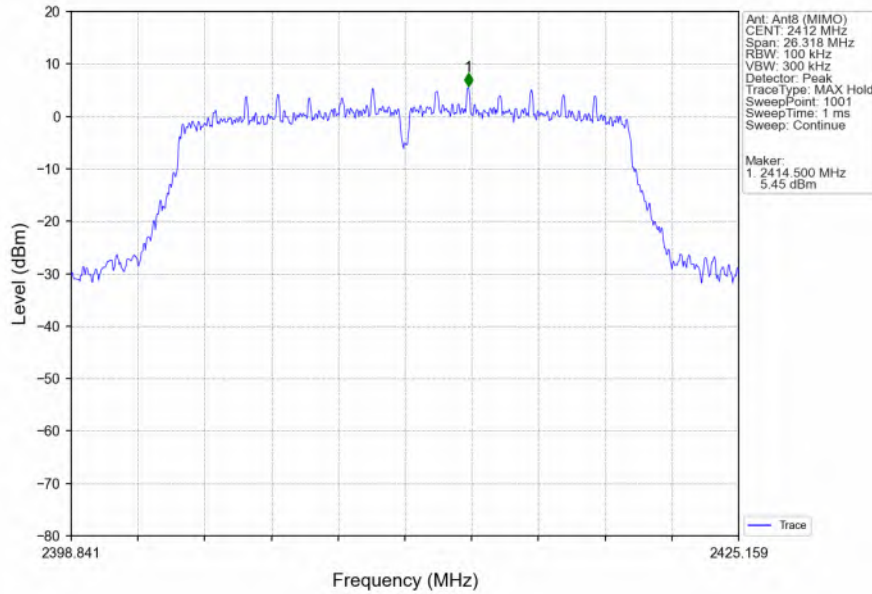


802.11n(HT20)_LCH_2412MHz_Ant9 (MIMO)_NTNV

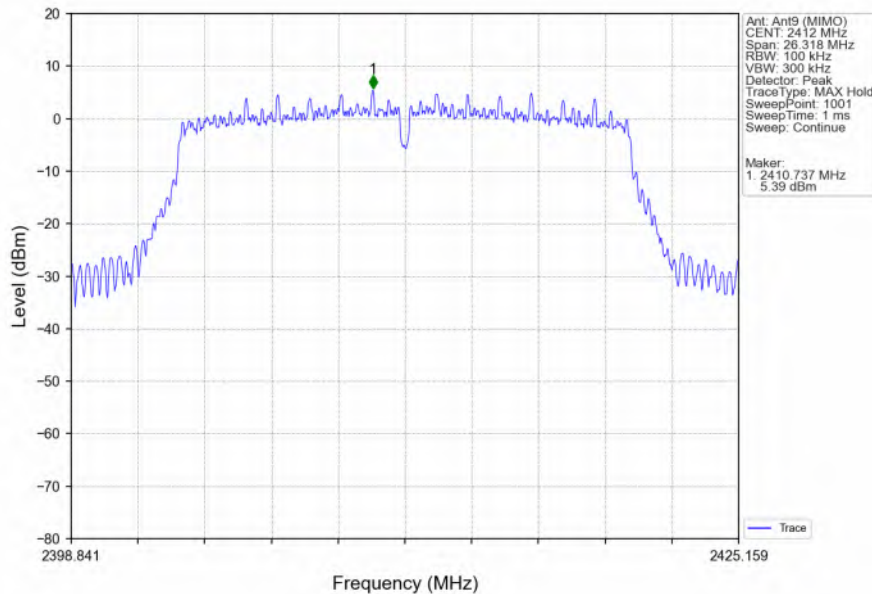


802.11n(HT20)_MCH_2437MHz_Ant8 (MIMO)_NTNV

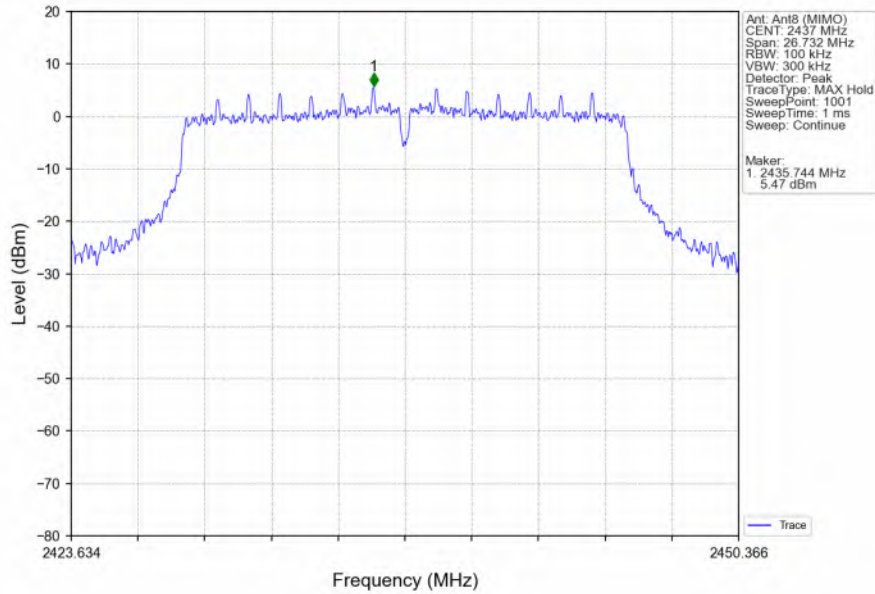


802.11n(HT20)_MCH_2437MHz_Ant9 (MIMO)_NTNV

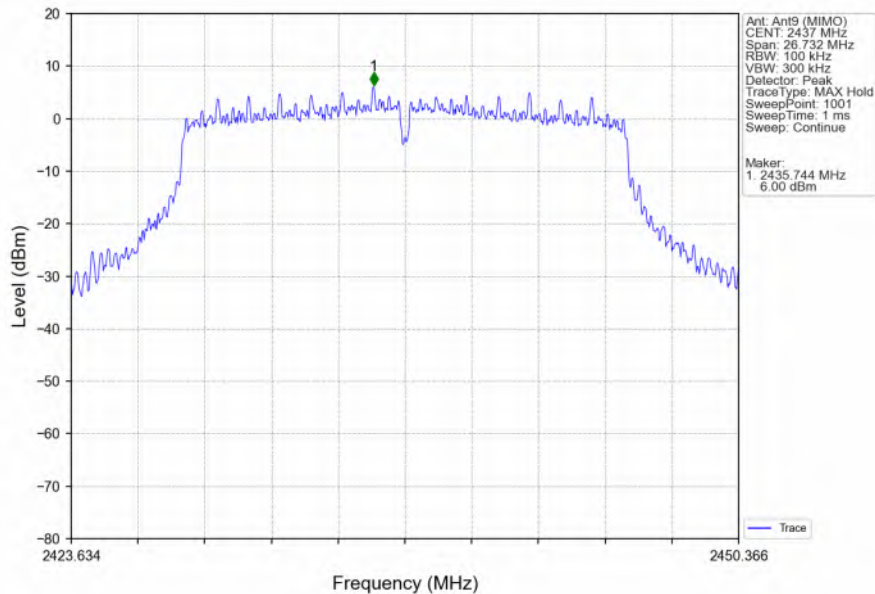


802.11n(HT20)_HCH_2462MHz_Ant8 (MIMO)_NTNV

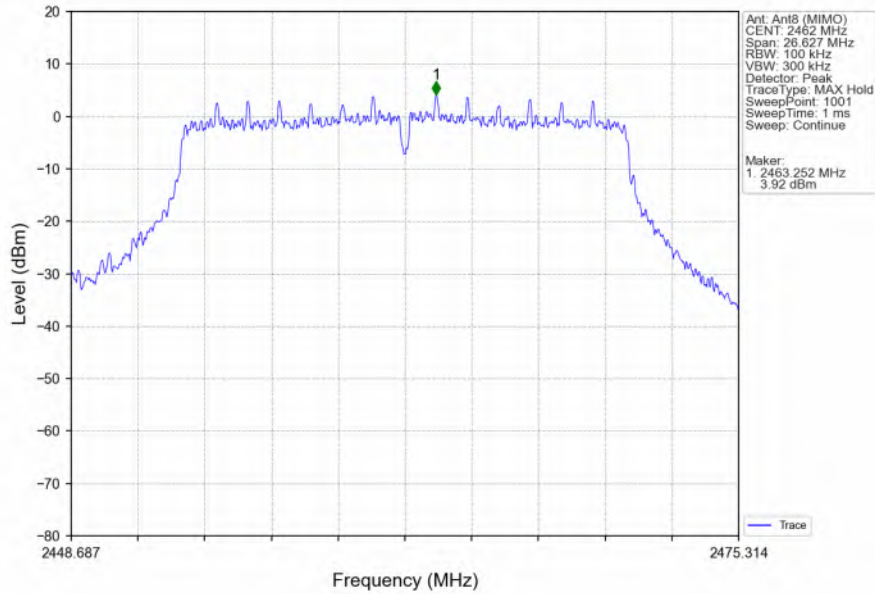


802.11n(HT20)_HCH_2462MHz_Ant9 (MIMO)_NTNV

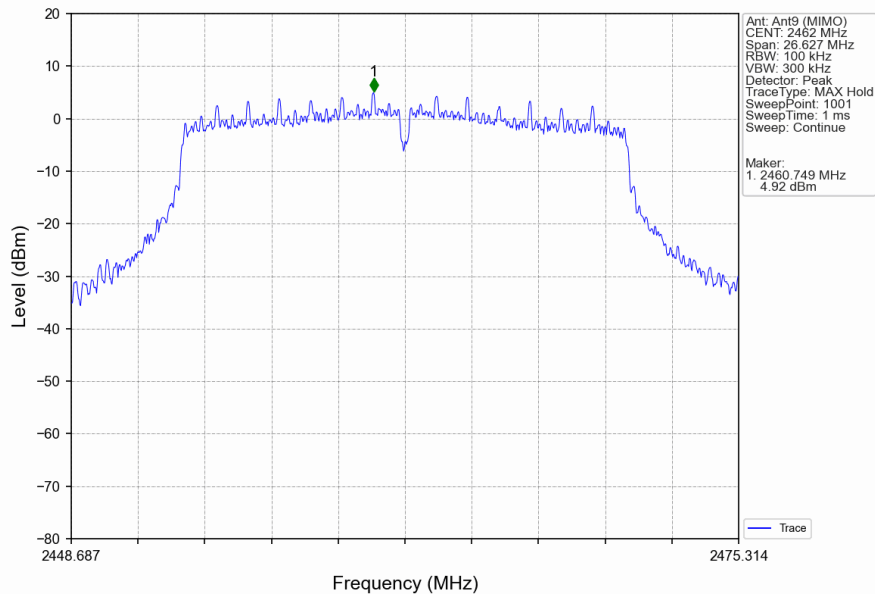


802.11n(HT40)_LCH_2422MHz_Ant8 (MIMO)_NTNV

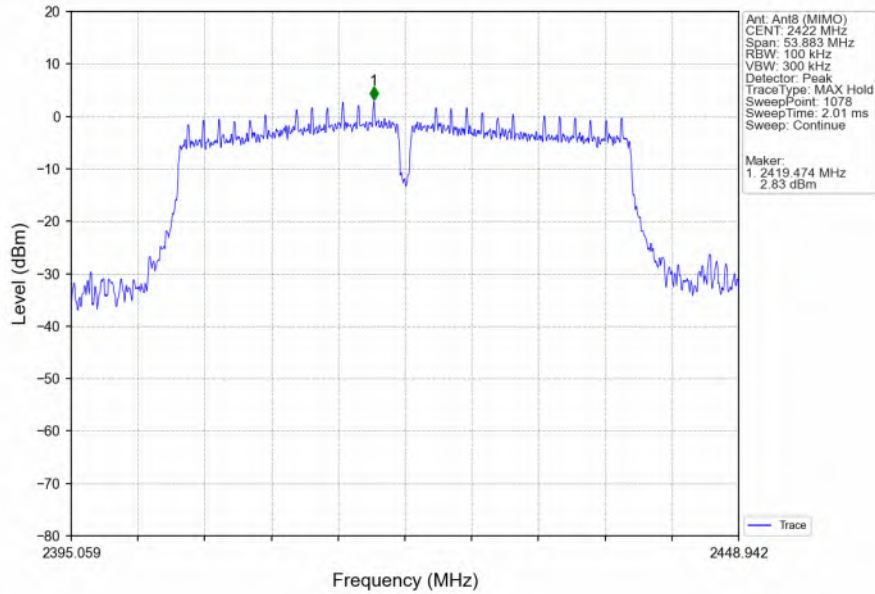


802.11n(HT40)_LCH_2422MHz_Ant9 (MIMO)_NTNV

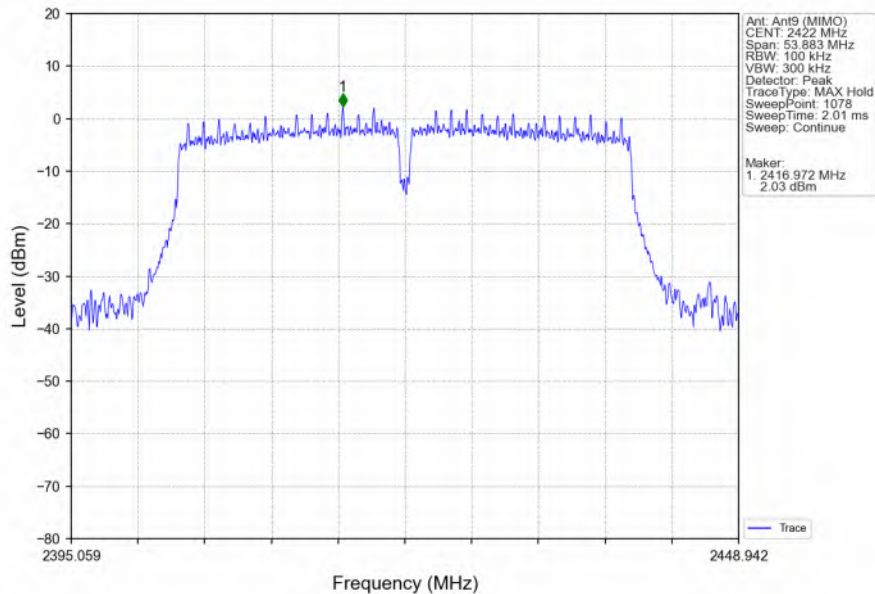


802.11n(HT40)_MCH_2437MHz_Ant8 (MIMO)_NTNV

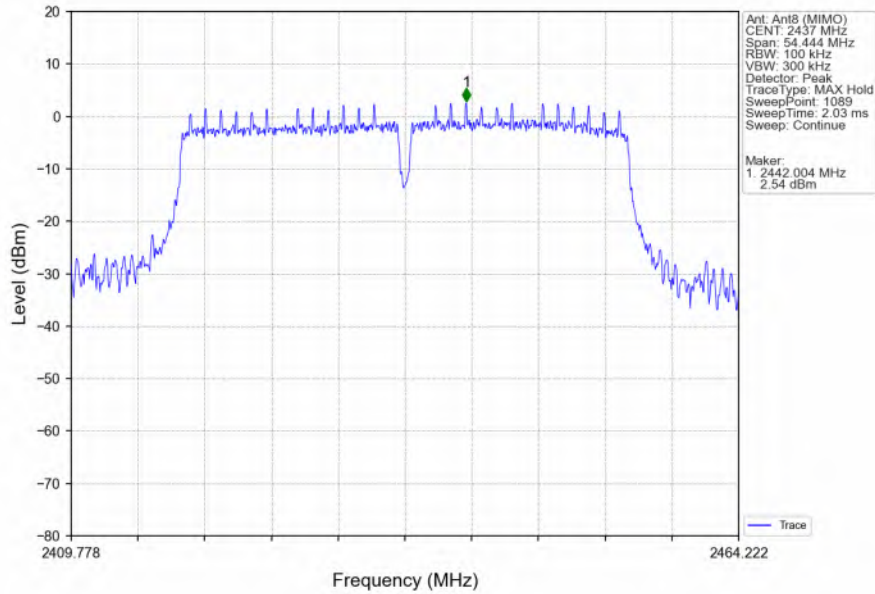


802.11n(HT40)_MCH_2437MHz_Ant9 (MIMO)_NTNV

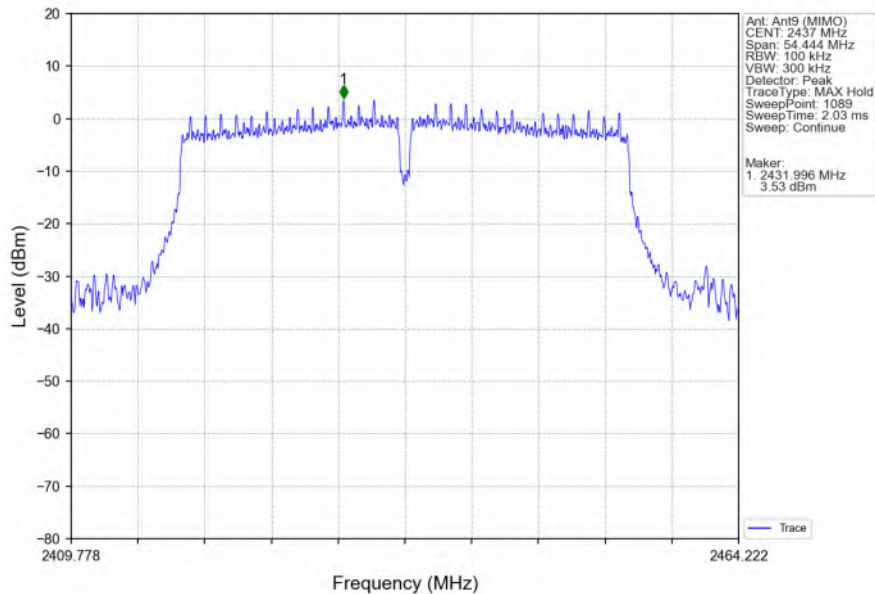

802.11n(HT40)_HCH_2452MHz_Ant8 (MIMO)_NTNV

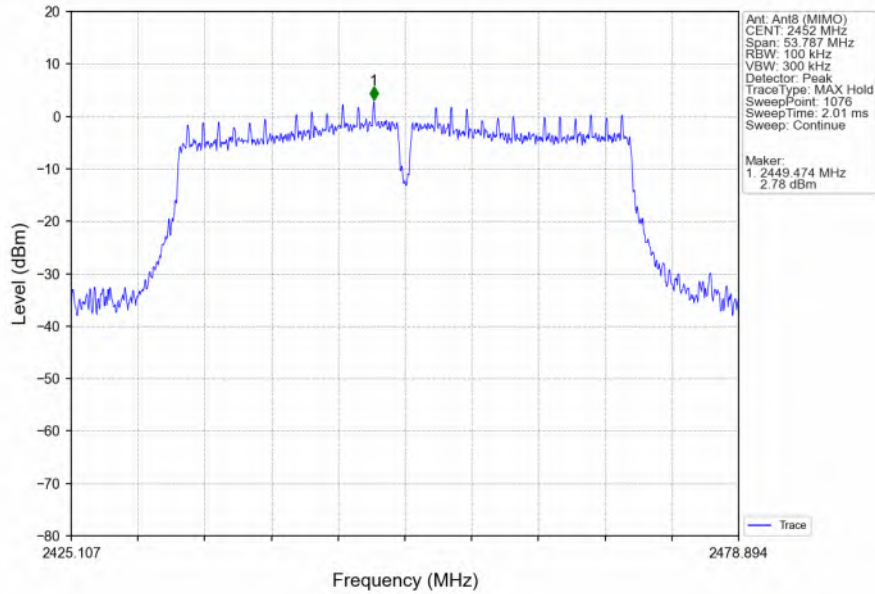


802.11n(HT40)_HCH_2452MHz_Ant9 (MIMO)_NTNV

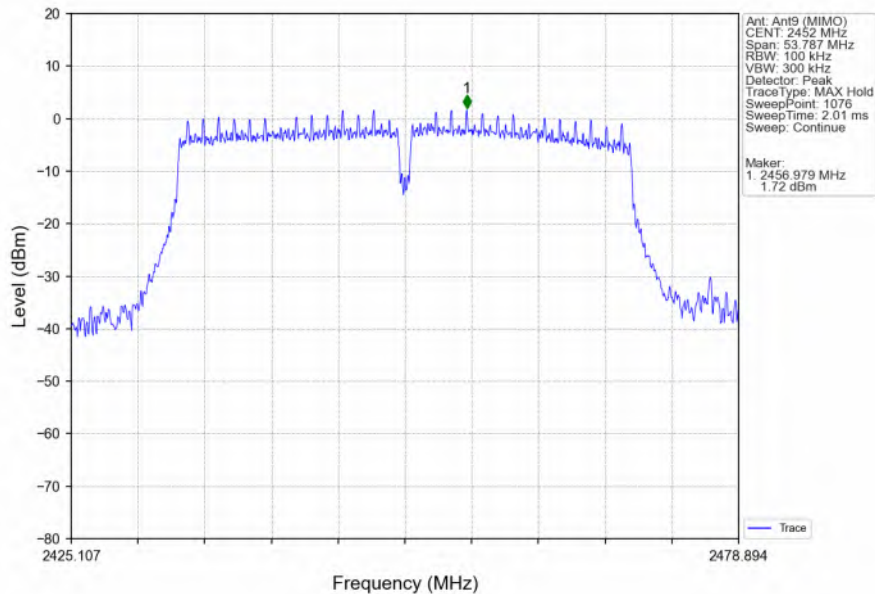


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


802.11ax(HEW20)_LCH_2412MHz_RU26_Left_Ant8 (MIMO)_NTNV

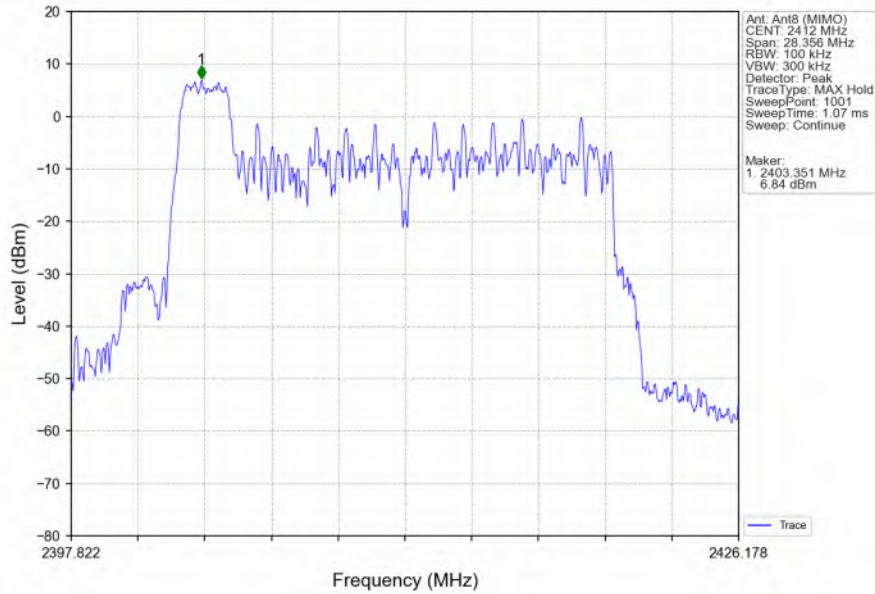


802.11ax(HEW20)_LCH_2412MHz_RU26_Left_Ant9 (MIMO)_NTNV

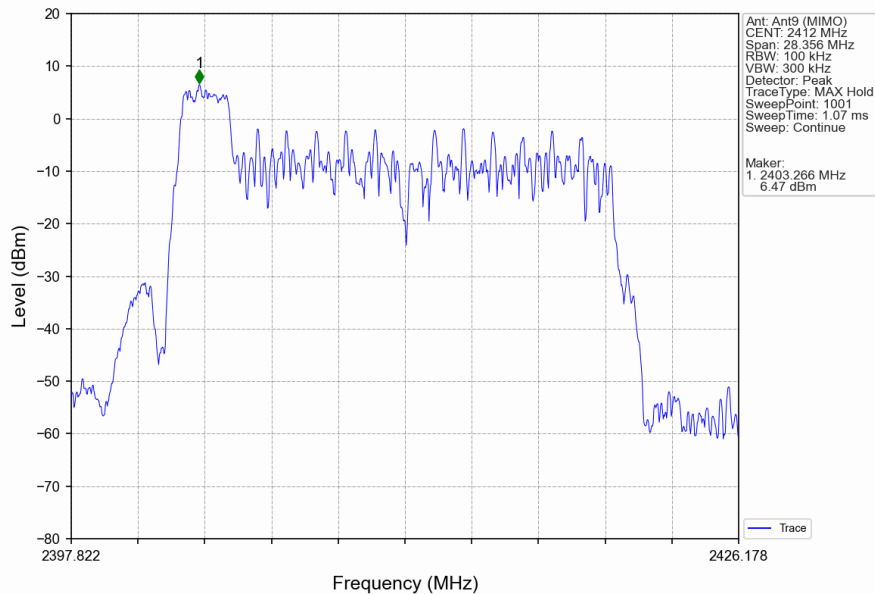


802.11ax(HEW20)_LCH_2412MHz_RU52_Left_Ant8 (MIMO)_NTNV

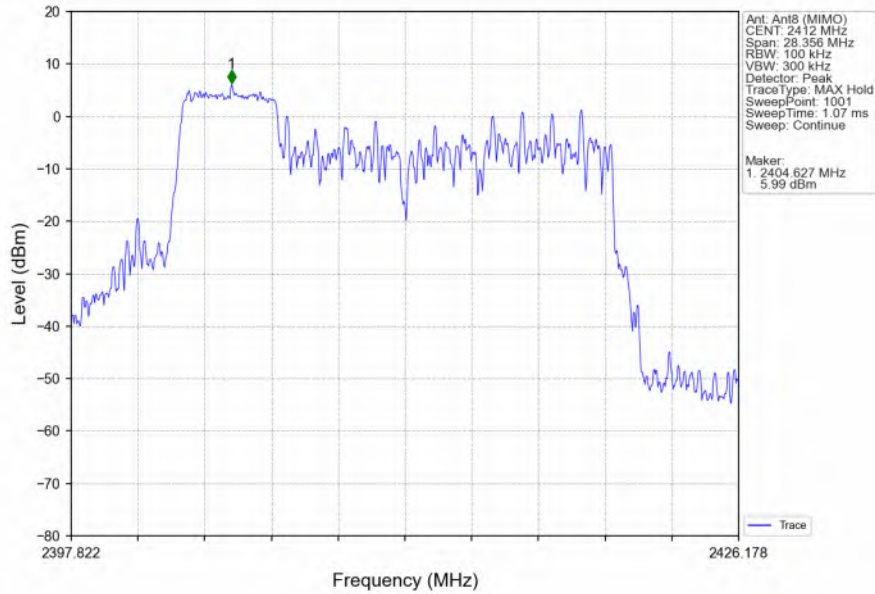


802.11ax(HEW20)_LCH_2412MHz_RU52_Left_Ant9 (MIMO)_NTNV

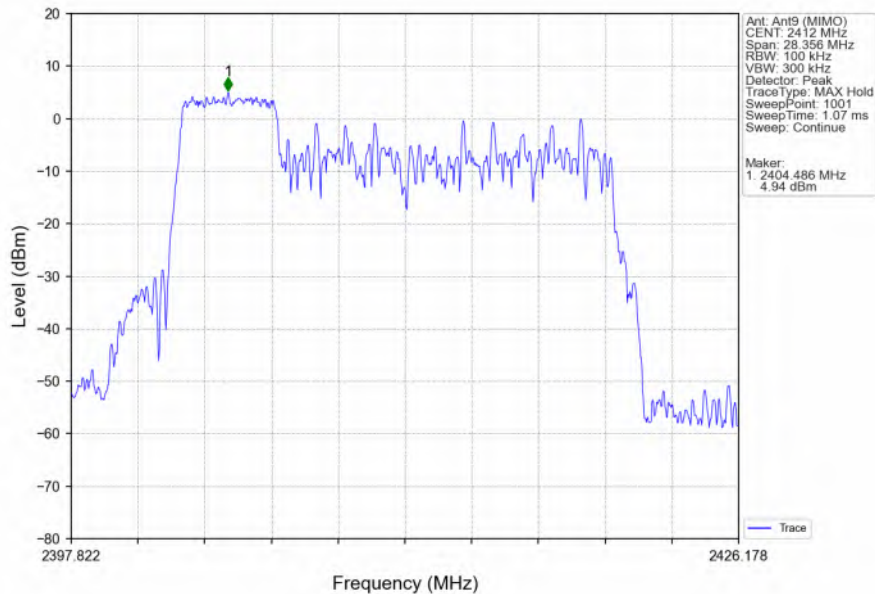


802.11ax(HEW20)_LCH_2412MHz_RU106_Left_Ant8 (MIMO)_NTNV

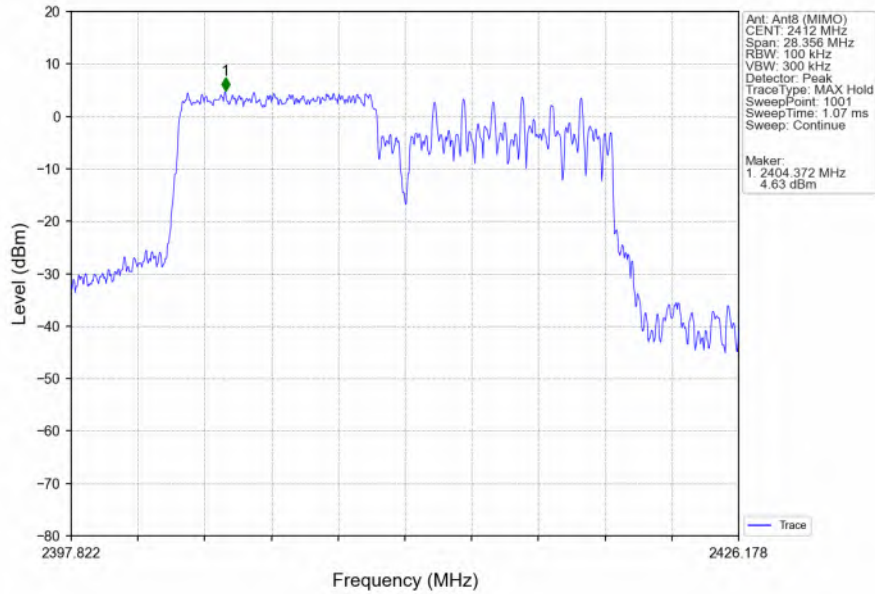


802.11ax(HEW20)_LCH_2412MHz_RU106_Left_Ant9 (MIMO)_NTNV

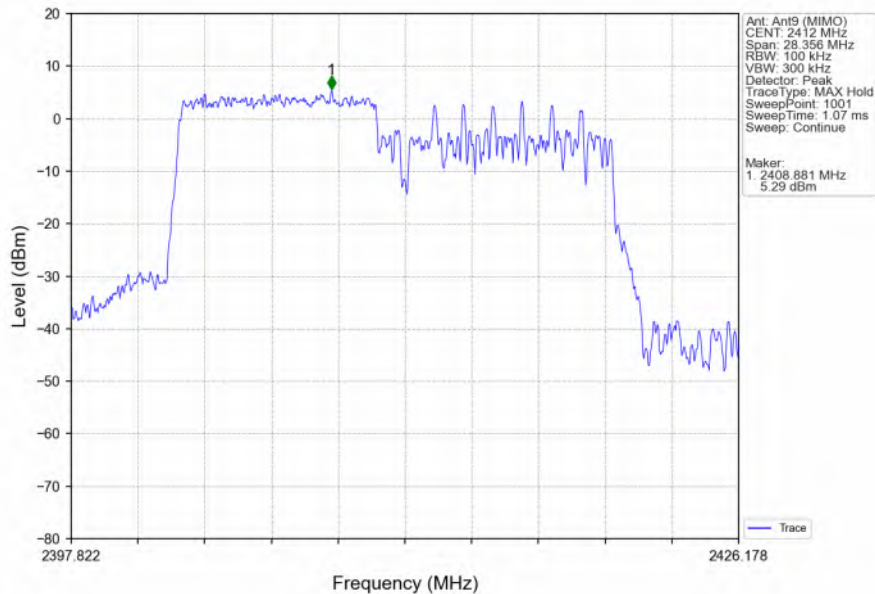


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant8 (MIMO)_NTNV

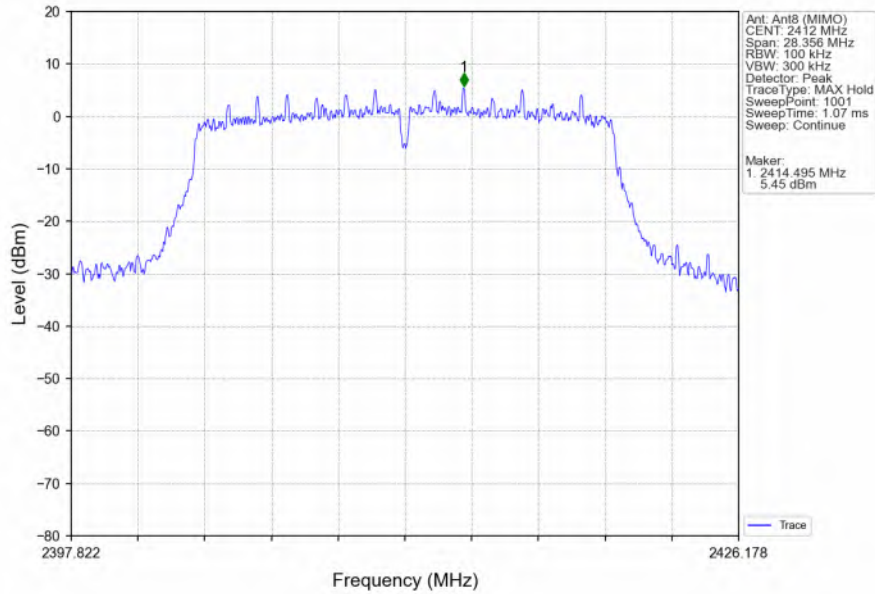


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant9 (MIMO)_NTNV

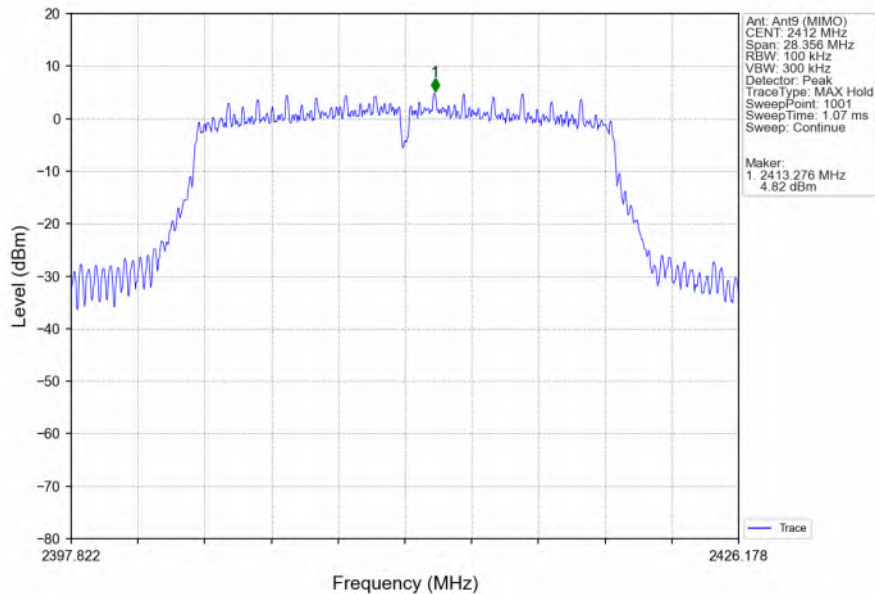


802.11ax(HEW20)_MCH_2437MHz_RU26_Mid_Ant8 (MIMO)_NTNV

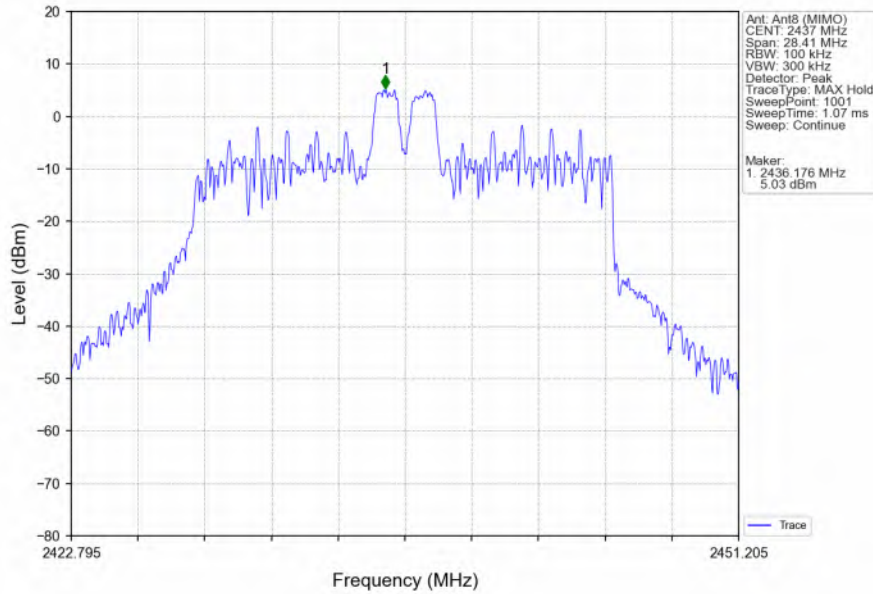


802.11ax(HEW20)_MCH_2437MHz_RU26_Mid_Ant9 (MIMO)_NTNV

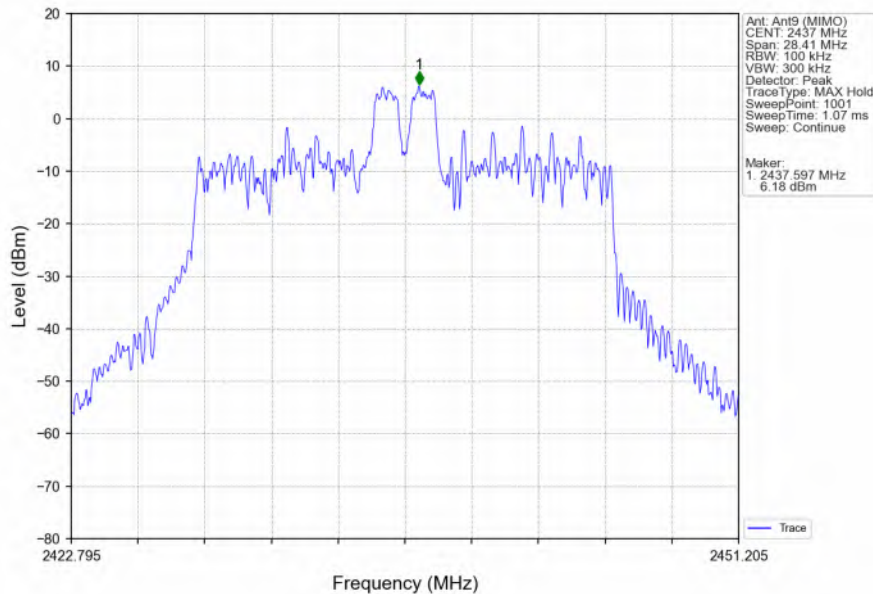


802.11ax(HEW20)_MCH_2437MHz_RU52_Mid_Ant8 (MIMO)_NTNV

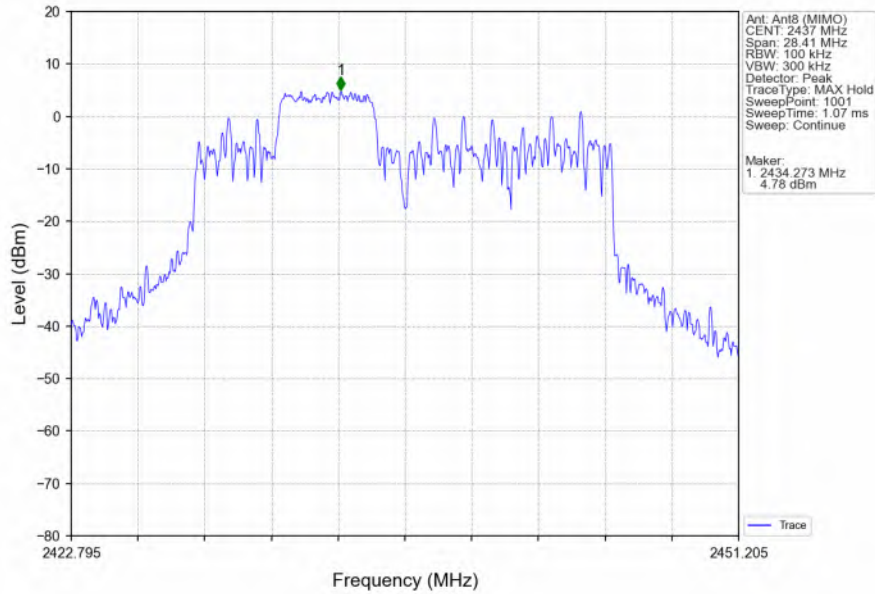


802.11ax(HEW20)_MCH_2437MHz_RU52_Mid_Ant9 (MIMO)_NTNV

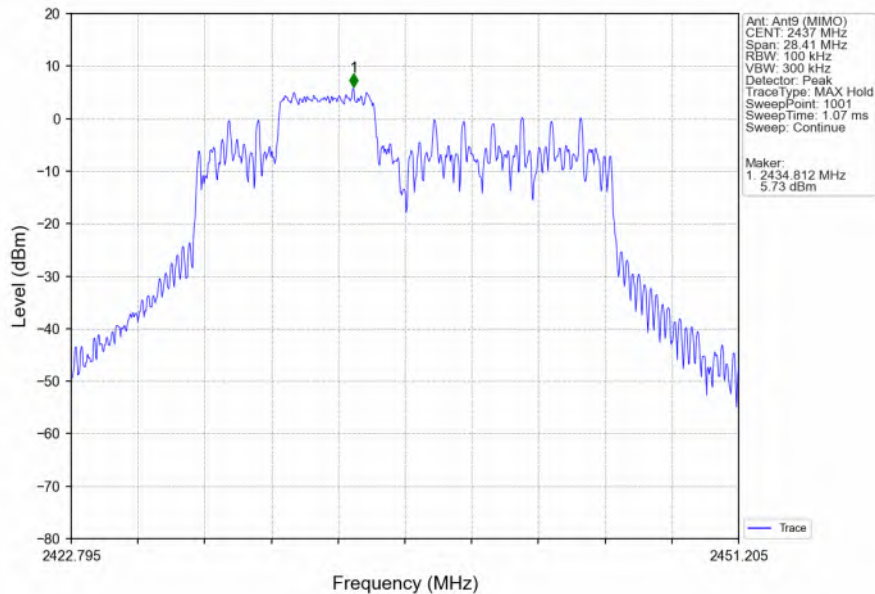


802.11ax(HEW20)_MCH_2437MHz_RU106_Left_Ant8 (MIMO)_NTNV

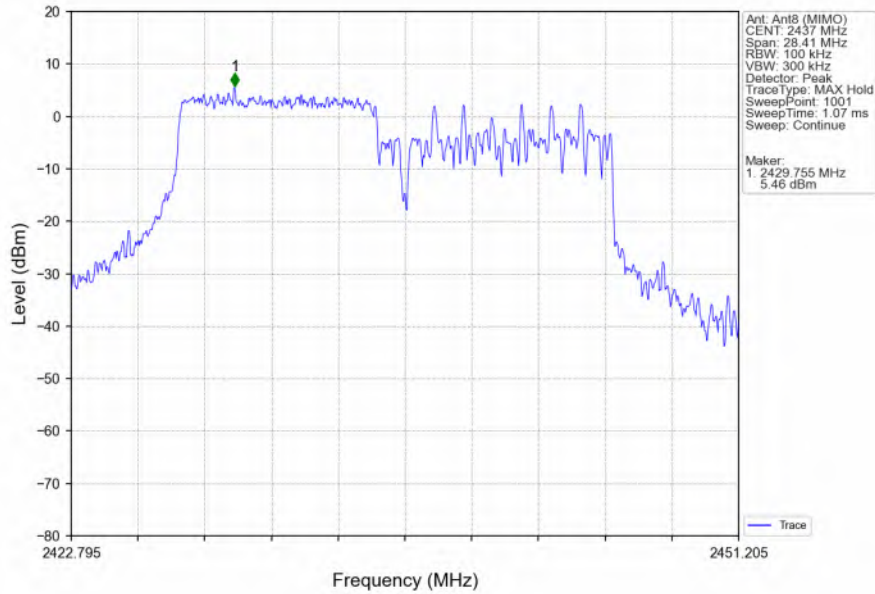


802.11ax(HEW20)_MCH_2437MHz_RU106_Left_Ant9 (MIMO)_NTNV

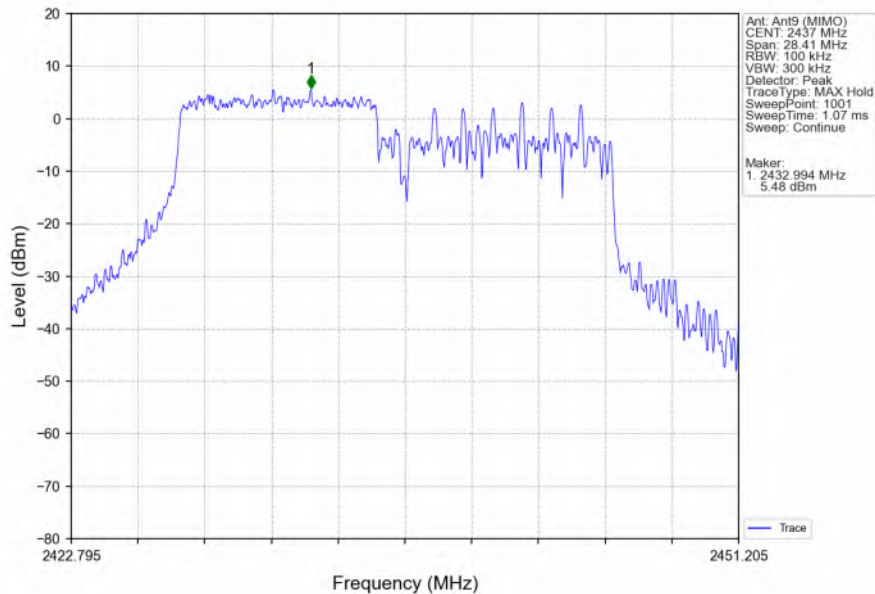


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant8 (MIMO)_NTNV

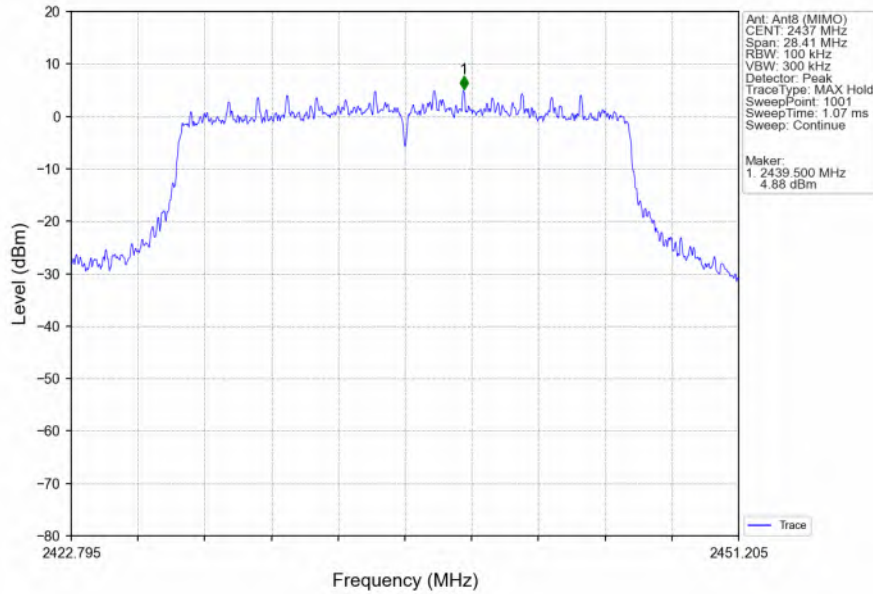


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant9 (MIMO)_NTNV

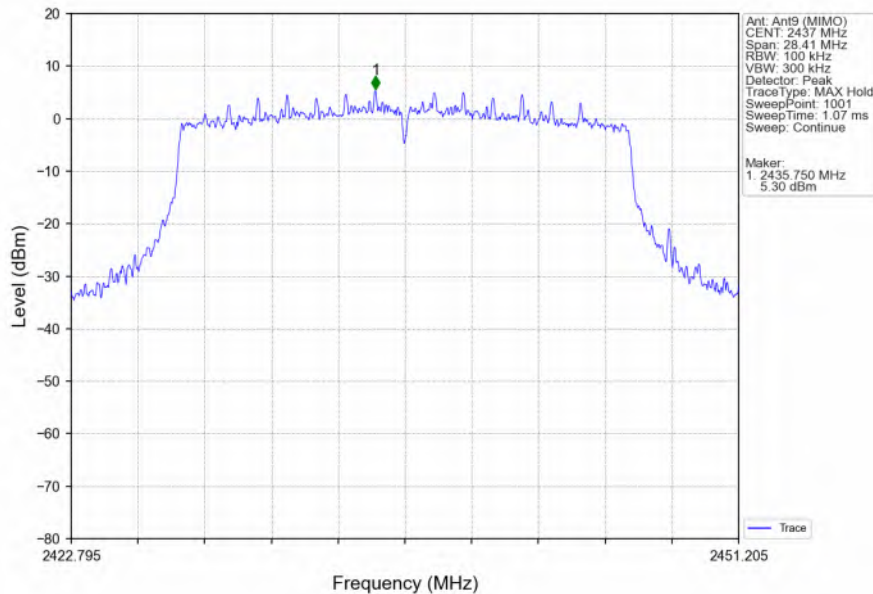


802.11ax(HEW20)_HCH_2462MHz_RU26_Right_Ant8 (MIMO)_NTNV

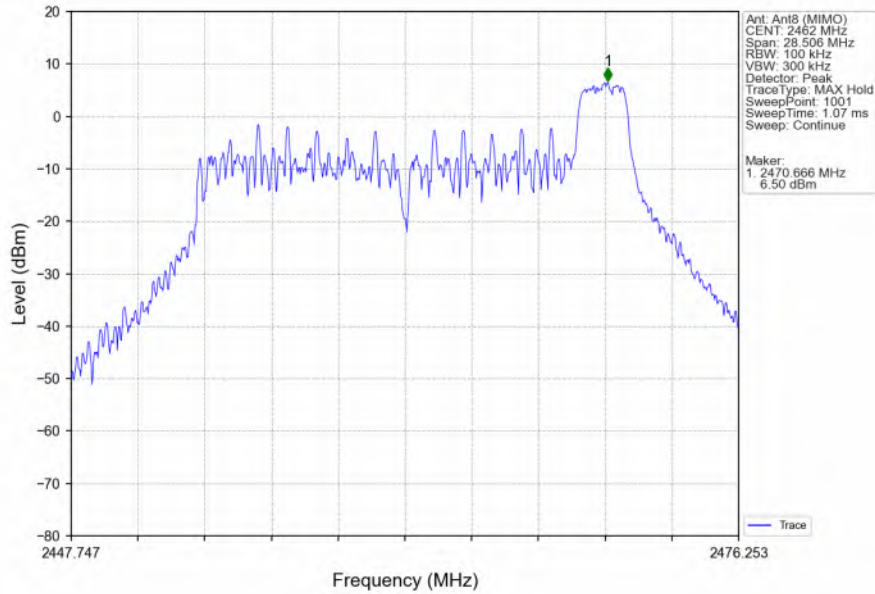


802.11ax(HEW20)_HCH_2462MHz_RU26_Right_Ant9 (MIMO)_NTNV

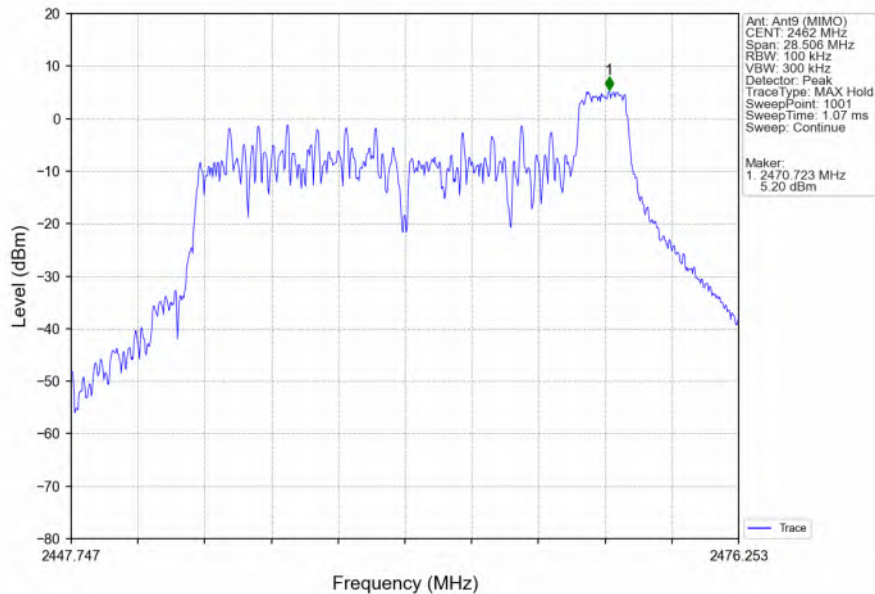


802.11ax(HEW20)_HCH_2462MHz_RU52_Right_Ant8 (MIMO)_NTNV

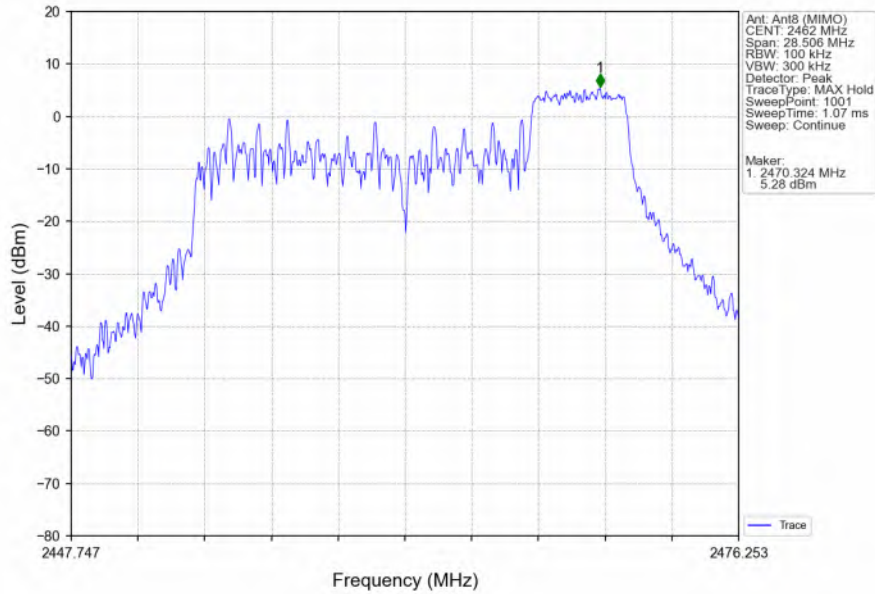


802.11ax(HEW20)_HCH_2462MHz_RU52_Right_Ant9 (MIMO)_NTNV

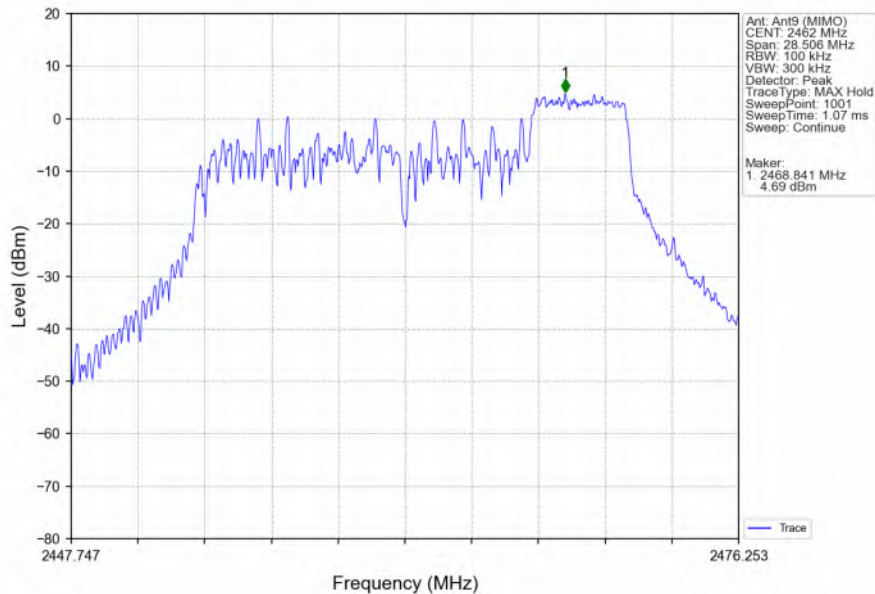


802.11ax(HEW20)_HCH_2462MHz_RU106_Right_Ant8 (MIMO)_NTNV

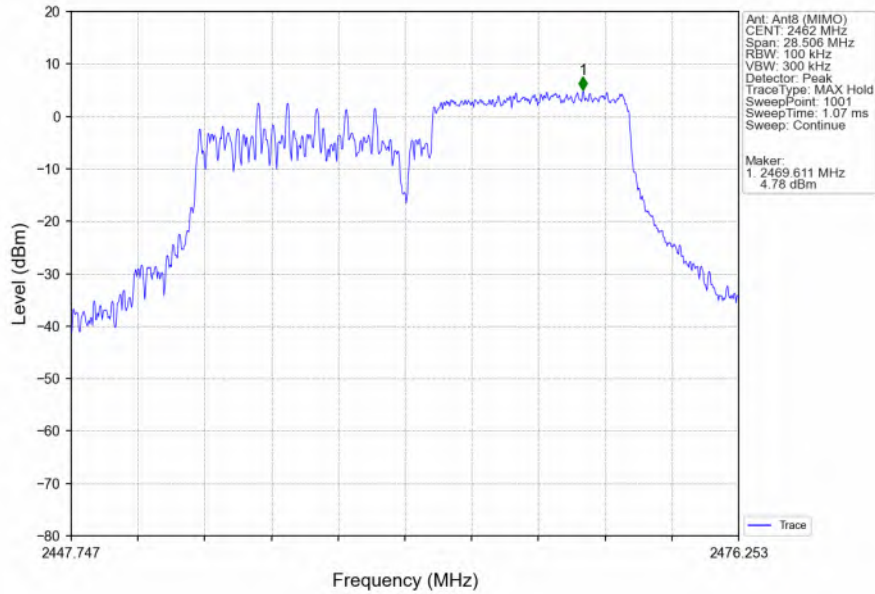


802.11ax(HEW20)_HCH_2462MHz_RU106_Right_Ant9 (MIMO)_NTNV

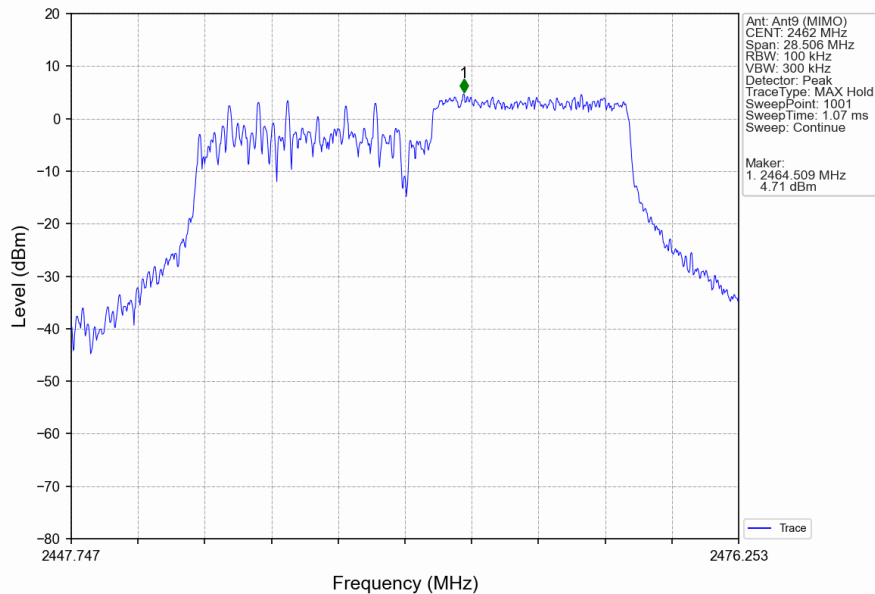


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant8 (MIMO)_NTNV

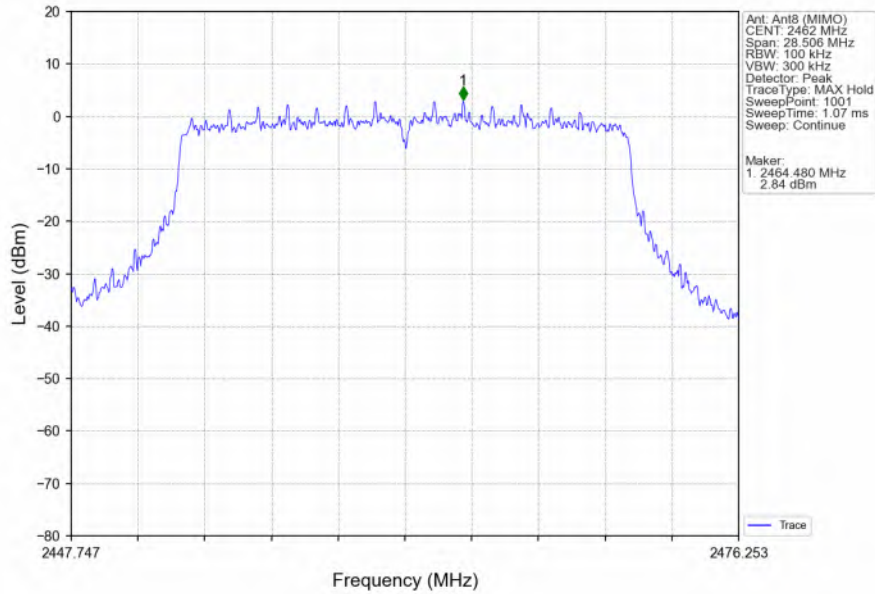


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant9 (MIMO)_NTNV

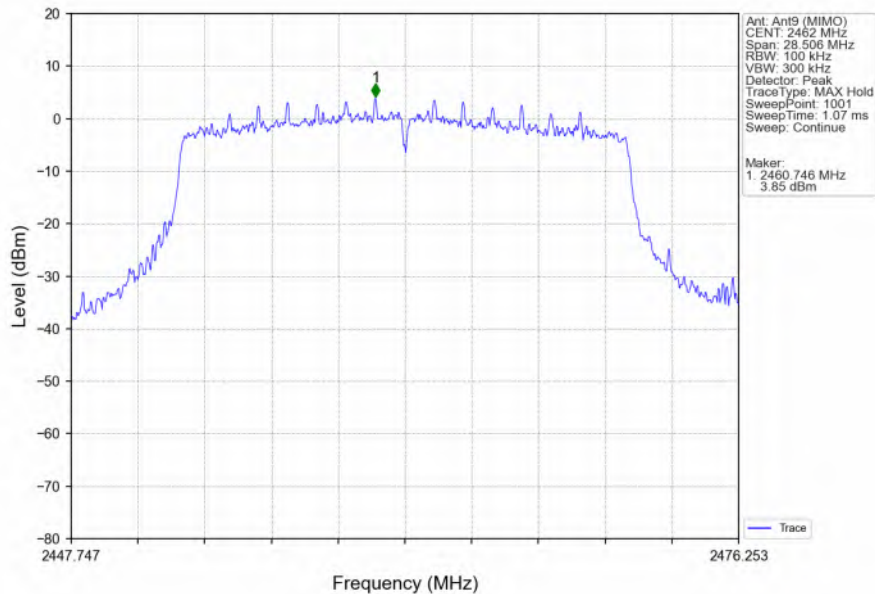


802.11ax(HEW40)_LCH_2422MHz_RU242_Left_Ant8 (MIMO)_NTNV

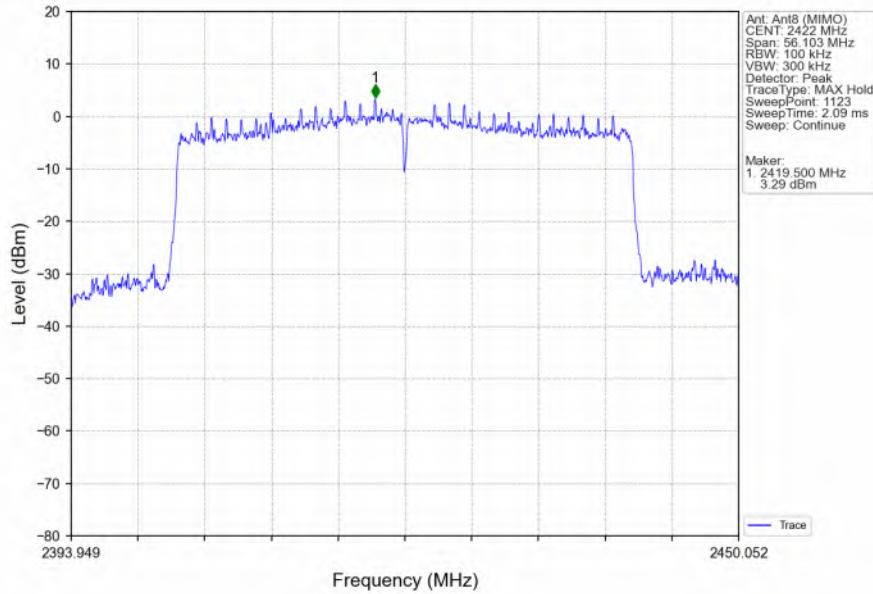


802.11ax(HEW40)_LCH_2422MHz_RU242_Left_Ant9 (MIMO)_NTNV

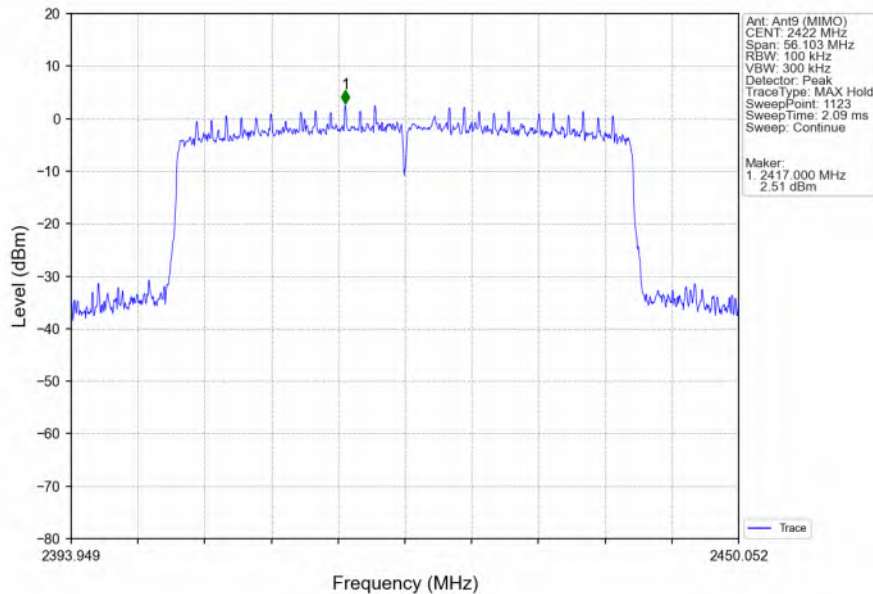


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant8 (MIMO)_NTNV

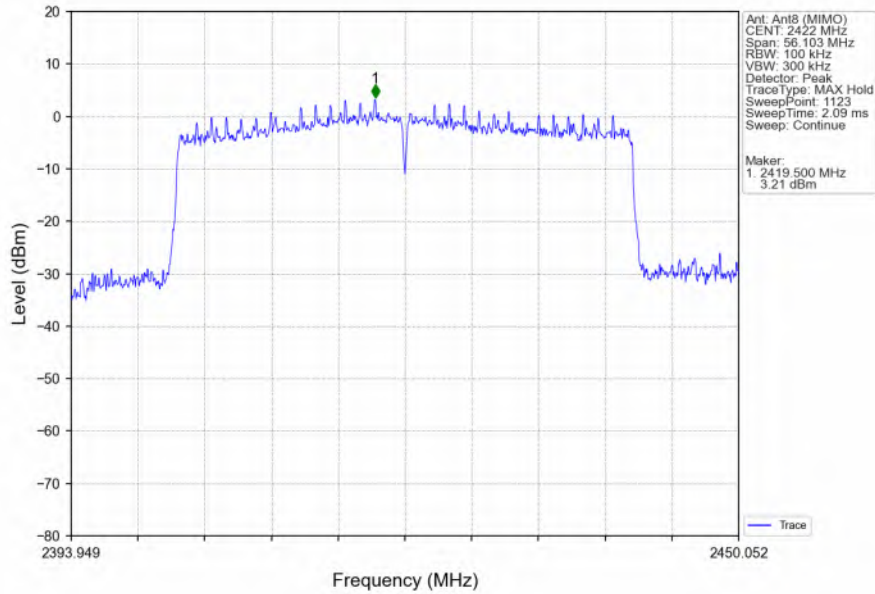


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant9 (MIMO)_NTNV

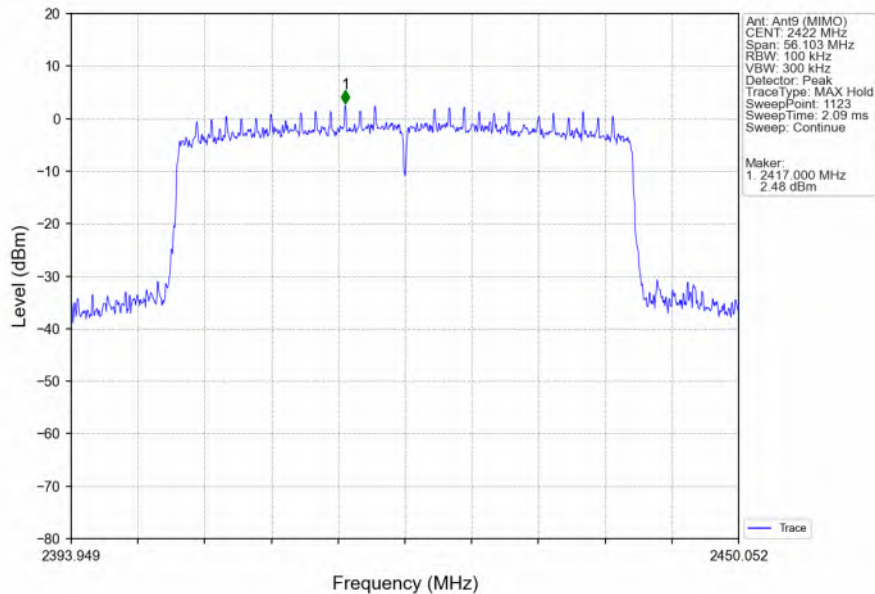


802.11ax(HEW40)_MCH_2437MHz_RU242_Left_Ant8 (MIMO)_NTNV

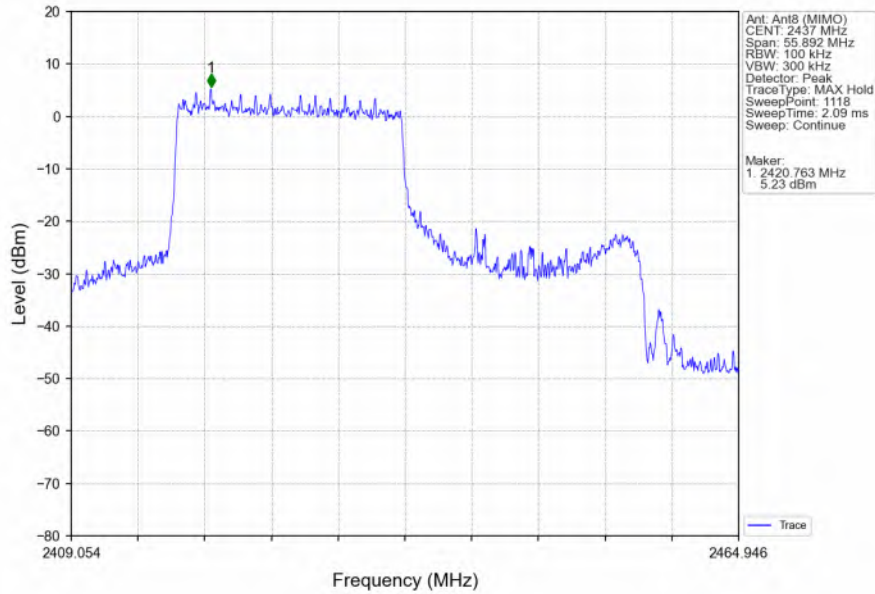


802.11ax(HEW40)_MCH_2437MHz_RU242_Left_Ant9 (MIMO)_NTNV

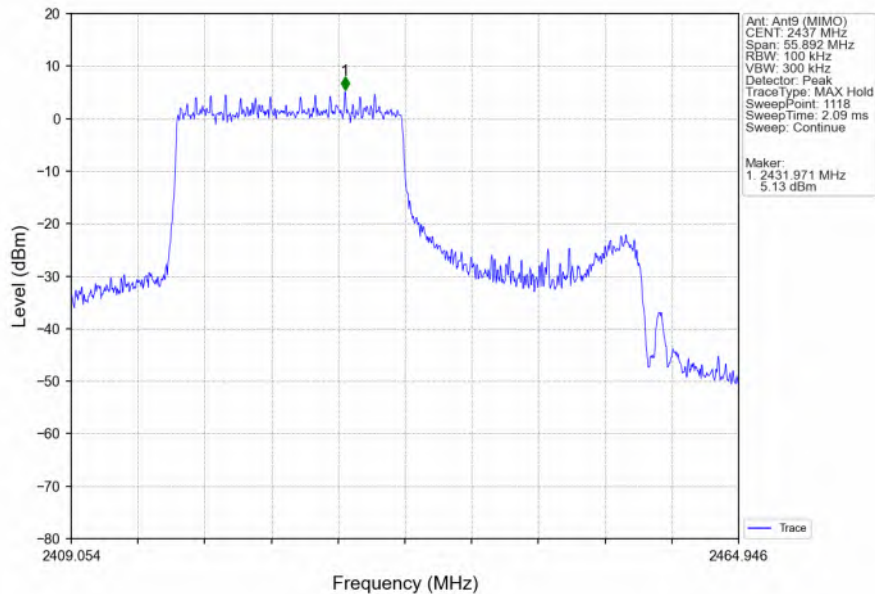

802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant8 (MIMO)_NTNV

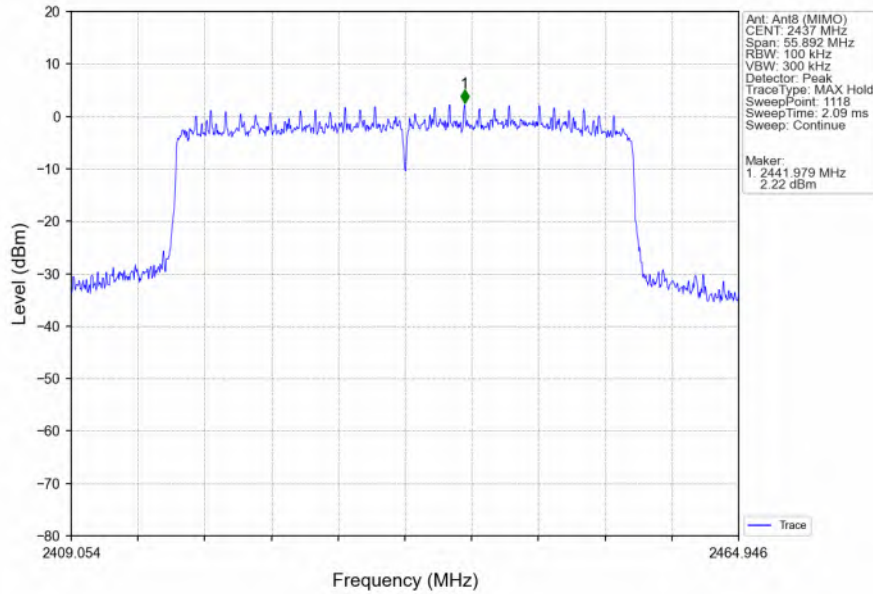


802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant9 (MIMO)_NTNV

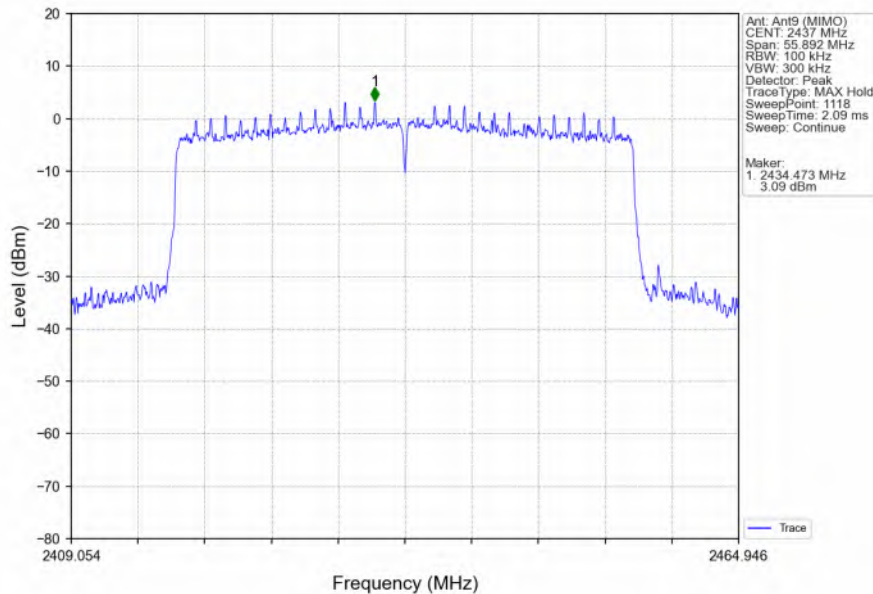


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


802.11ax(HEW40)_HCH_2452MHz_RU242_Right_Ant8 (MIMO)_NTNV

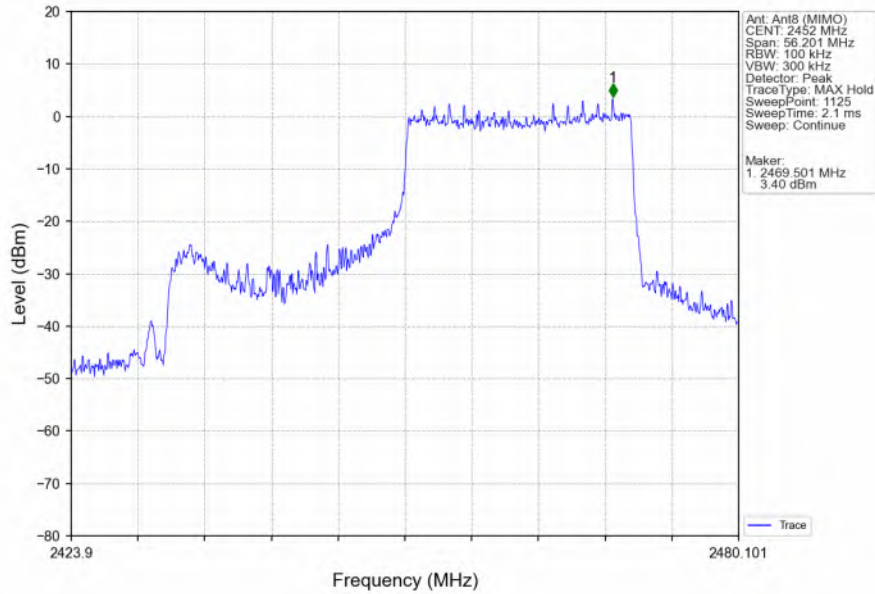


802.11ax(HEW40)_HCH_2452MHz_RU242_Right_Ant9 (MIMO)_NTNV

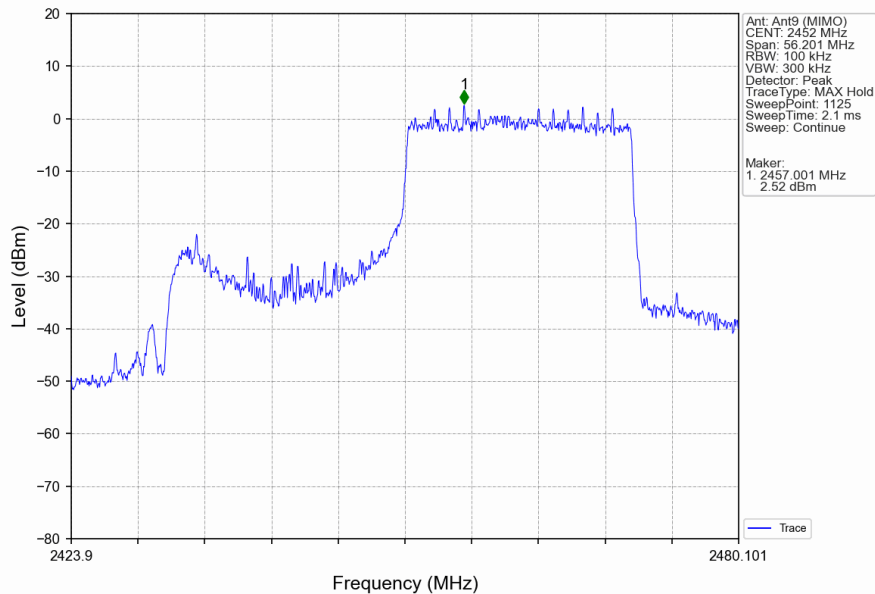

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant8 (MIMO)_NTNV

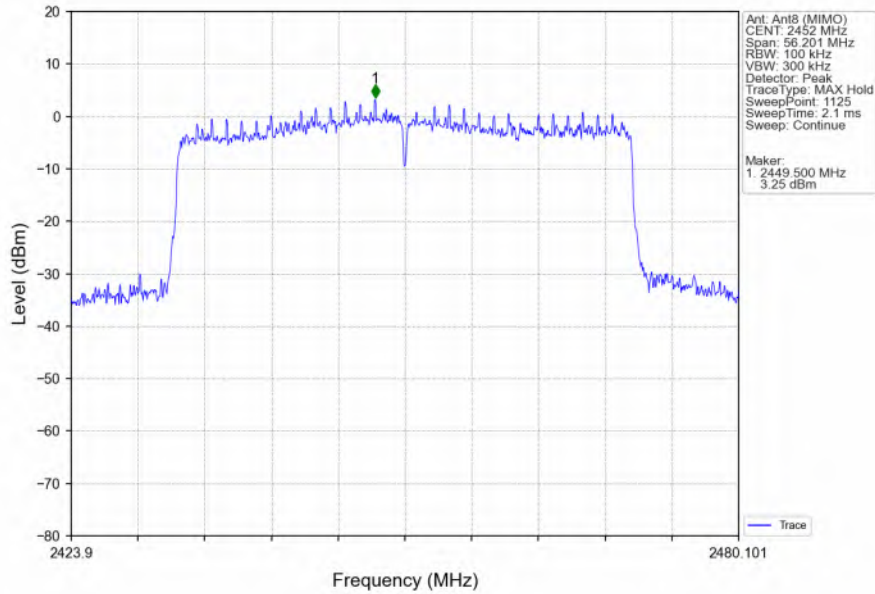

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant9 (MIMO)_NTNV

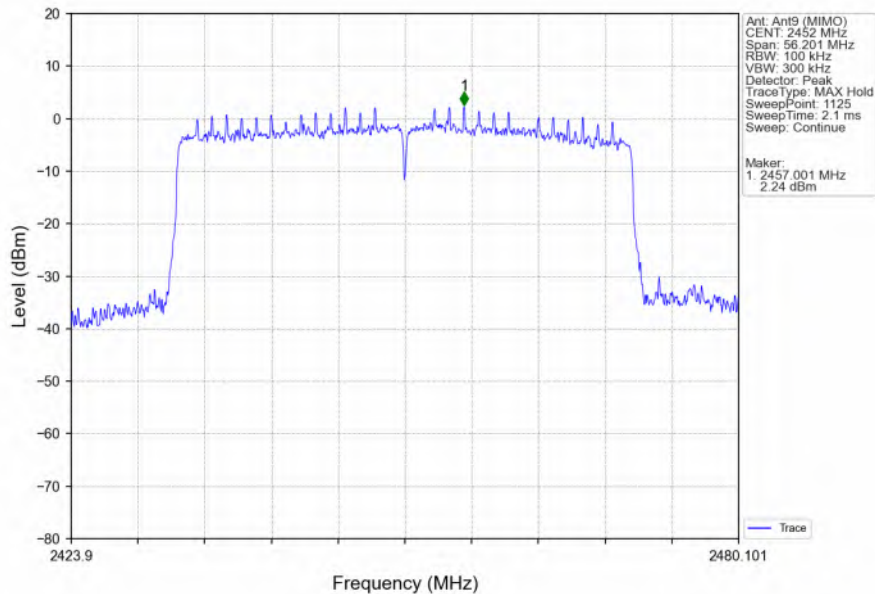


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

5.2.2 CSE


802.11b_LCH_2412MHz_Ant8 (SISO)_NTNV

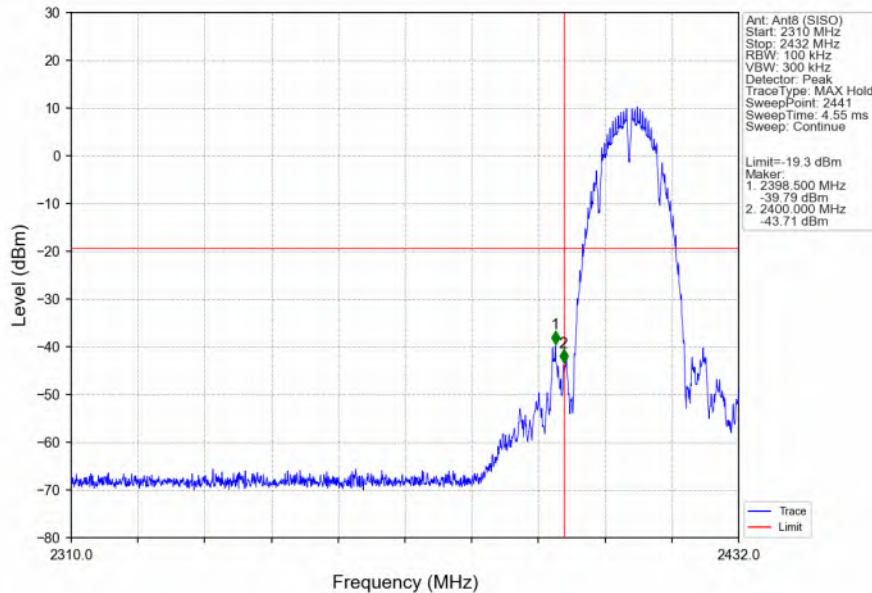


802.11b_LCH_2412MHz_Ant8 (SISO)_NTNV

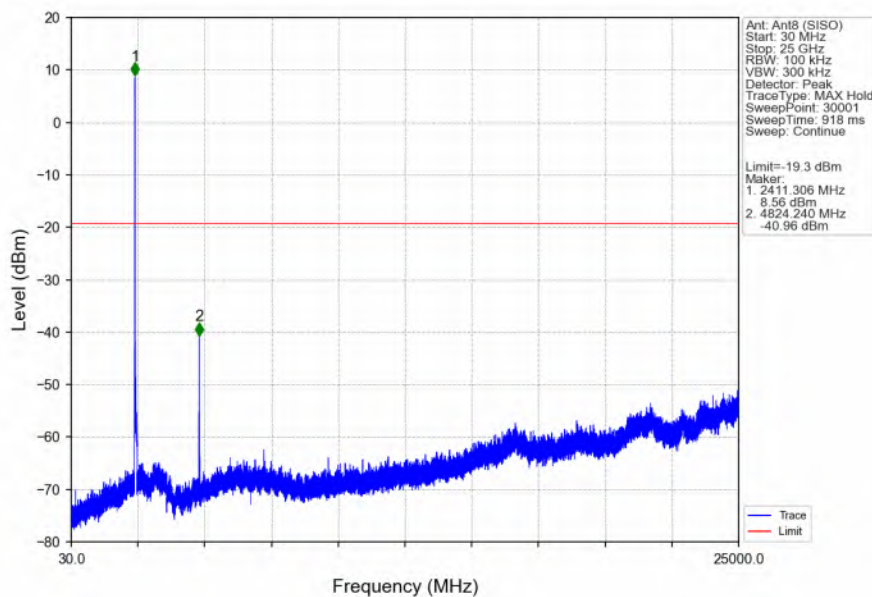


802.11b_LCH_2412MHz_Ant9 (SISO)_NTNV

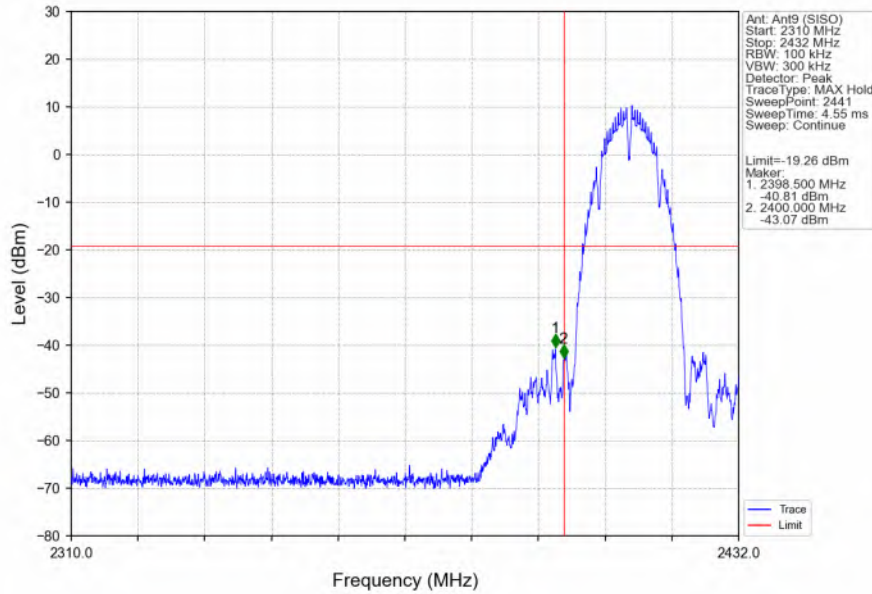


802.11b_LCH_2412MHz_Ant9 (SISO)_NTNV

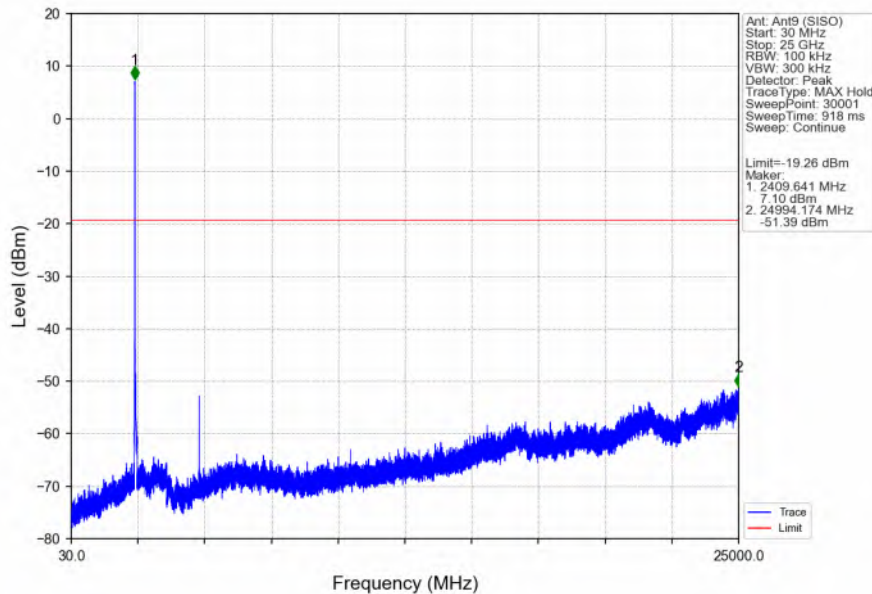


802.11b_MCH_2437MHz_Ant8 (SISO)_NTNV

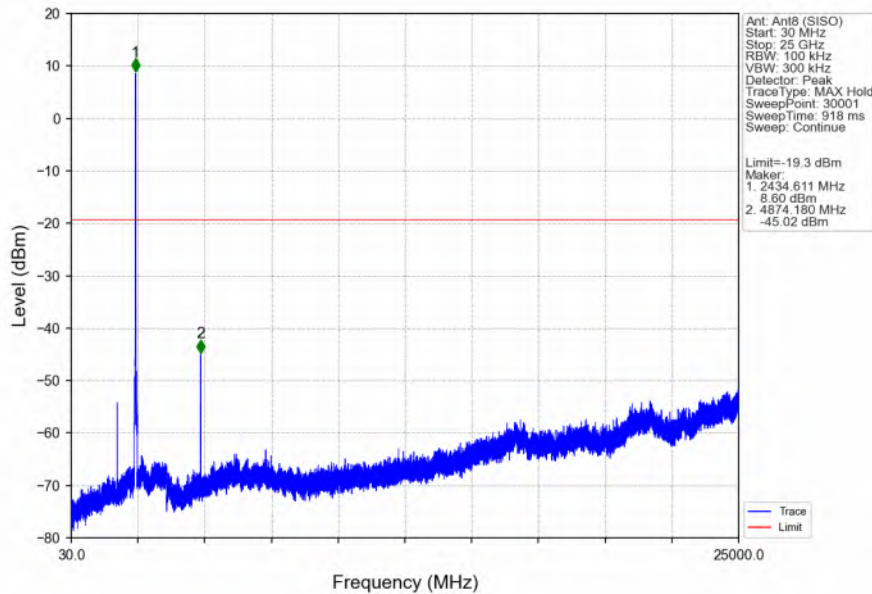


802.11b_MCH_2437MHz_Ant9 (SISO)_NTNV

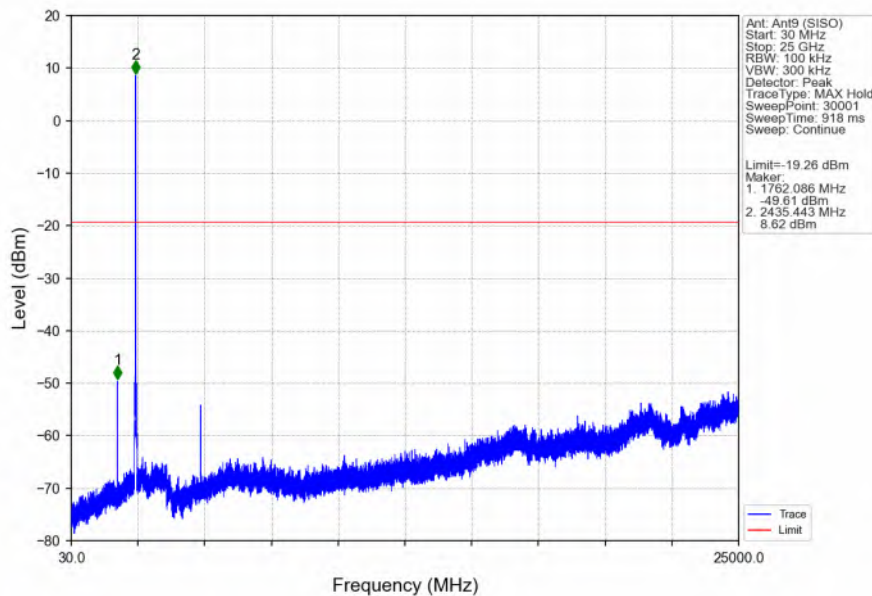

802.11b_HCH_2462MHz_Ant8 (SISO)_NTNV

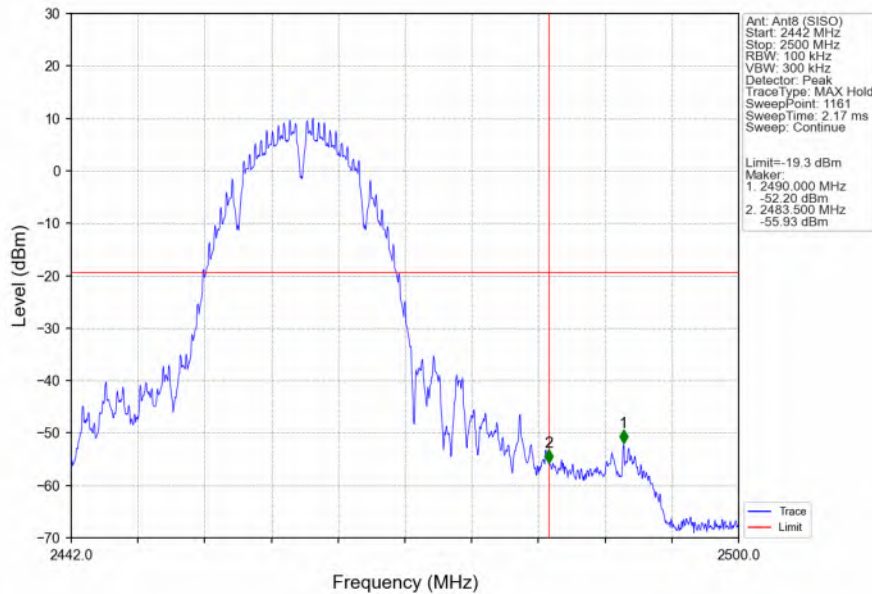

802.11b_HCH_2462MHz_Ant8 (SISO)_NTNV

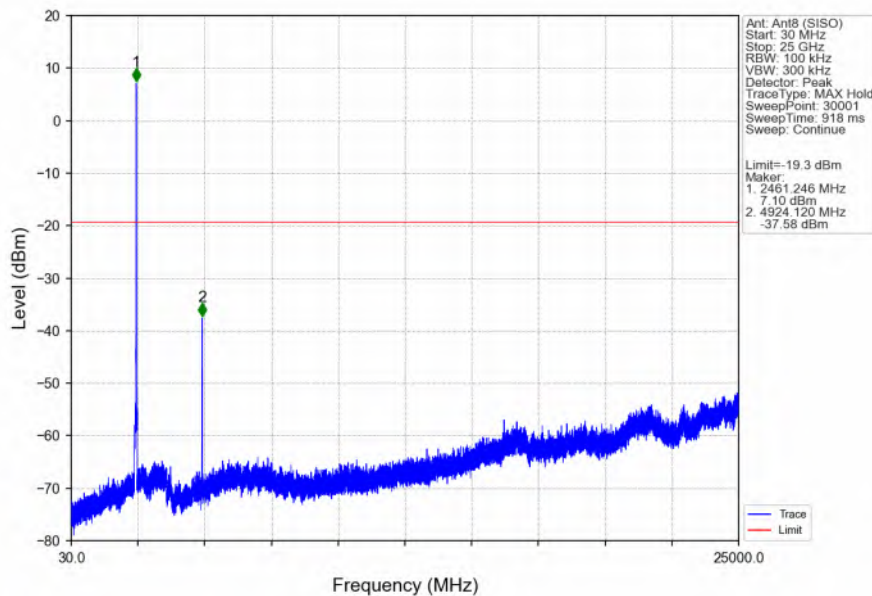


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch Testing & Calibration Laboratory

No.1 Workshop, M-10, Middle Section, Science & Technology Park, Nanshan District, Shenzhen, Guangdong, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn
中国·广东·深圳市南山区科技园中区M-10栋1号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com


802.11b_HCH_2462MHz_Ant9 (SISO)_NTNV

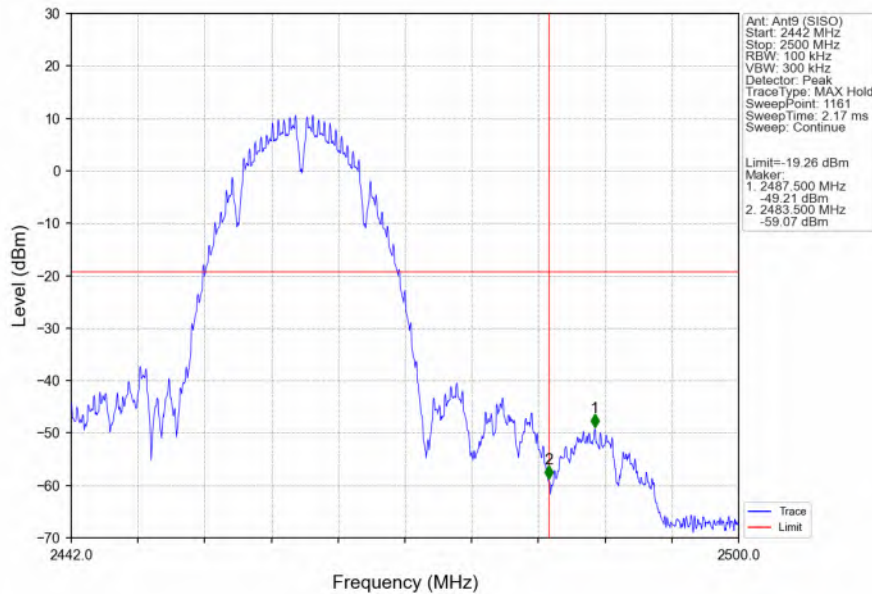


802.11b_HCH_2462MHz_Ant9 (SISO)_NTNV

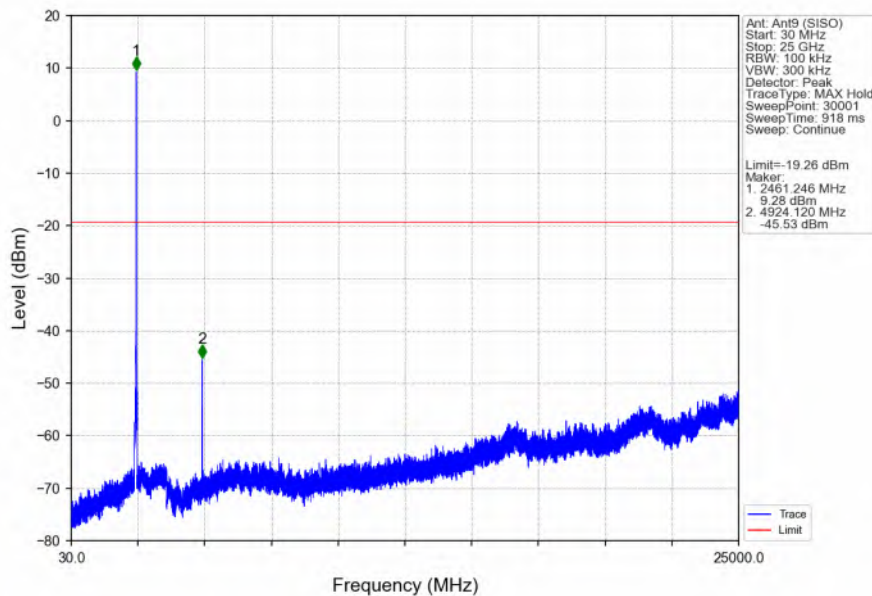


802.11g_LCH_2412MHz_Ant8 (SISO)_NTNV

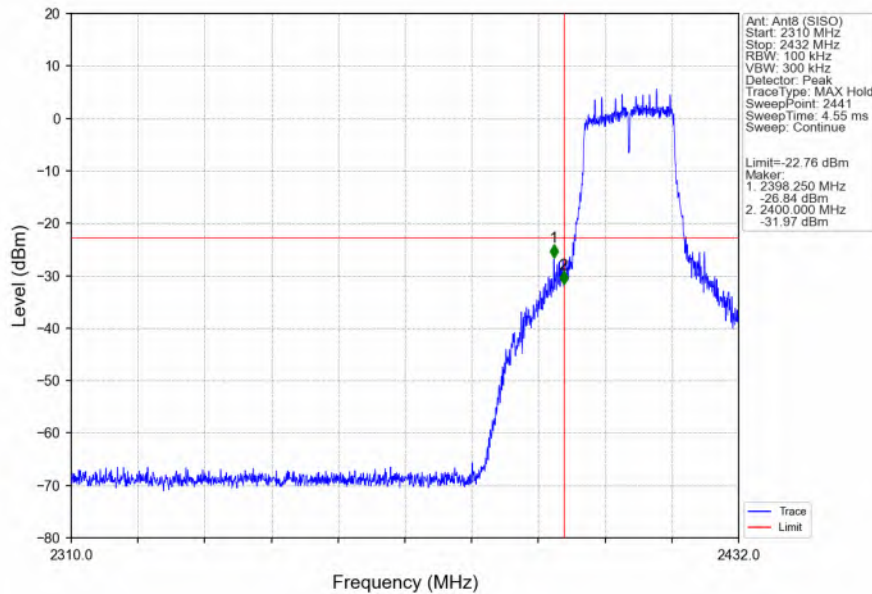


802.11g_LCH_2412MHz_Ant8 (SISO)_NTNV

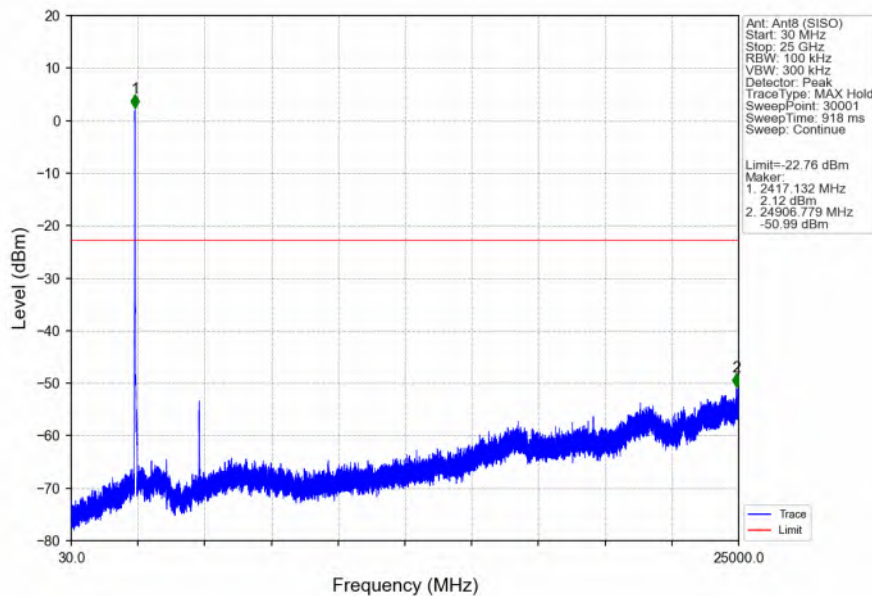


802.11g_LCH_2412MHz_Ant9 (SISO)_NTNV

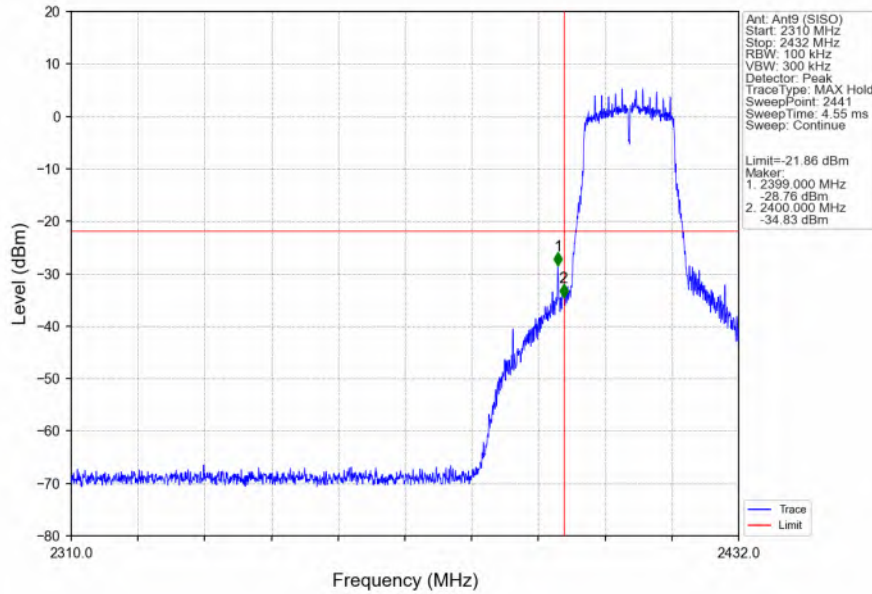


802.11g_LCH_2412MHz_Ant9 (SISO)_NTNV

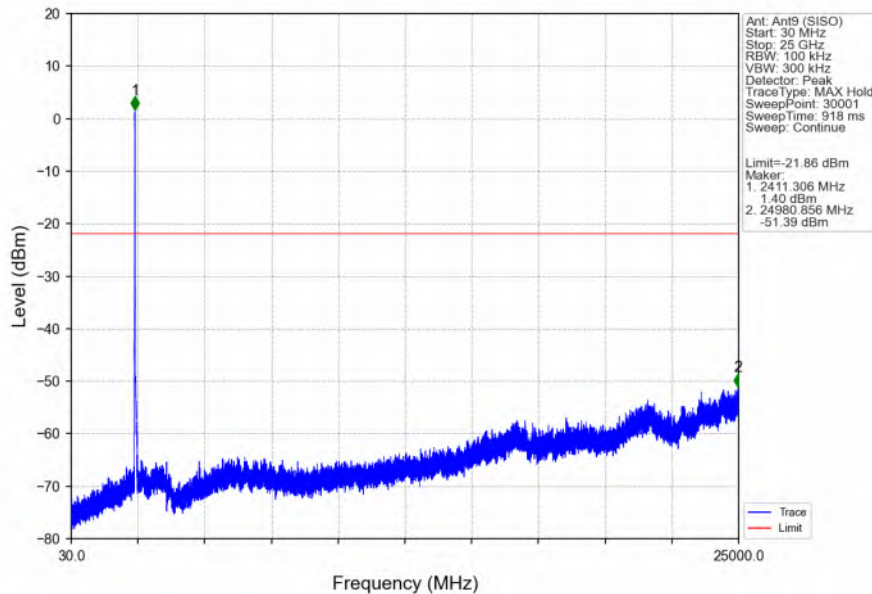


802.11g_MCH_2437MHz_Ant8 (SISO)_NTNV

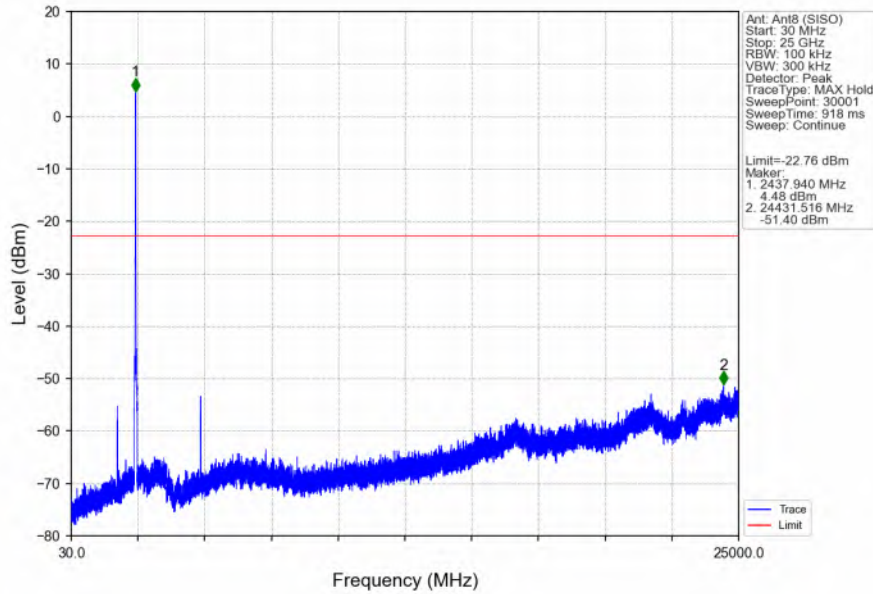


802.11g_MCH_2437MHz_Ant9 (SISO)_NTNV

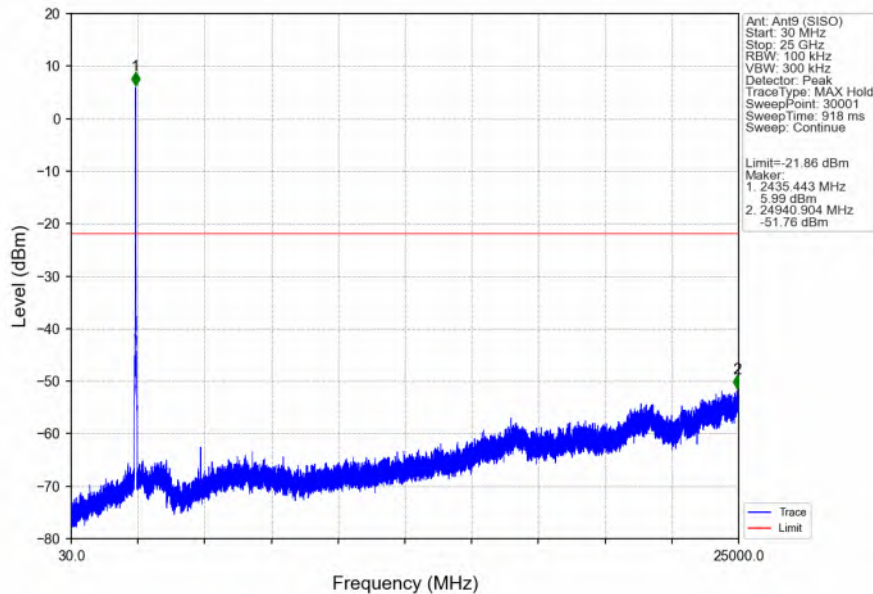


802.11g_HCH_2462MHz_Ant8 (SISO)_NTNV

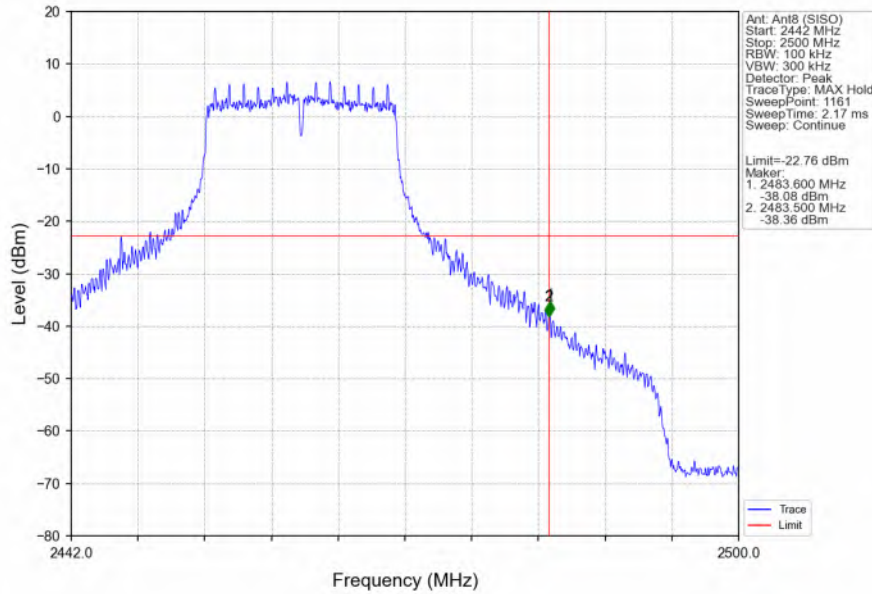


802.11g_HCH_2462MHz_Ant8 (SISO)_NTNV

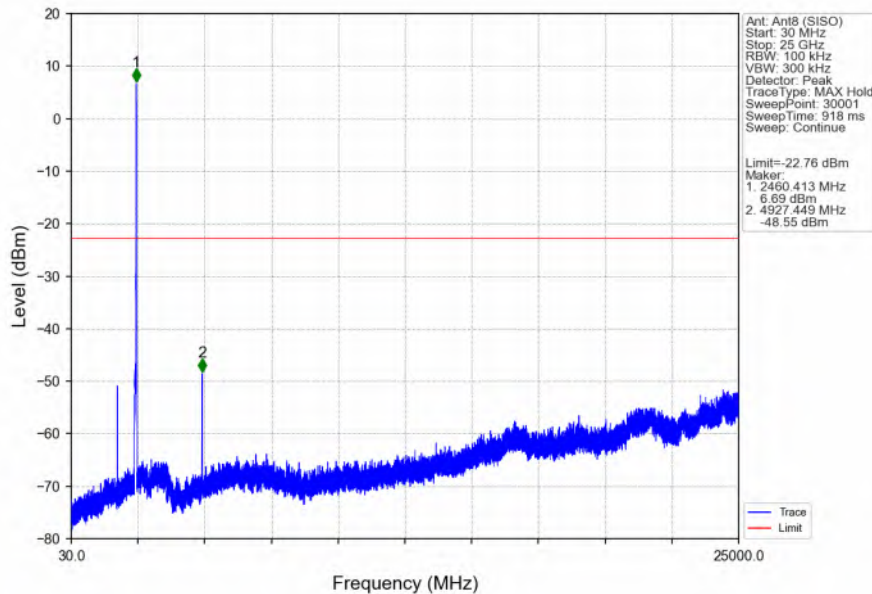


802.11g_HCH_2462MHz_Ant9 (SISO)_NTNV

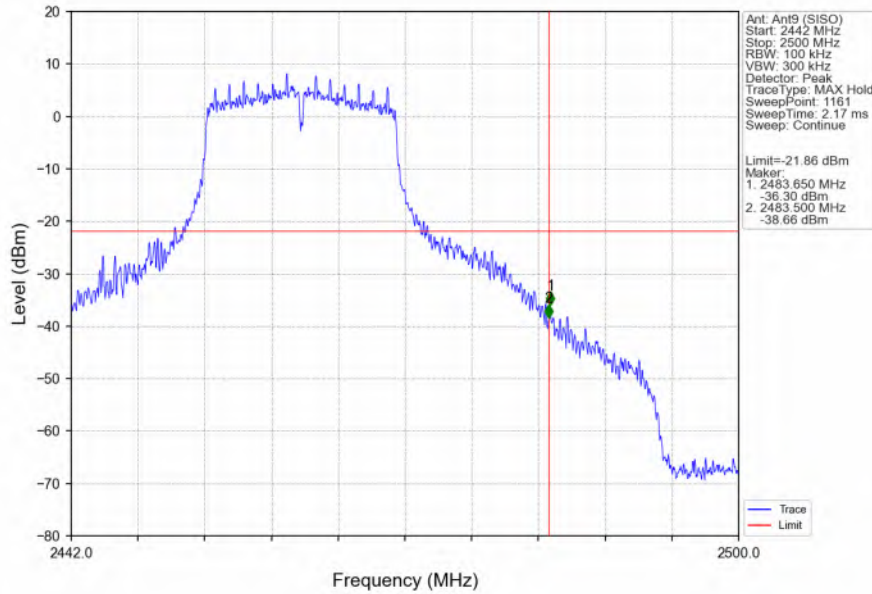


802.11g_HCH_2462MHz_Ant9 (SISO)_NTNV

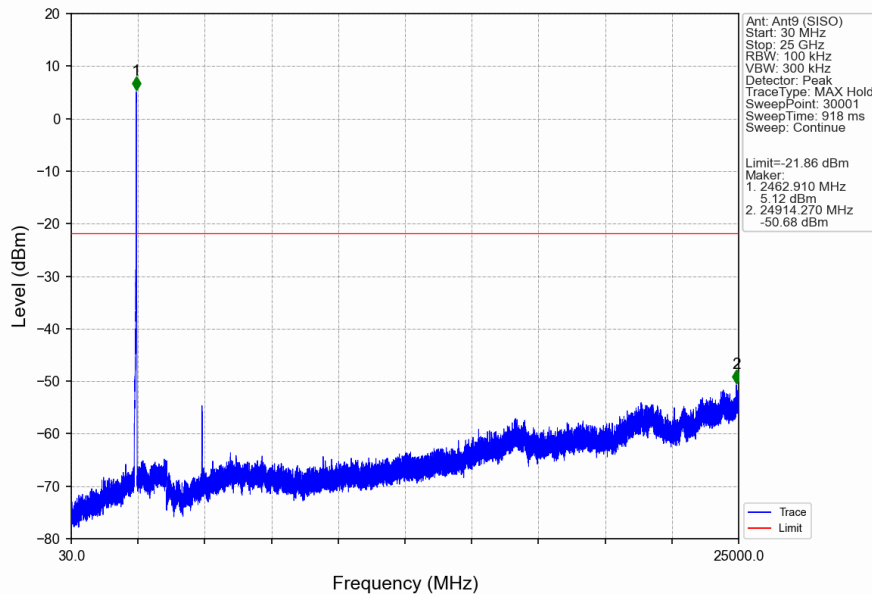


802.11n(HT20)_LCH_2412MHz_Ant8 (MIMO)_NTNV

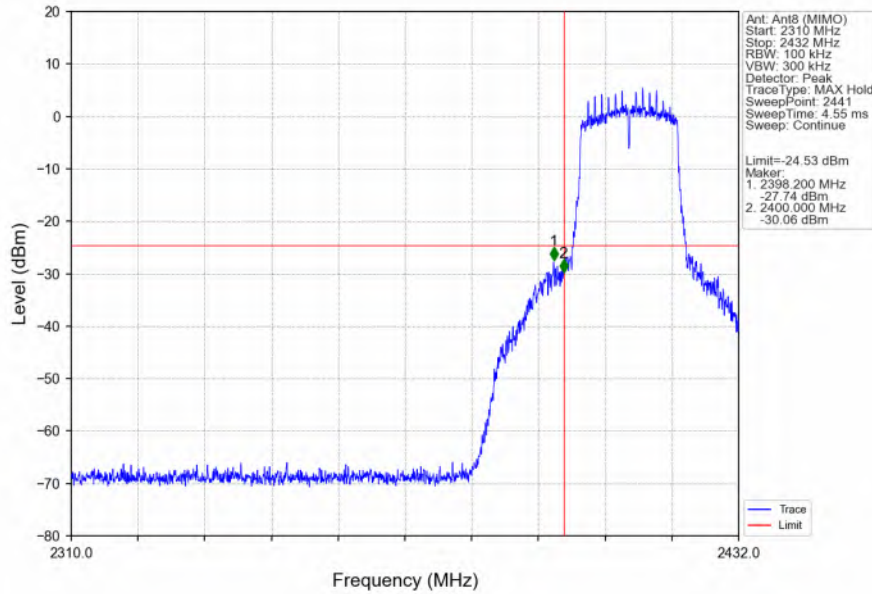


802.11n(HT20)_LCH_2412MHz_Ant8 (MIMO)_NTNV

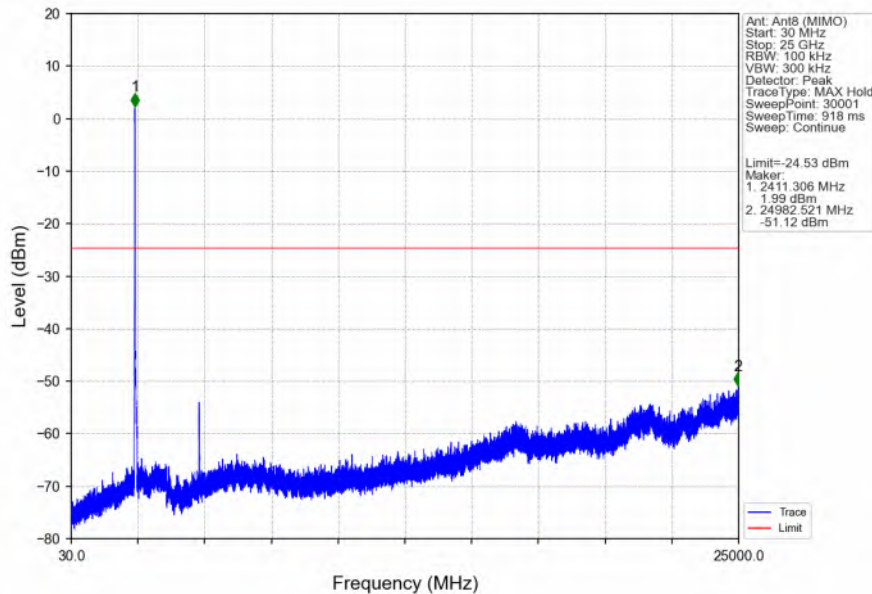

802.11n(HT20)_LCH_2412MHz_Ant9 (MIMO)_NTNV

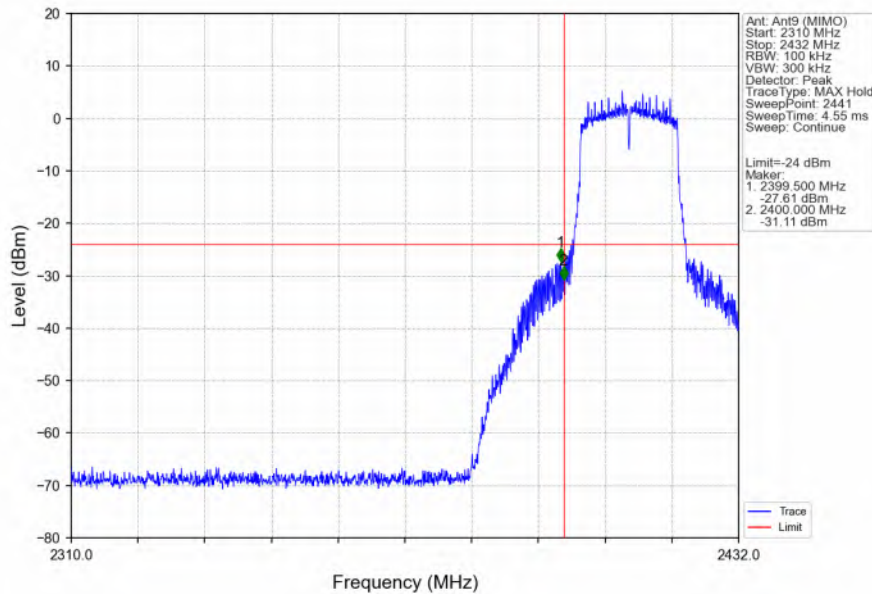


802.11n(HT20)_LCH_2412MHz_Ant9 (MIMO)_NTNV

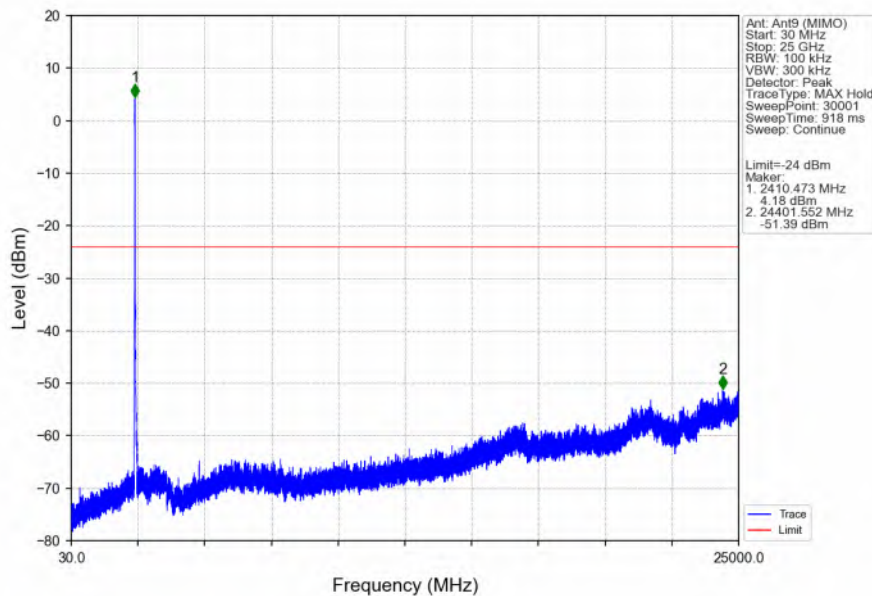


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

802.11n(HT20)_MCH_2437MHz_Ant8 (MIMO)_NTNV

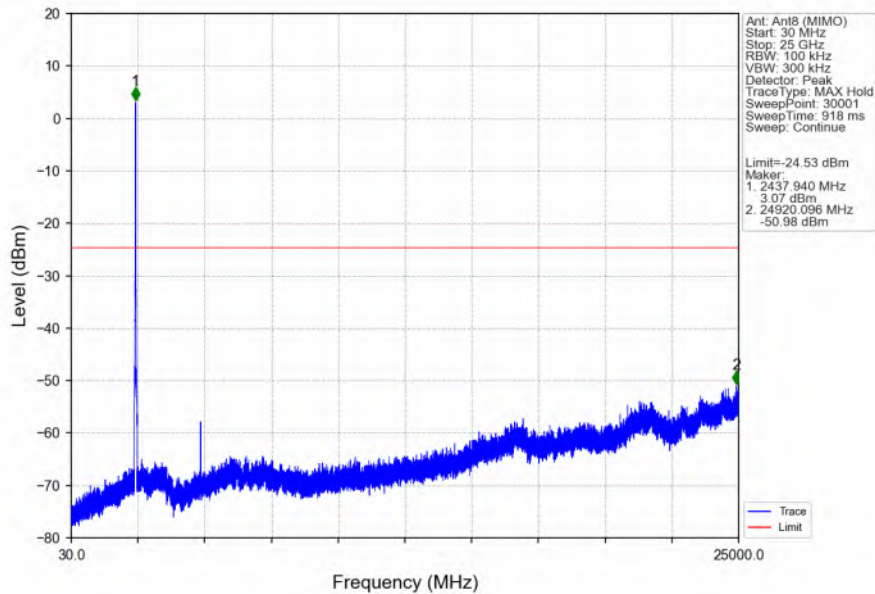


802.11n(HT20)_MCH_2437MHz_Ant9 (MIMO)_NTNV

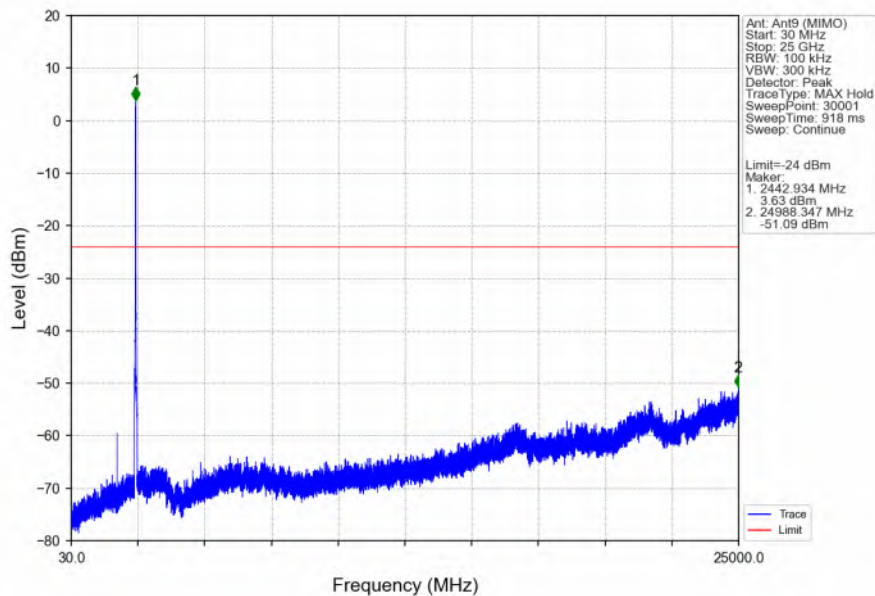


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


802.11n(HT20)_HCH_2462MHz_Ant8 (MIMO)_NTNV

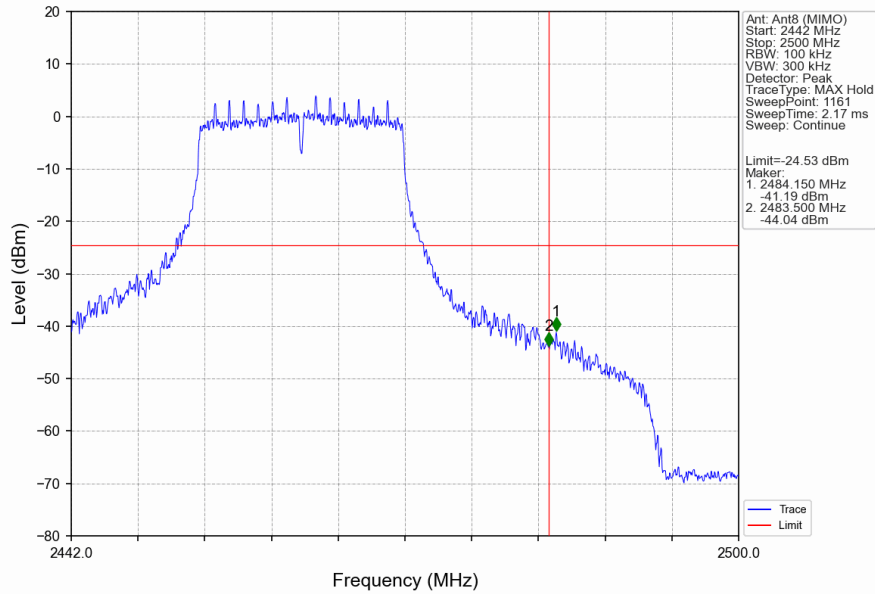


802.11n(HT20)_HCH_2462MHz_Ant8 (MIMO)_NTNV

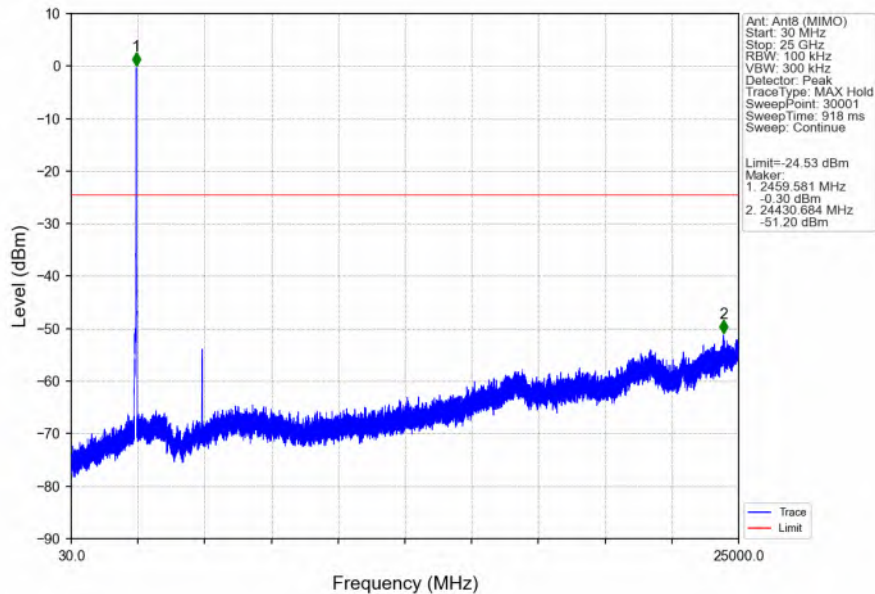


802.11n(HT20)_HCH_2462MHz_Ant9 (MIMO)_NTNV

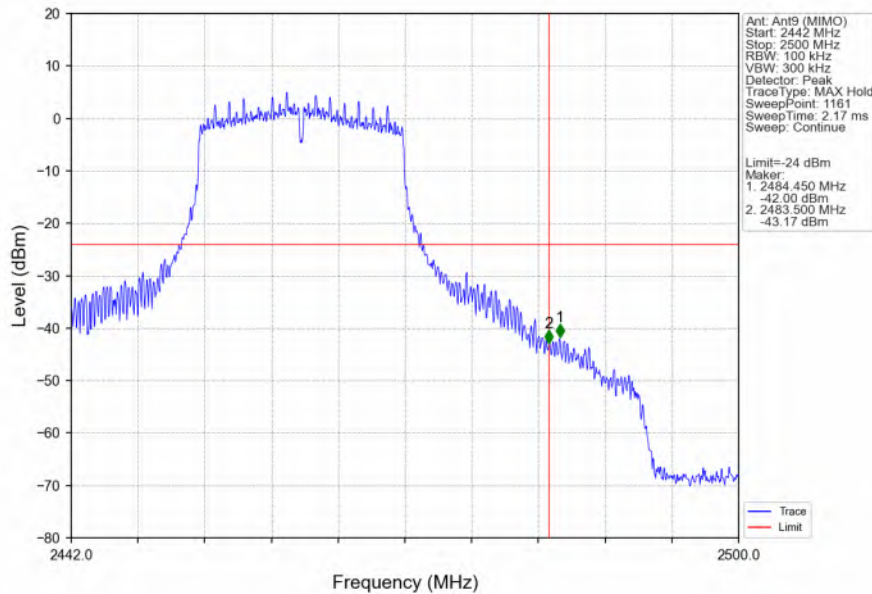


802.11n(HT20)_HCH_2462MHz_Ant9 (MIMO)_NTNV

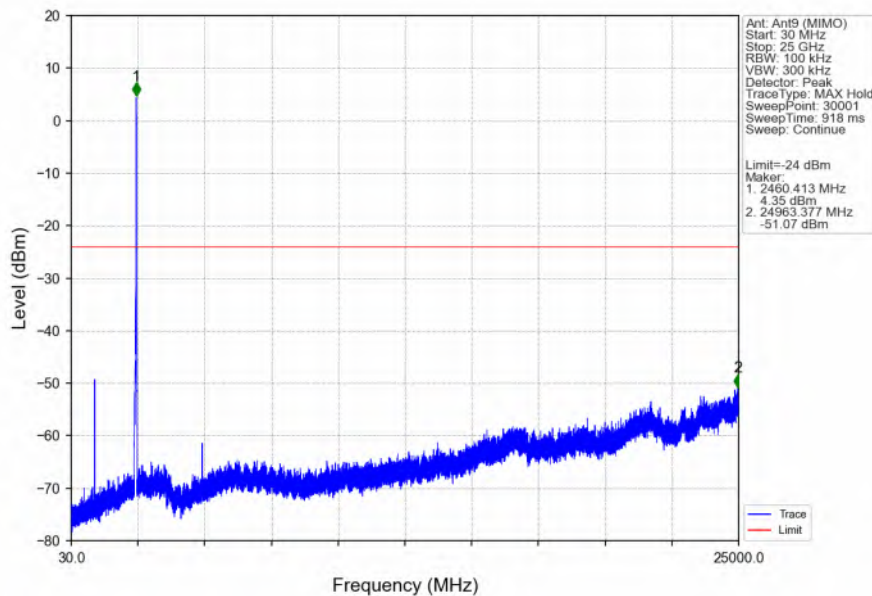


802.11n(HT40)_LCH_2422MHz_Ant8 (MIMO)_NTNV

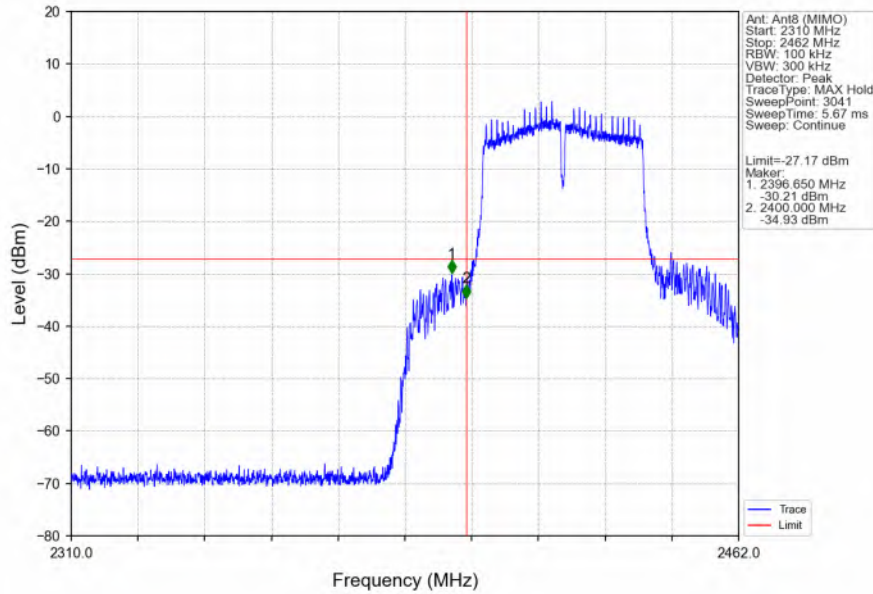


802.11n(HT40)_LCH_2422MHz_Ant8 (MIMO)_NTNV

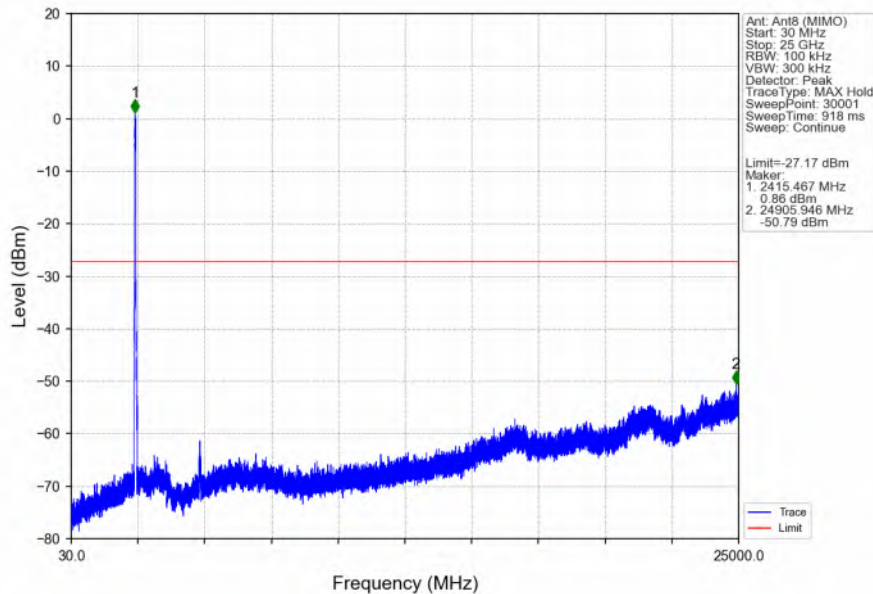


802.11n(HT40)_LCH_2422MHz_Ant9 (MIMO)_NTNV

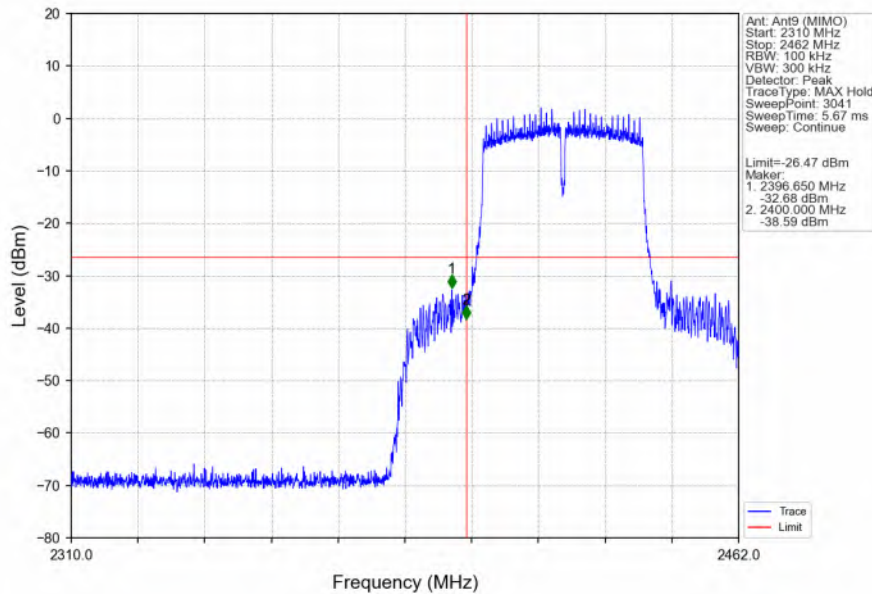


802.11n(HT40)_LCH_2422MHz_Ant9 (MIMO)_NTNV

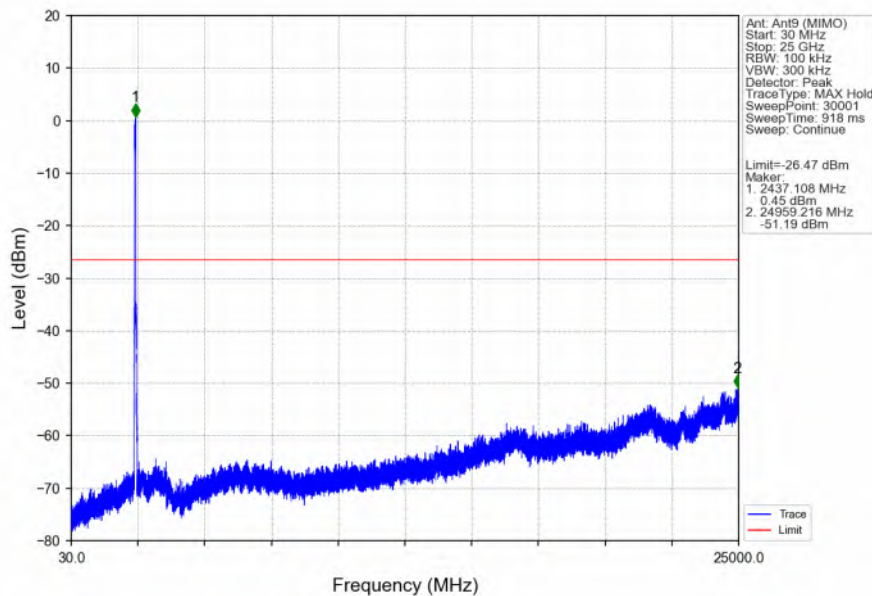


802.11n(HT40)_MCH_2437MHz_Ant8 (MIMO)_NTNV

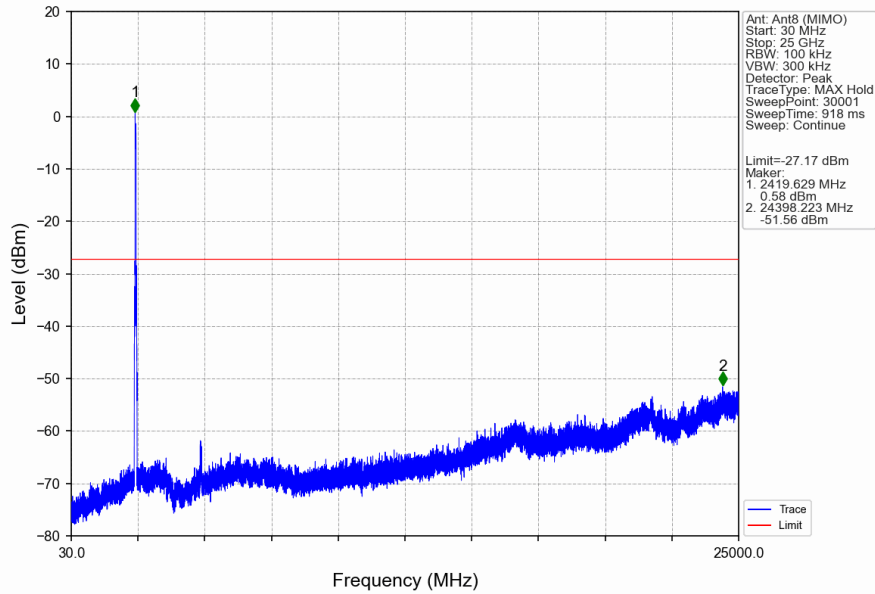


802.11n(HT40)_MCH_2437MHz_Ant9 (MIMO)_NTNV

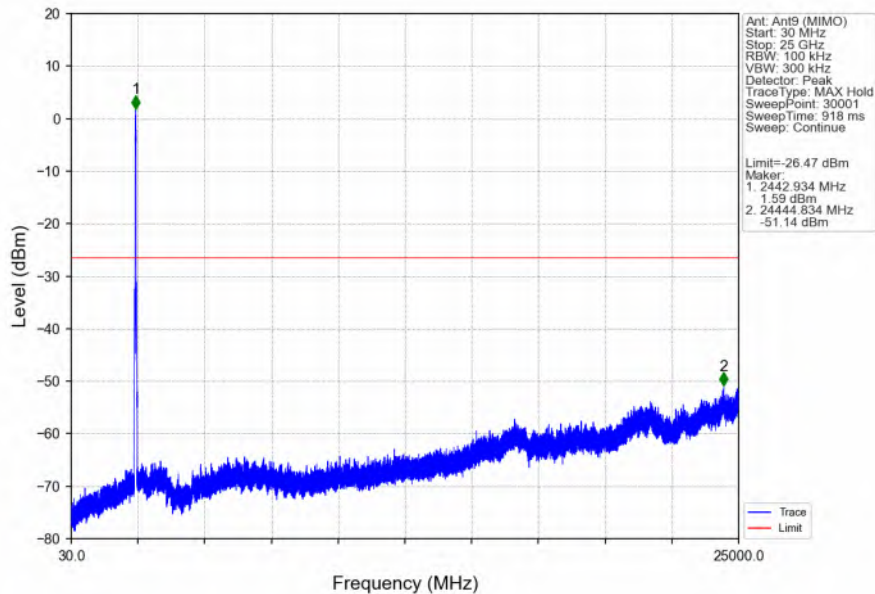


802.11n(HT40)_HCH_2452MHz_Ant8 (MIMO)_NTNV

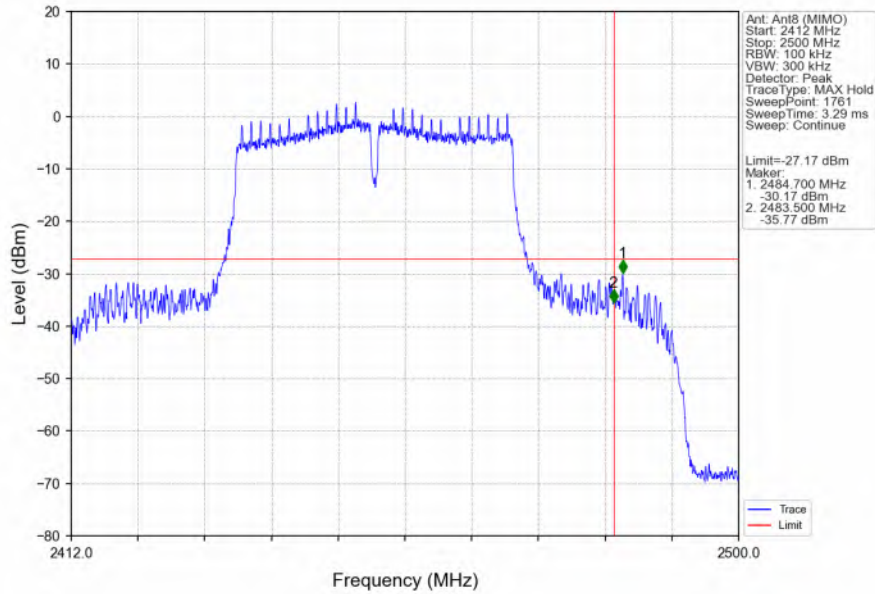


802.11n(HT40)_HCH_2452MHz_Ant8 (MIMO)_NTNV

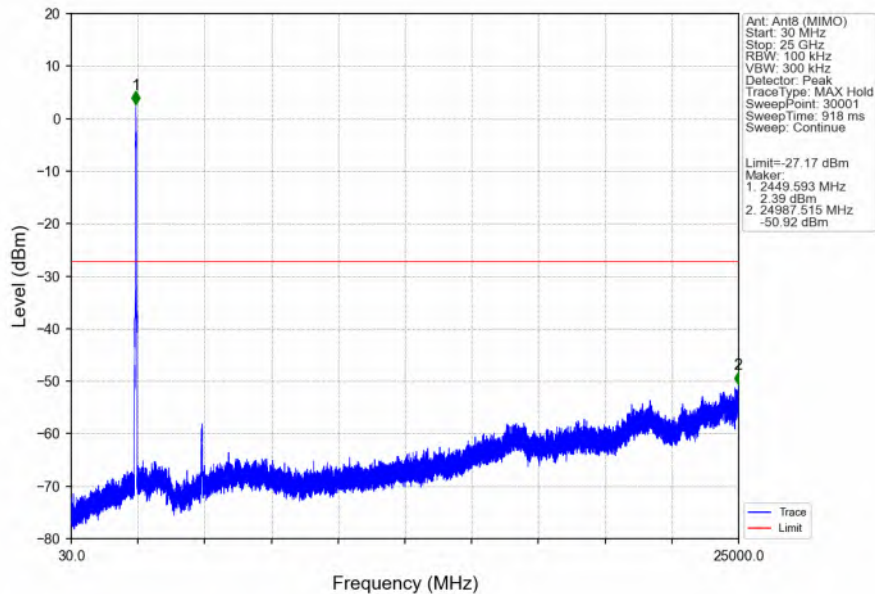


802.11n(HT40)_HCH_2452MHz_Ant9 (MIMO)_NTNV

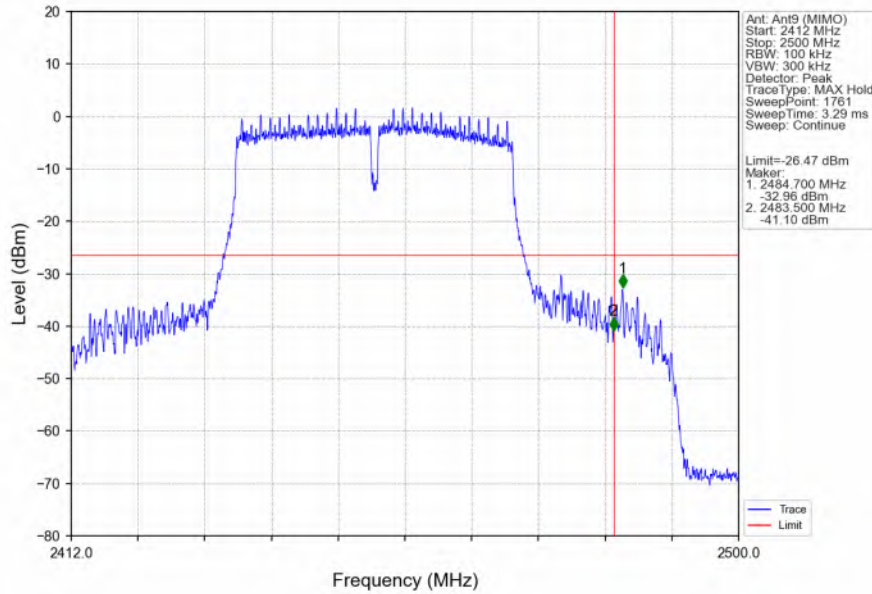


802.11n(HT40)_HCH_2452MHz_Ant9 (MIMO)_NTNV

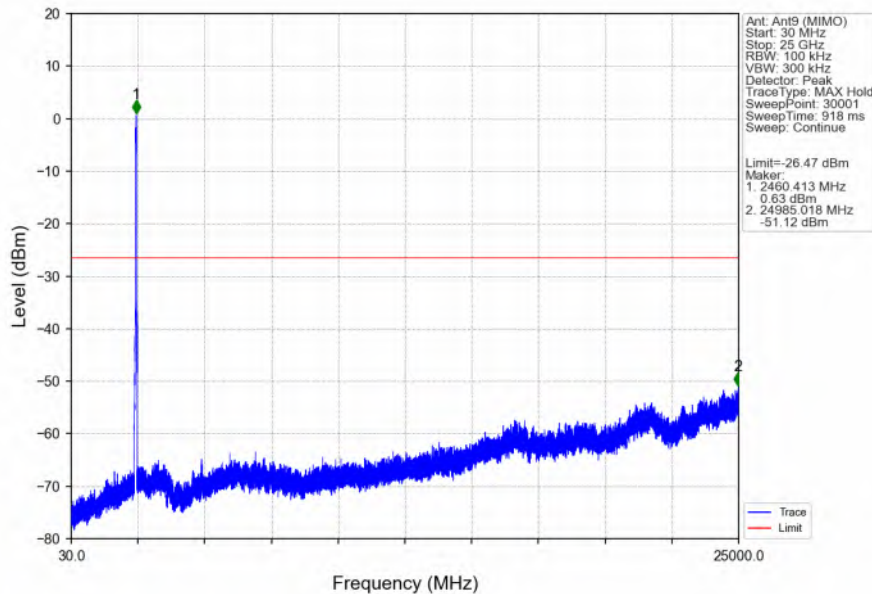


802.11ax(HEW20)_LCH_2412MHz_RU26_Left_Ant8 (MIMO)_NTNV

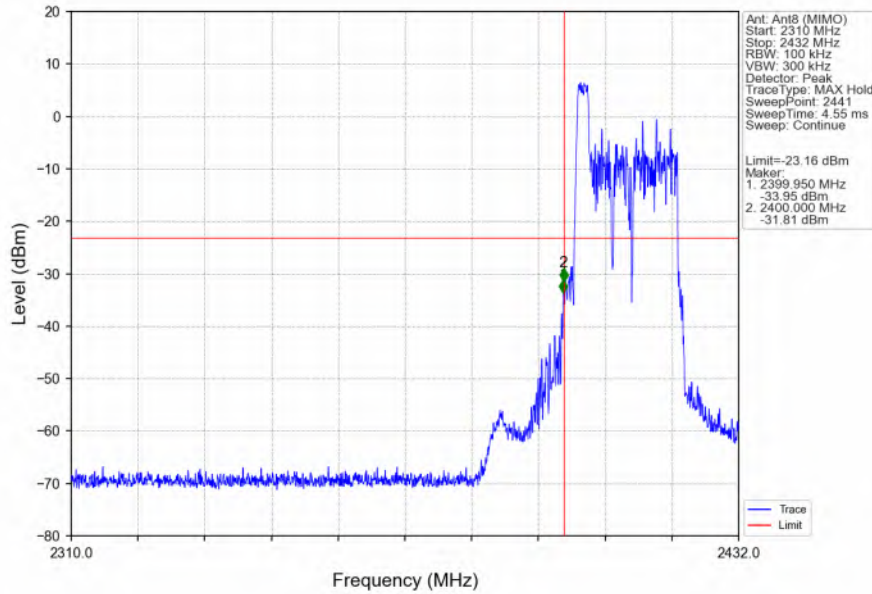


802.11ax(HEW20)_LCH_2412MHz_RU26_Left_Ant8 (MIMO)_NTNV

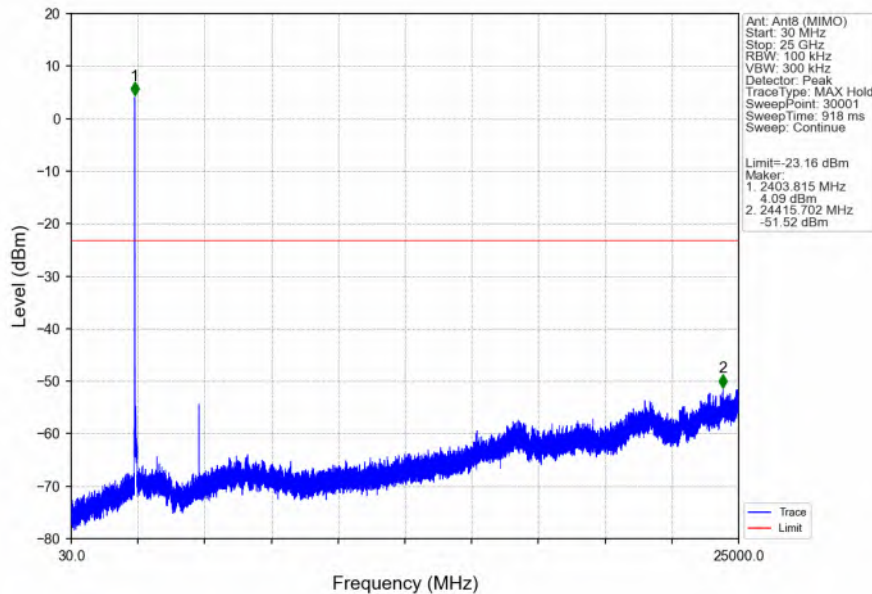


802.11ax(HEW20)_LCH_2412MHz_RU26_Left_Ant9 (MIMO)_NTNV

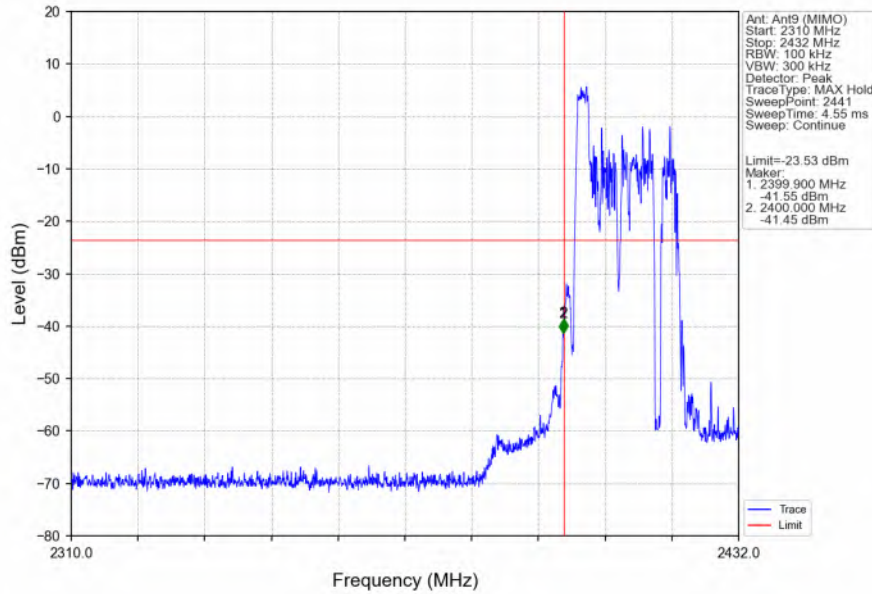


802.11ax(HEW20)_LCH_2412MHz_RU26_Left_Ant9 (MIMO)_NTNV

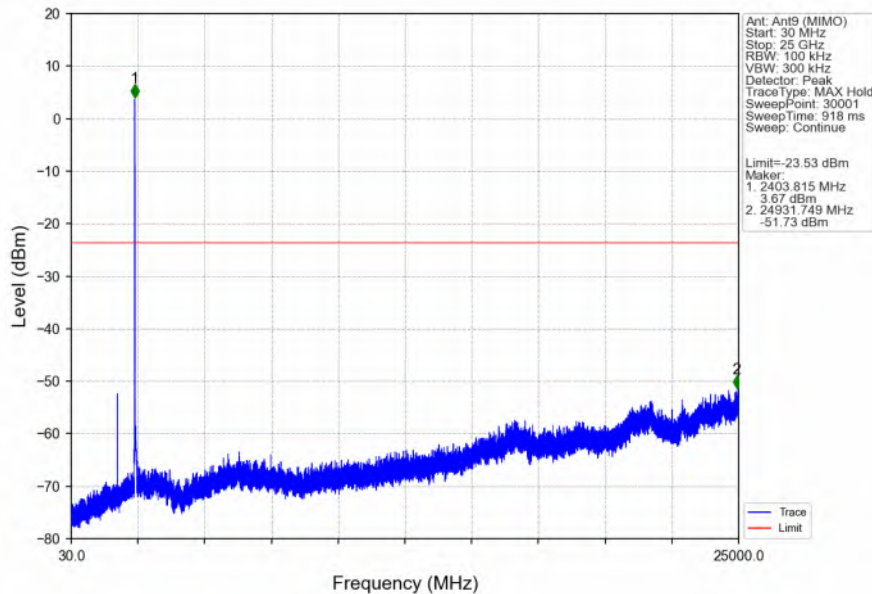


802.11ax(HEW20)_LCH_2412MHz_RU52_Left_Ant8 (MIMO)_NTNV

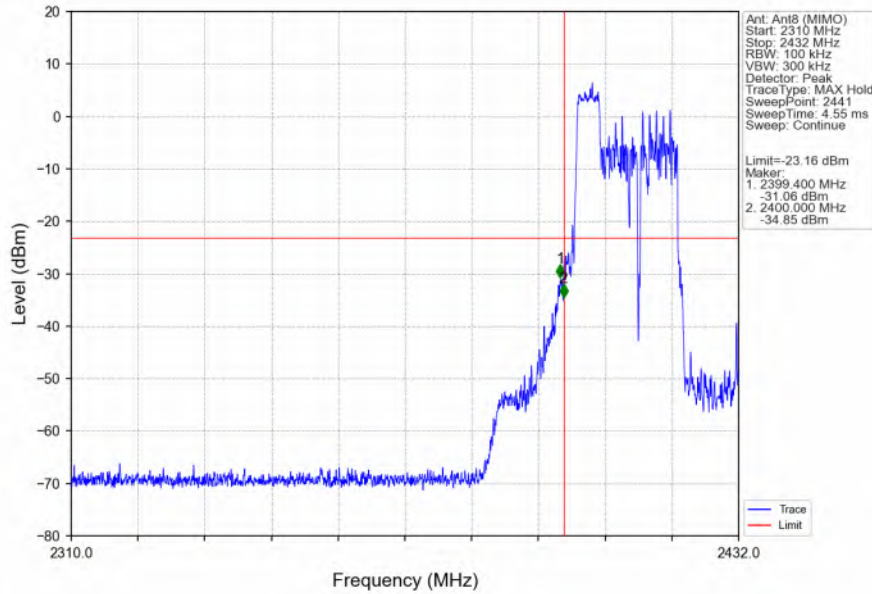


802.11ax(HEW20)_LCH_2412MHz_RU52_Left_Ant8 (MIMO)_NTNV

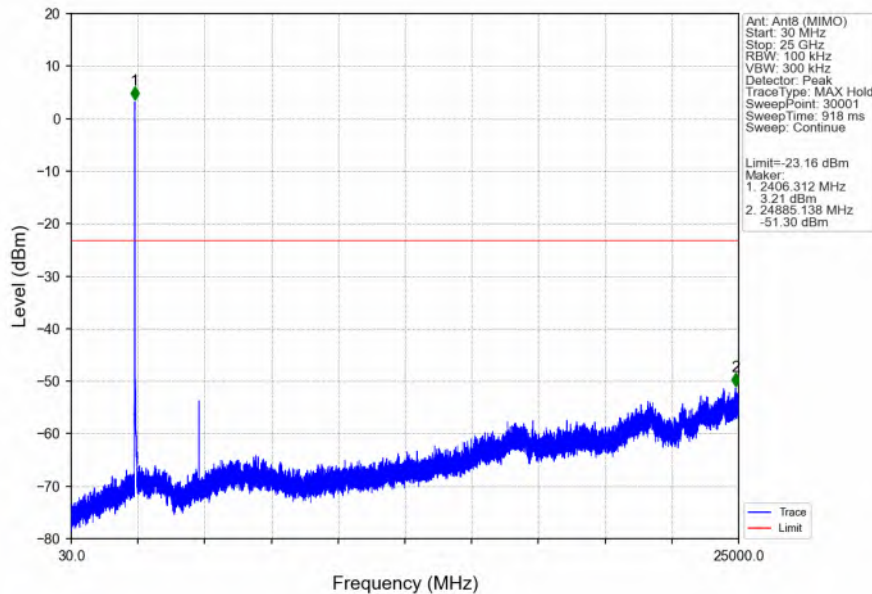


802.11ax(HEW20)_LCH_2412MHz_RU52_Left_Ant9 (MIMO)_NTNV

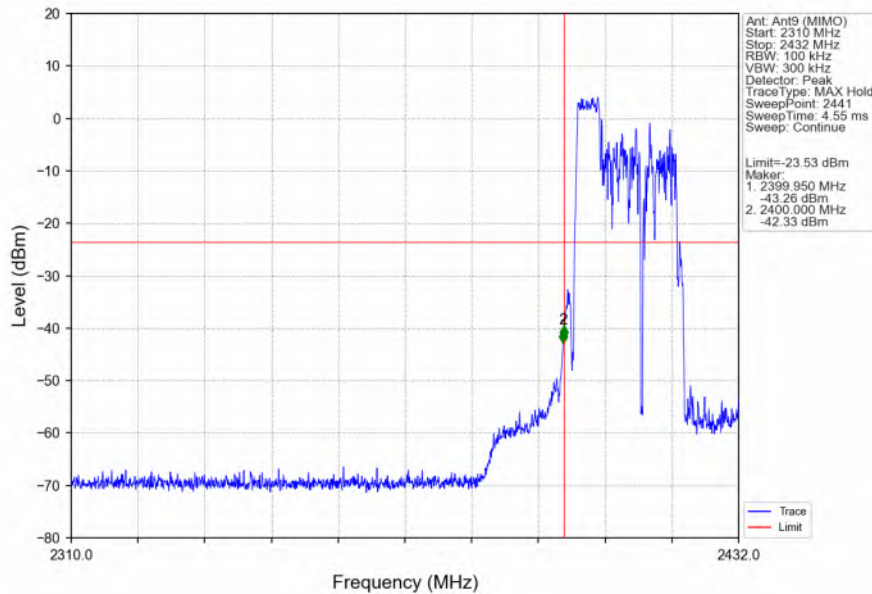


802.11ax(HEW20)_LCH_2412MHz_RU52_Left_Ant9 (MIMO)_NTNV

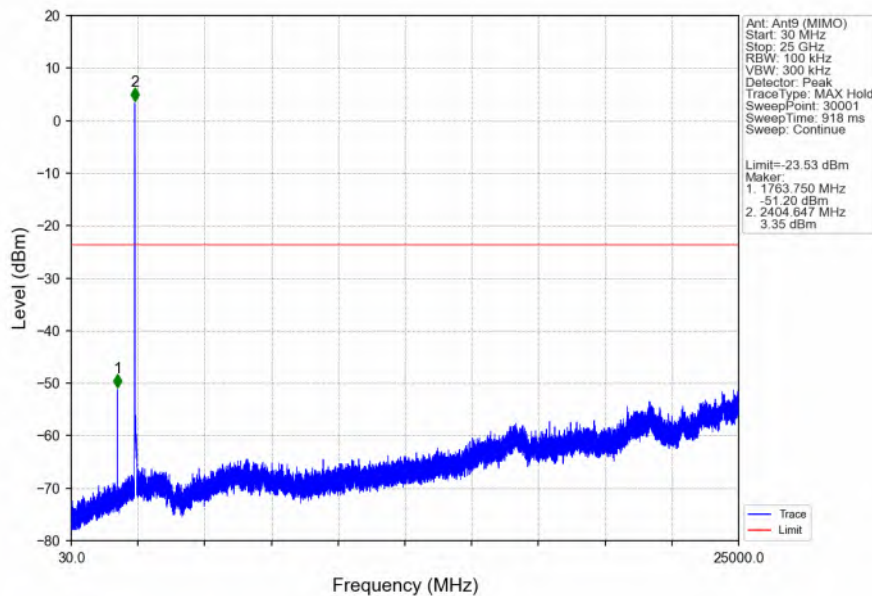

802.11ax(HEW20)_LCH_2412MHz_RU106_Left_Ant8 (MIMO)_NTNV

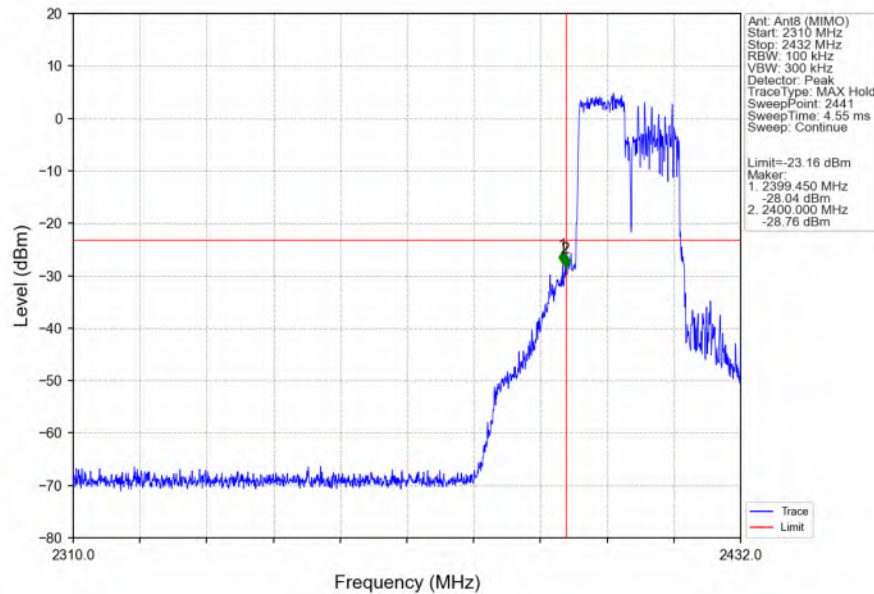

802.11ax(HEW20)_LCH_2412MHz_RU106_Left_Ant8 (MIMO)_NTNV

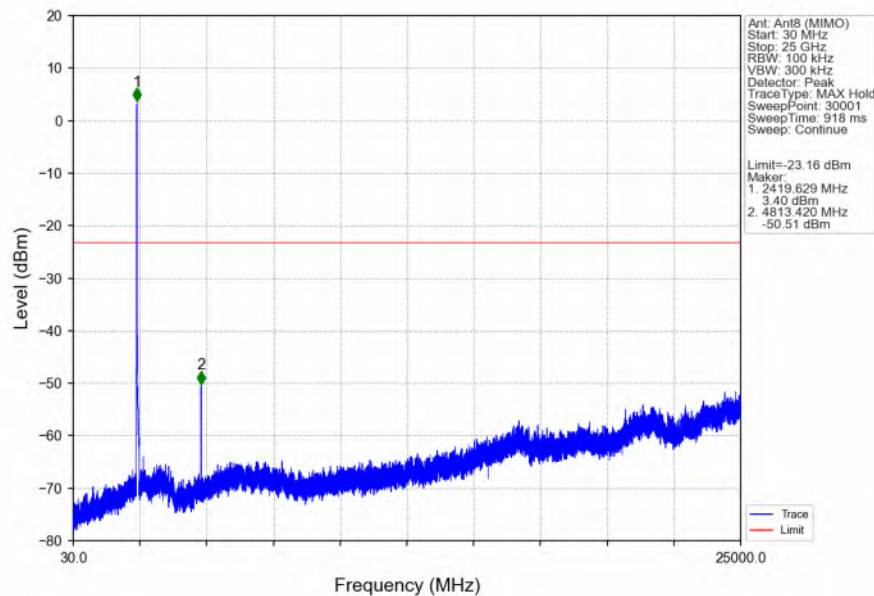


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


SGS-CSTC Standards Technical Services Co., Ltd.
Shenzhen Branch Inspection & Testing Laboratory

No.1 Workshop, M-10, Middle Section, Science & Technology Park, Nanshan District, Shenzhen, Guangdong, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com.cn
中国·广东·深圳市南山区科技园中区M-10栋1号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com


802.11ax(HEW20)_LCH_2412MHz_RU106_Left_Ant9 (MIMO)_NTNV

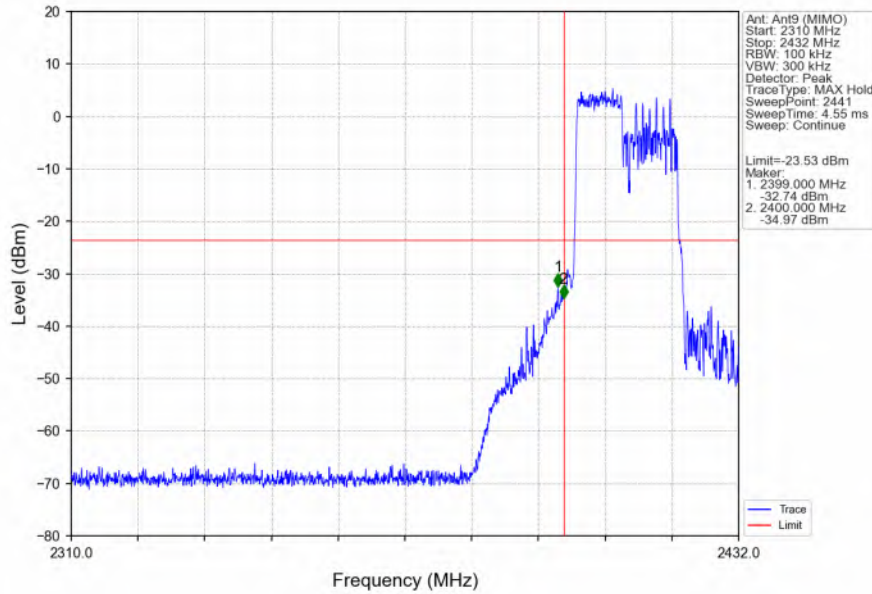


802.11ax(HEW20)_LCH_2412MHz_RU106_Left_Ant9 (MIMO)_NTNV

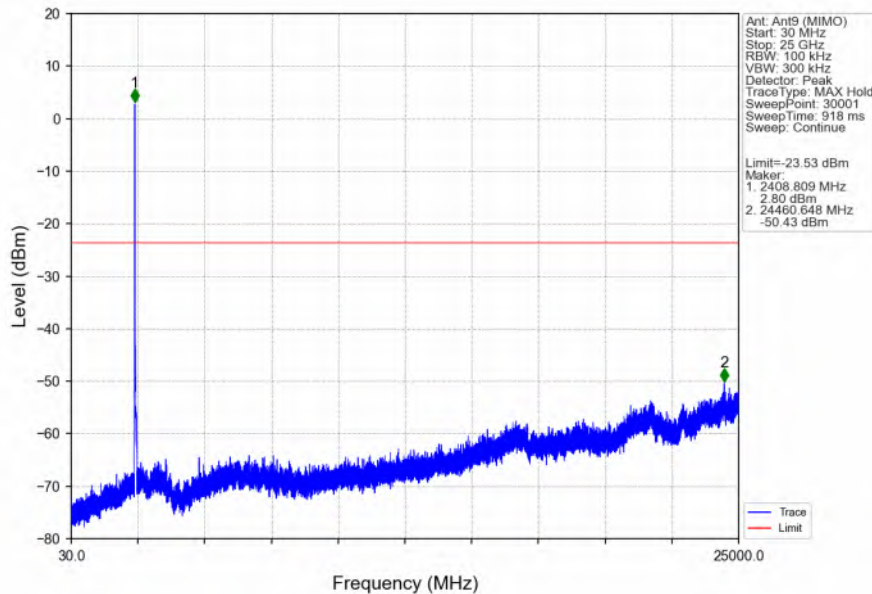


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant8 (MIMO)_NTNV

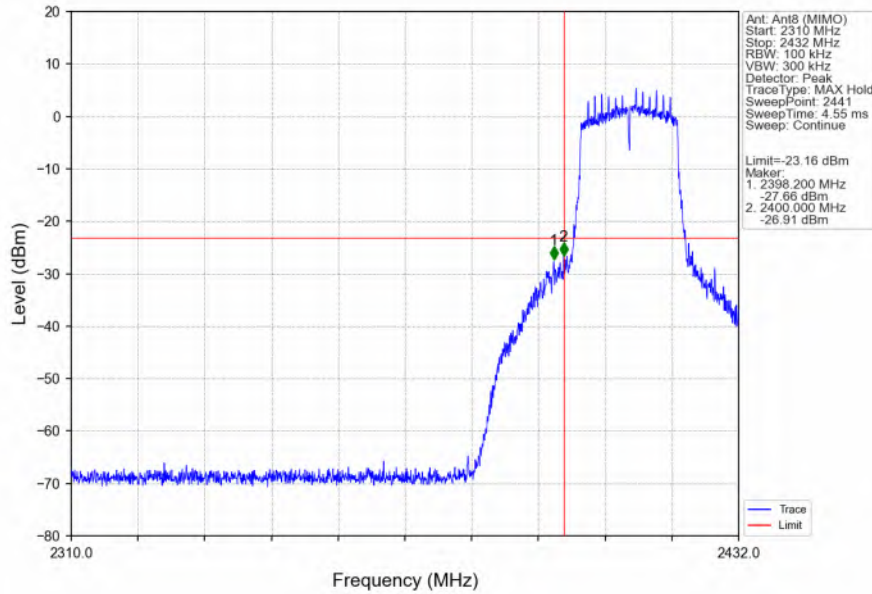


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant8 (MIMO)_NTNV

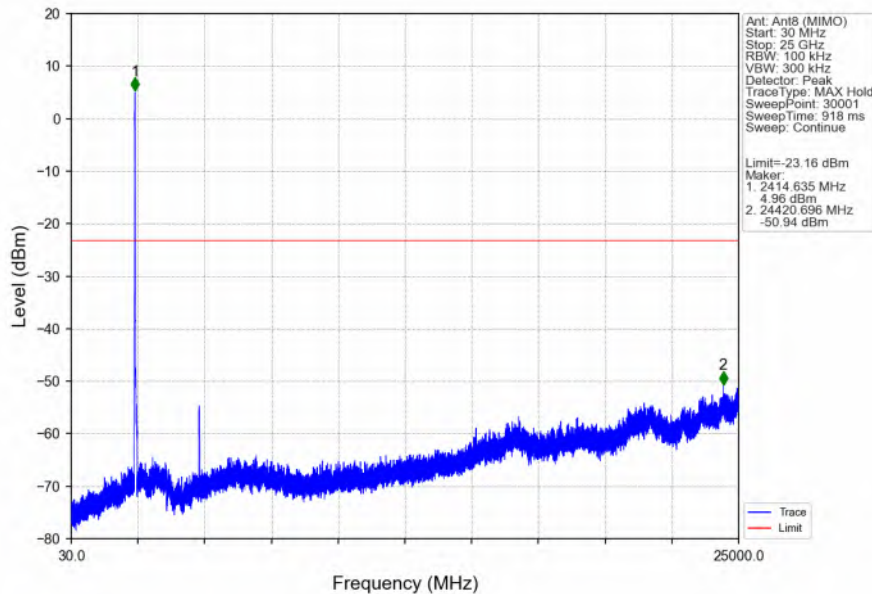


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant9 (MIMO)_NTNV

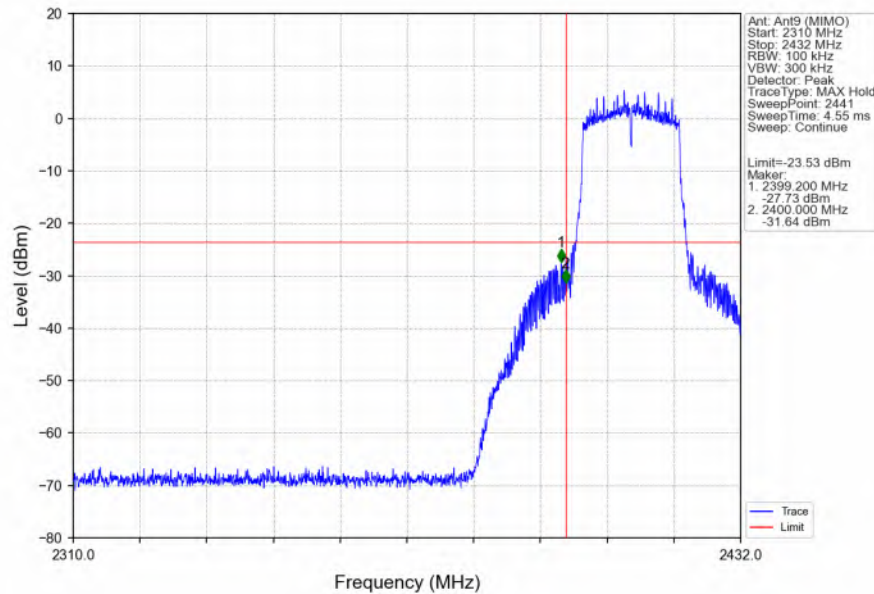


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant9 (MIMO)_NTNV

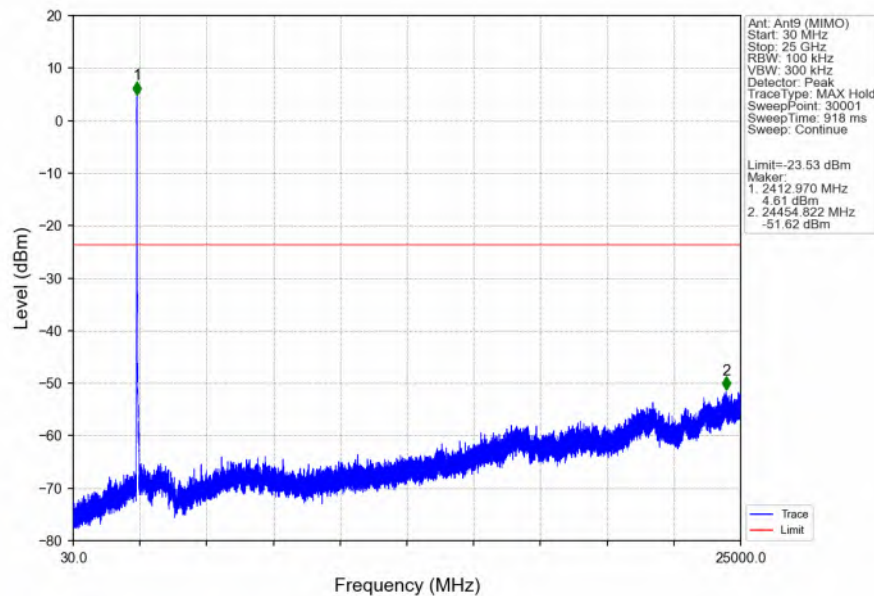


802.11ax(HEW20)_MCH_2437MHz_RU26_Mid_Ant8 (MIMO)_NTNV

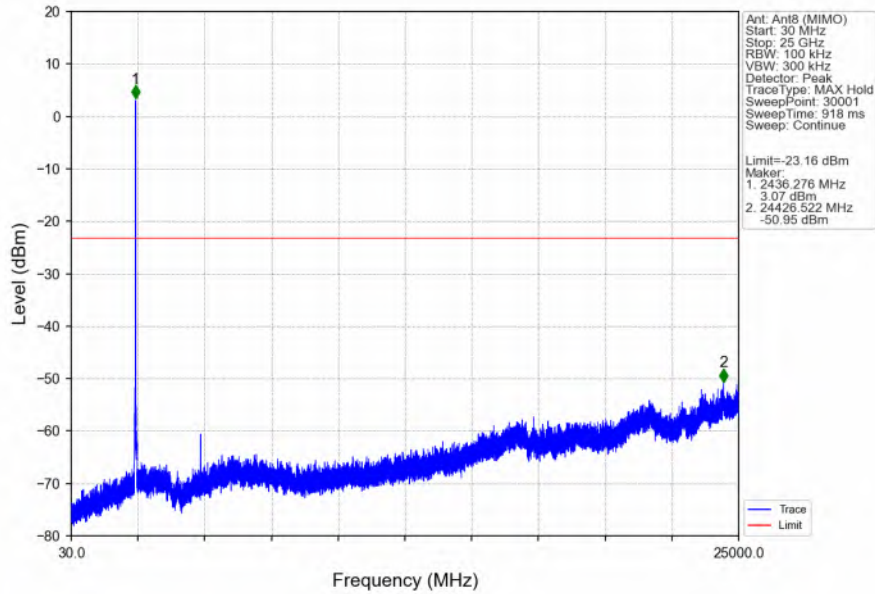


802.11ax(HEW20)_MCH_2437MHz_RU26_Mid_Ant9 (MIMO)_NTNV

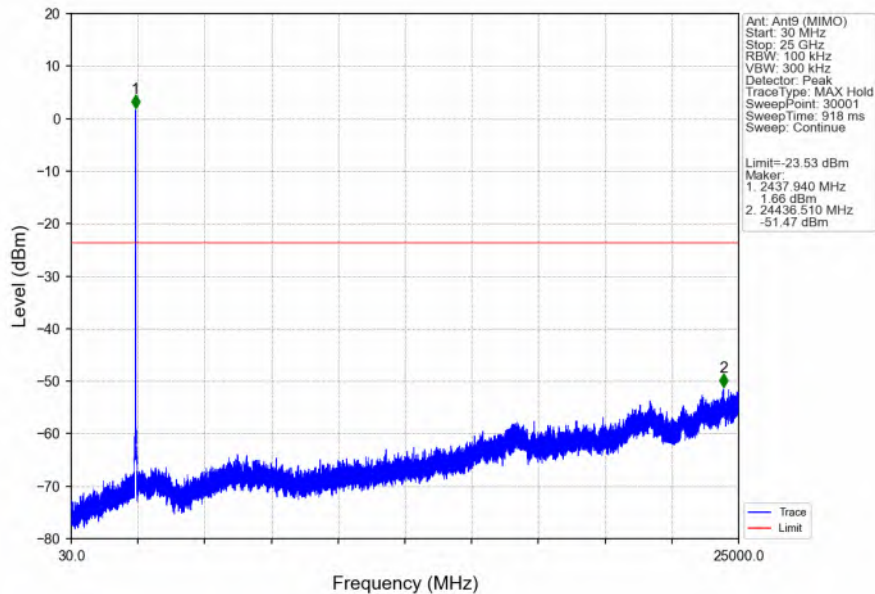


802.11ax(HEW20)_MCH_2437MHz_RU52_Mid_Ant8 (MIMO)_NTNV

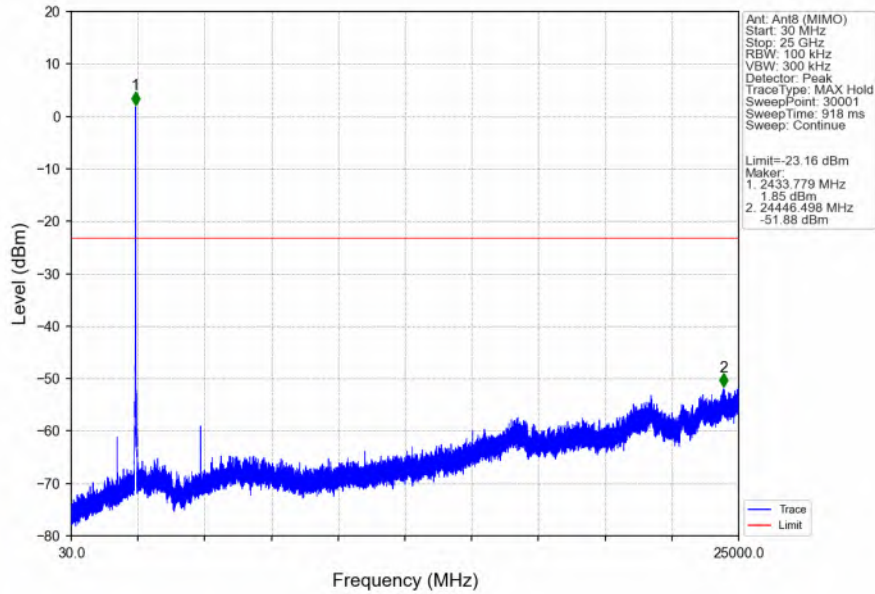


802.11ax(HEW20)_MCH_2437MHz_RU52_Mid_Ant9 (MIMO)_NTNV

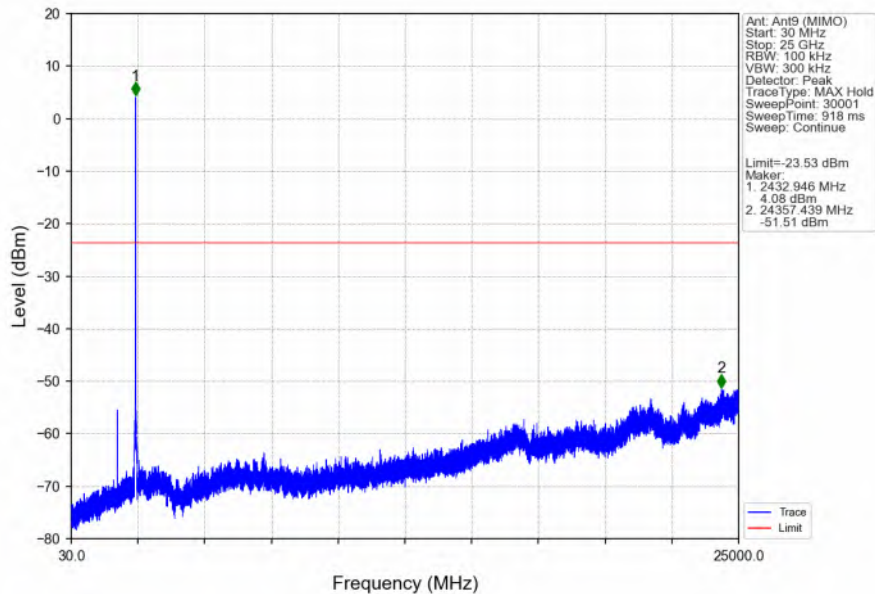


802.11ax(HEW20)_MCH_2437MHz_RU106_Left_Ant8 (MIMO)_NTNV

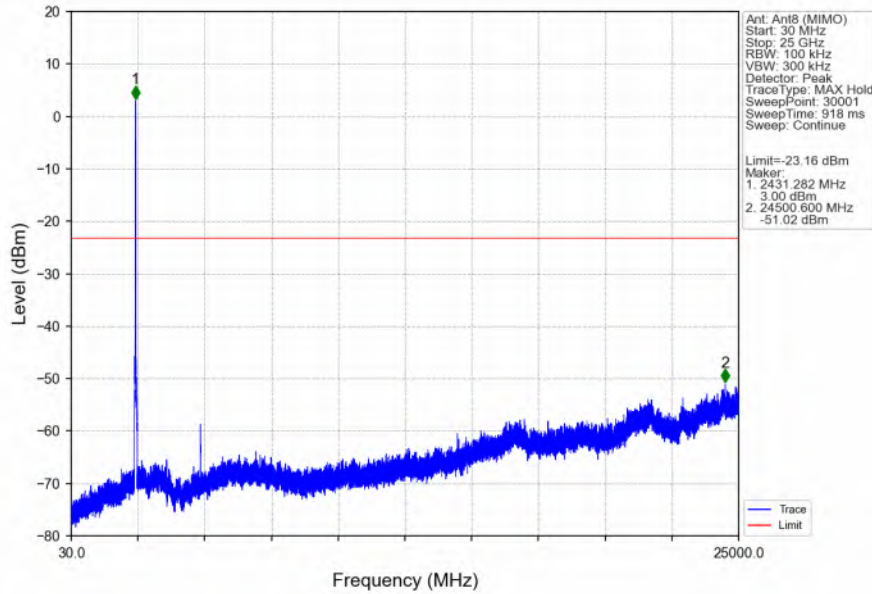


802.11ax(HEW20)_MCH_2437MHz_RU106_Left_Ant9 (MIMO)_NTNV

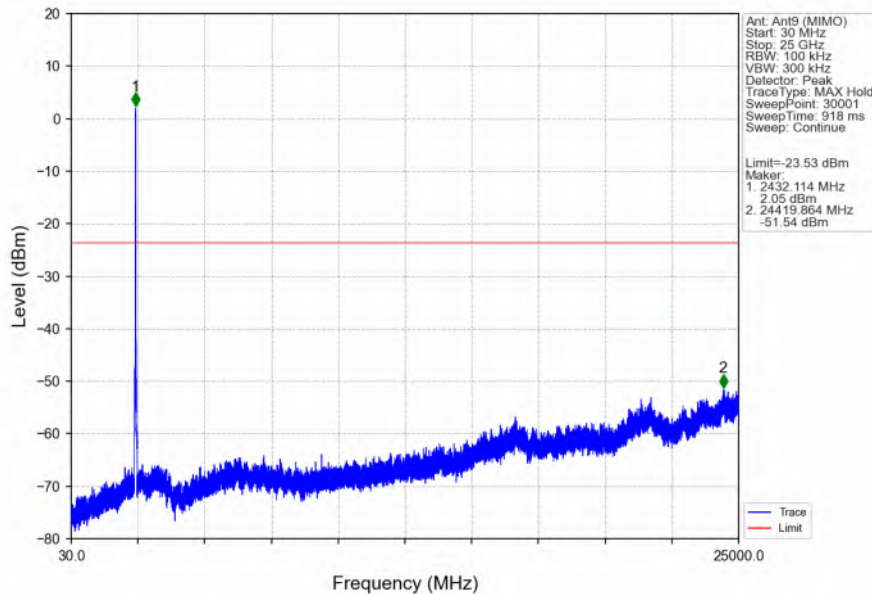

802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant8 (MIMO)_NTNV

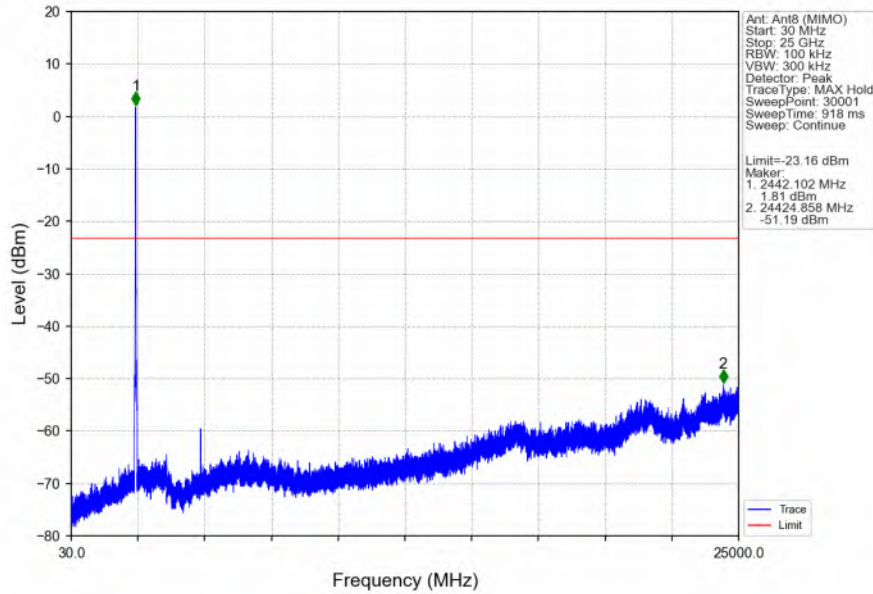


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant9 (MIMO)_NTNV

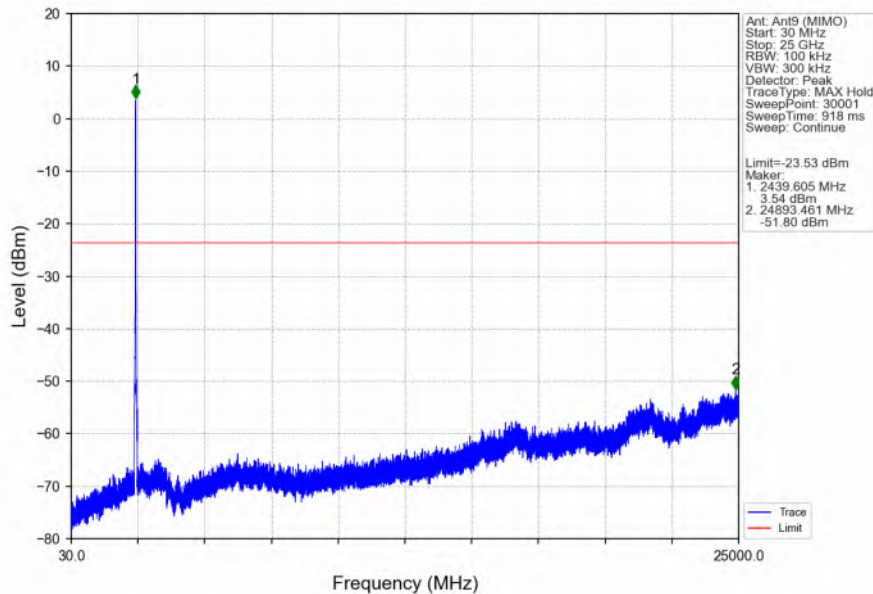


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <https://www.sgs.com/en/Terms-and-Conditions>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing /inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com


802.11ax(HEW20)_HCH_2462MHz_RU26_Right_Ant8 (MIMO)_NTNV

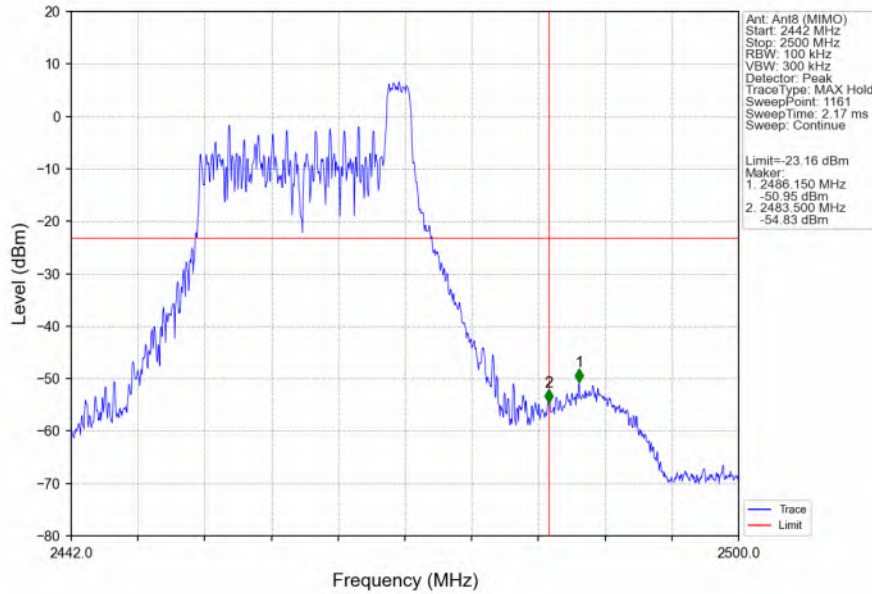


802.11ax(HEW20)_HCH_2462MHz_RU26_Right_Ant8 (MIMO)_NTNV

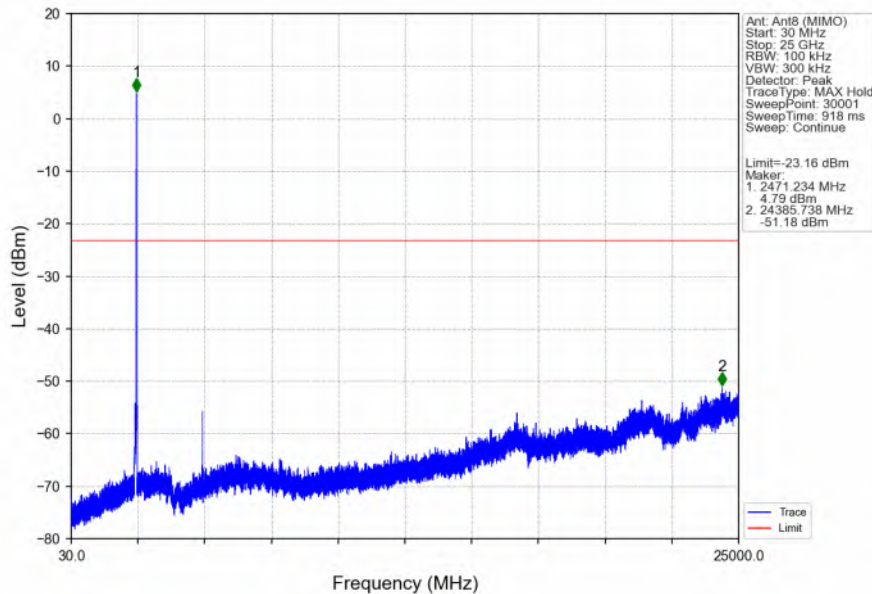


802.11ax(HEW20)_HCH_2462MHz_RU26_Right_Ant9 (MIMO)_NTNV

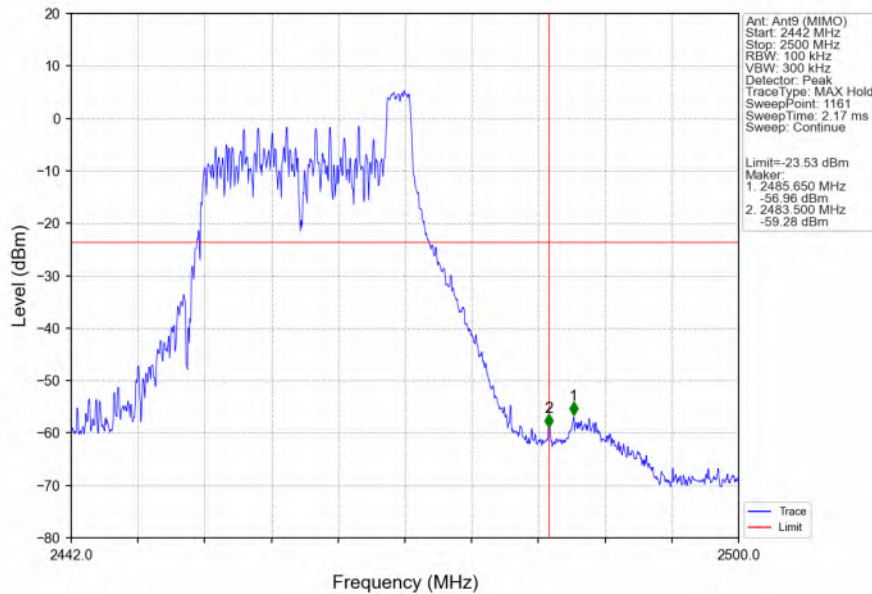


802.11ax(HEW20)_HCH_2462MHz_RU26_Right_Ant9 (MIMO)_NTNV

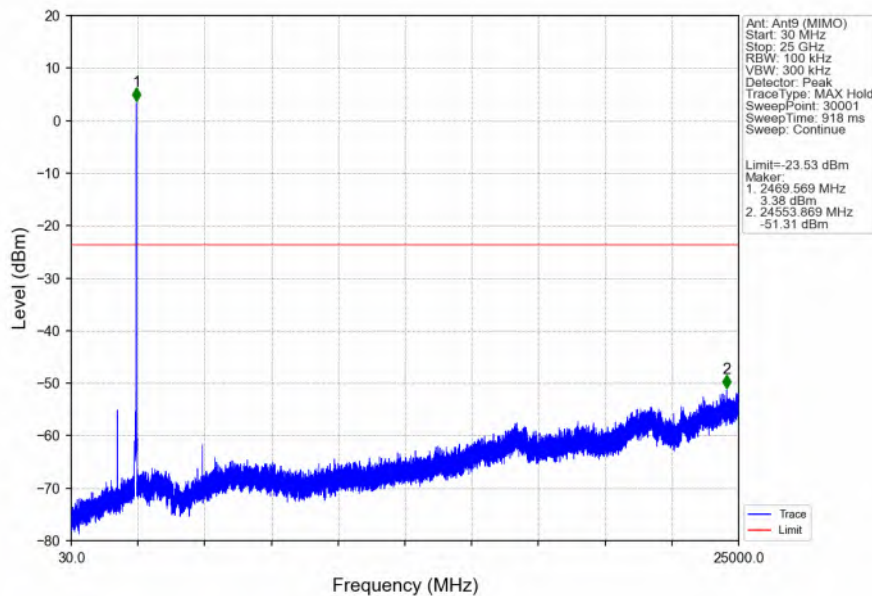


802.11ax(HEW20)_HCH_2462MHz_RU52_Right_Ant8 (MIMO)_NTNV

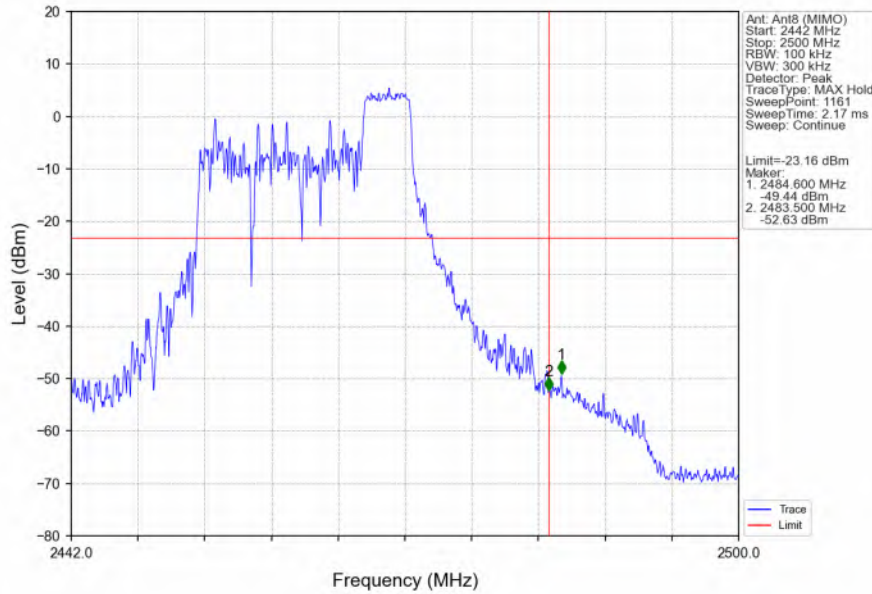


802.11ax(HEW20)_HCH_2462MHz_RU52_Right_Ant8 (MIMO)_NTNV

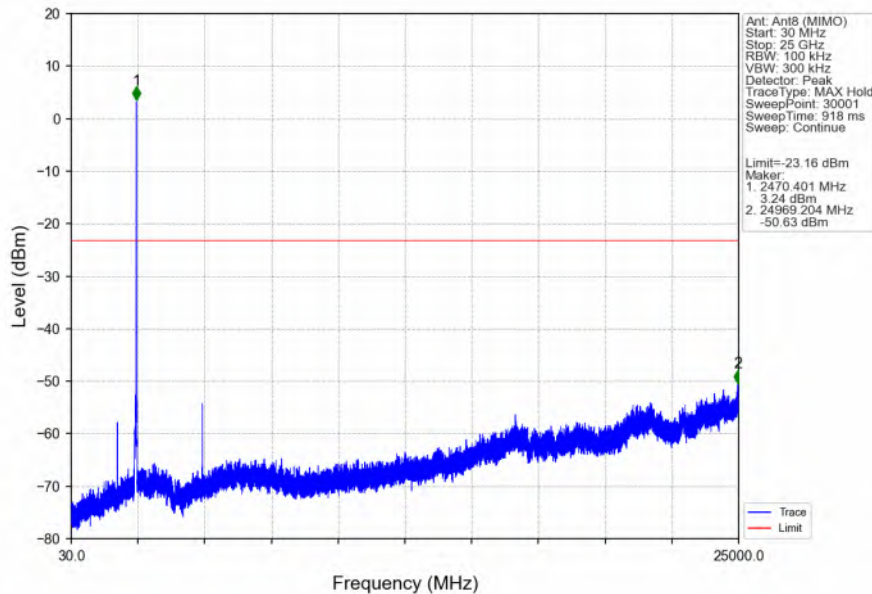


802.11ax(HEW20)_HCH_2462MHz_RU52_Right_Ant9 (MIMO)_NTNV

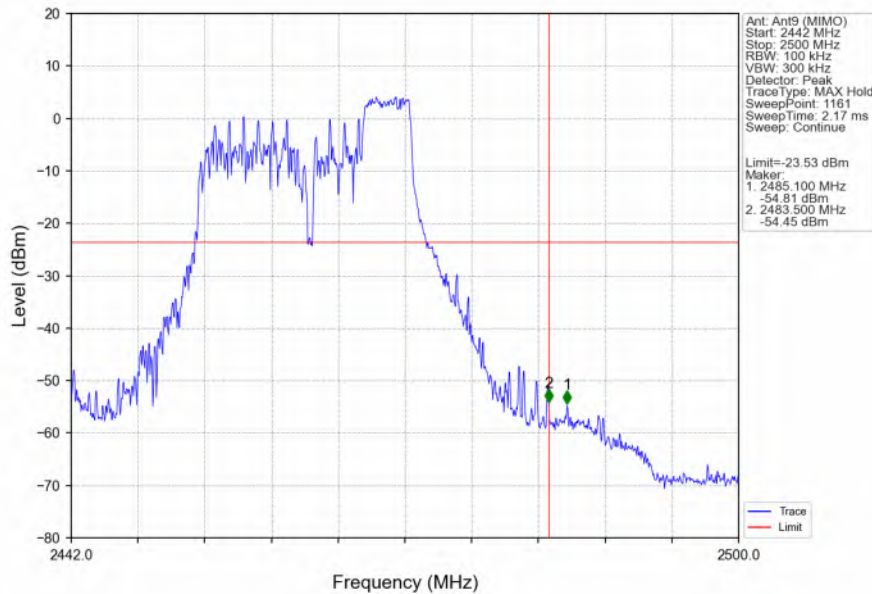


802.11ax(HEW20)_HCH_2462MHz_RU52_Right_Ant9 (MIMO)_NTNV

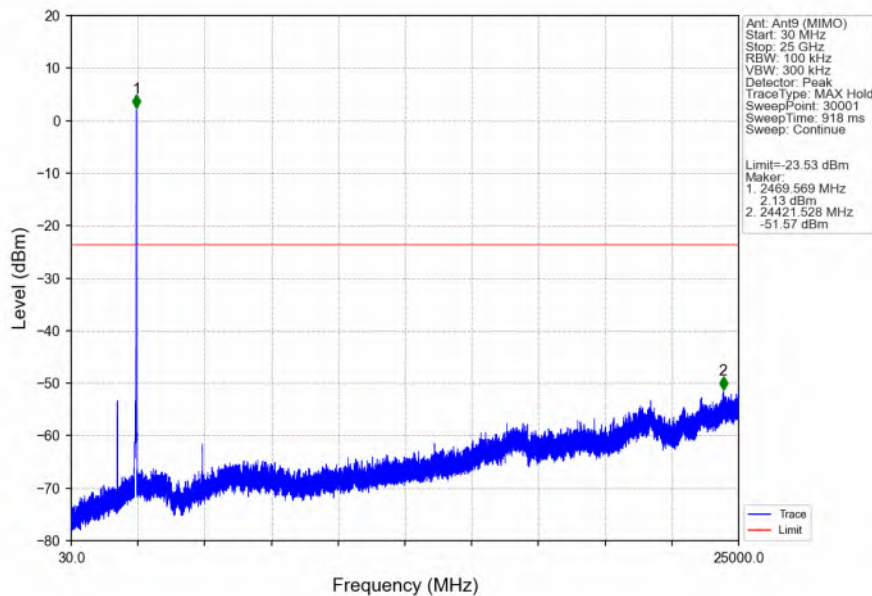


802.11ax(HEW20)_HCH_2462MHz_RU106_Right_Ant8 (MIMO)_NTNV

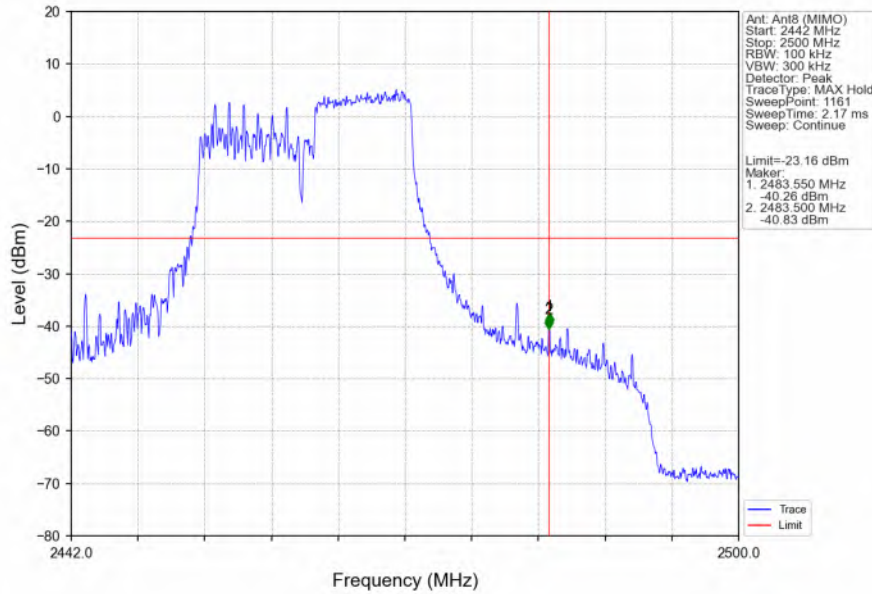


802.11ax(HEW20)_HCH_2462MHz_RU106_Right_Ant8 (MIMO)_NTNV

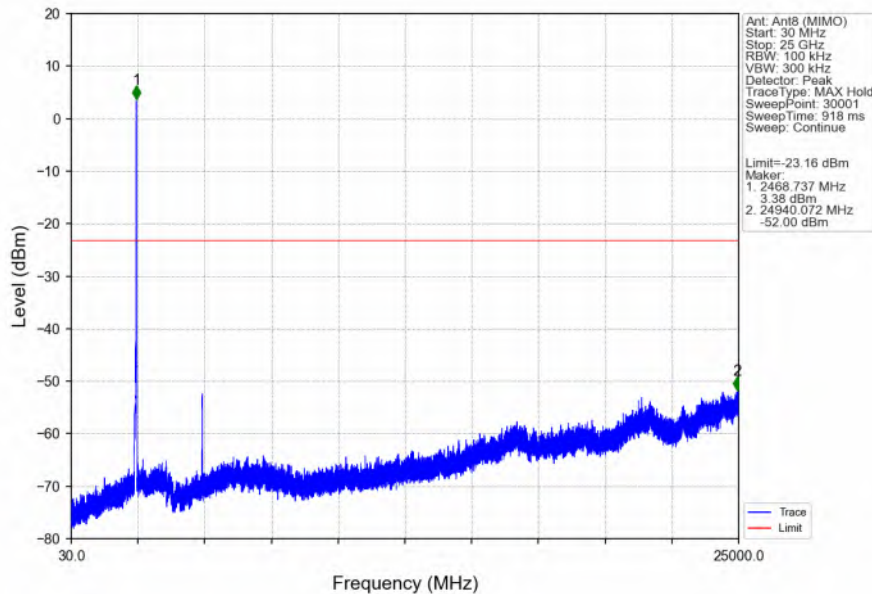


802.11ax(HEW20)_HCH_2462MHz_RU106_Right_Ant9 (MIMO)_NTNV

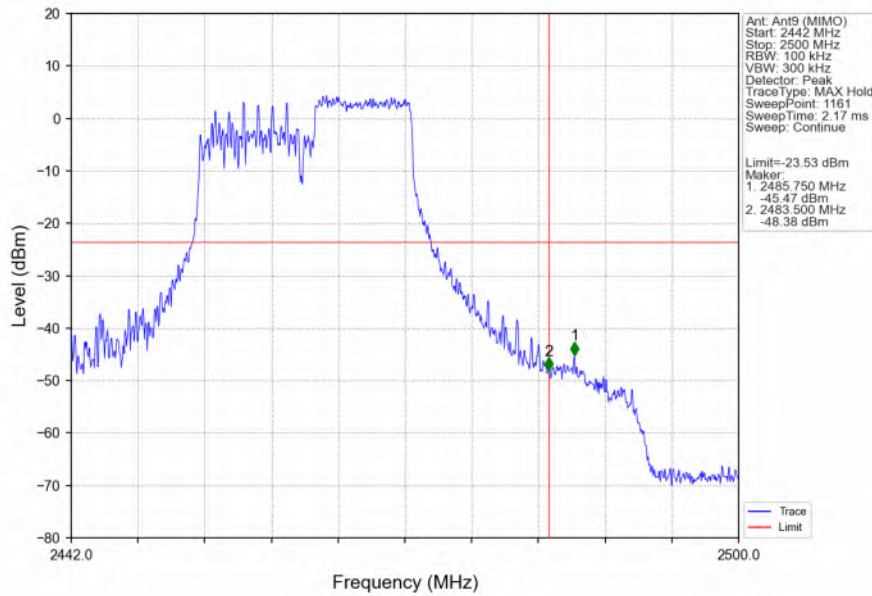


802.11ax(HEW20)_HCH_2462MHz_RU106_Right_Ant9 (MIMO)_NTNV

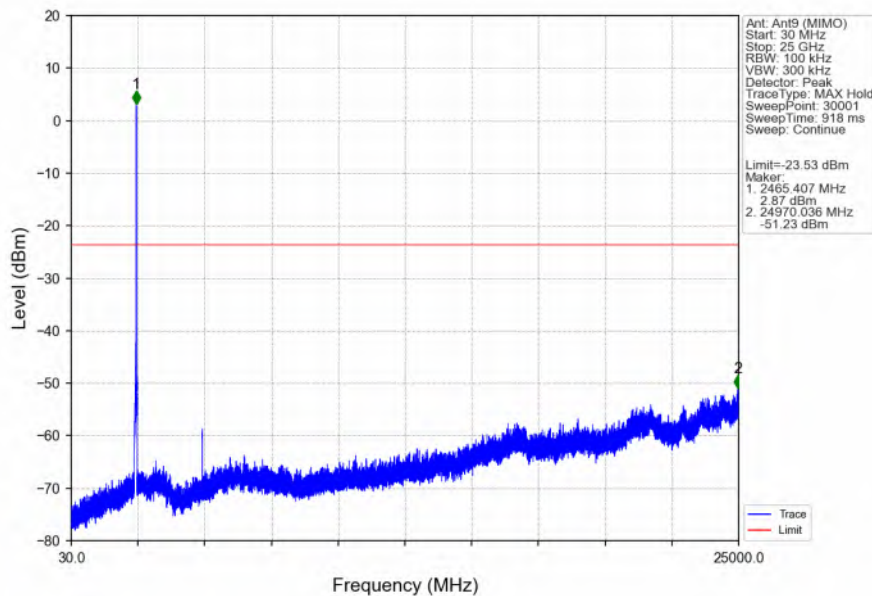


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant8 (MIMO)_NTNV

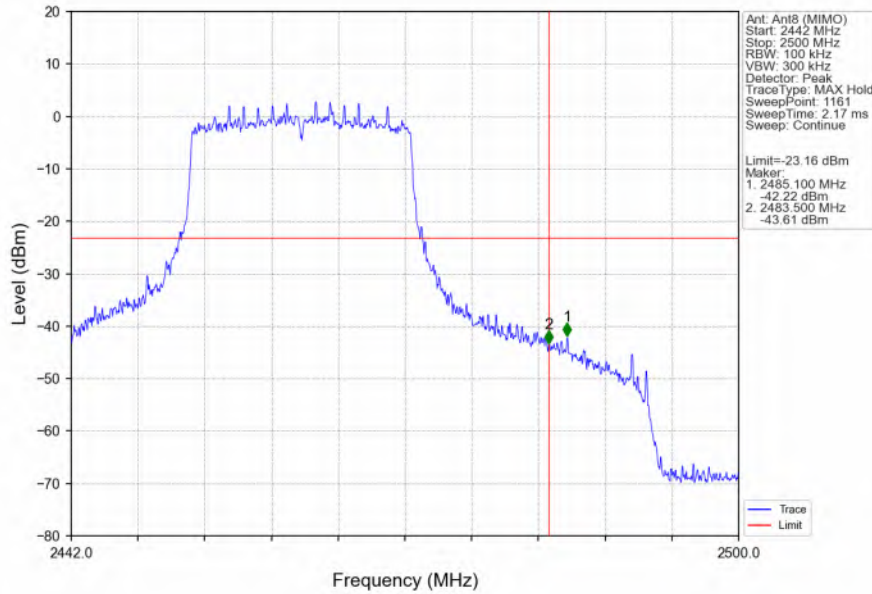


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant8 (MIMO)_NTNV

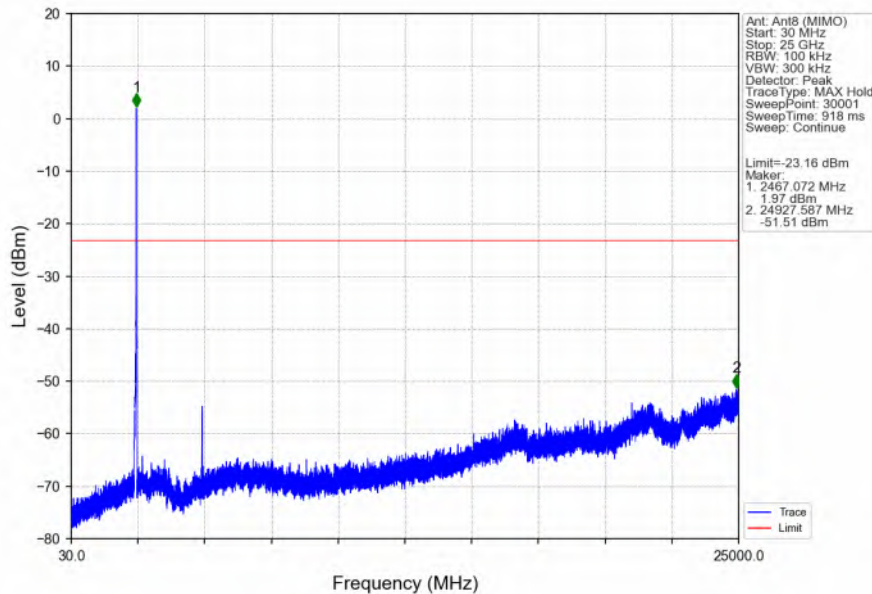


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant9 (MIMO)_NTNV

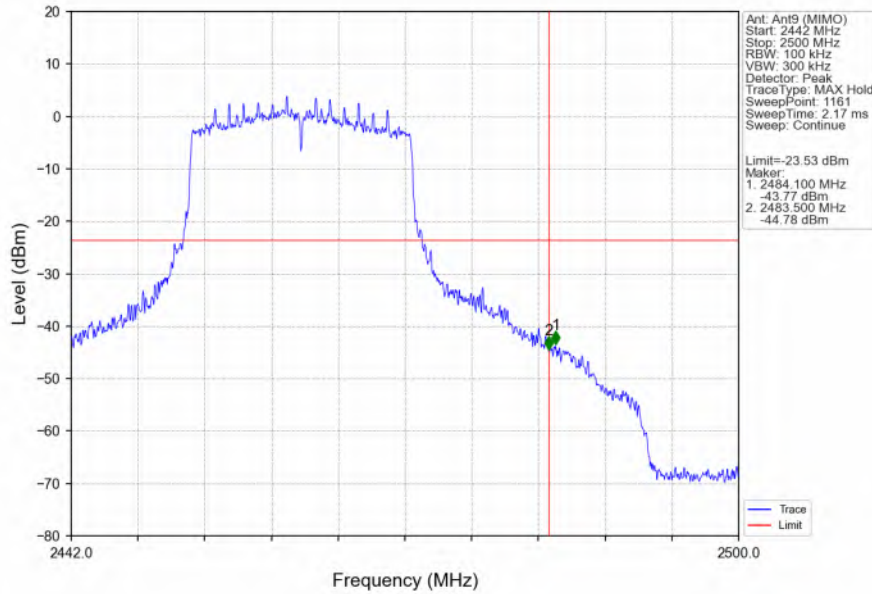


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant9 (MIMO)_NTNV

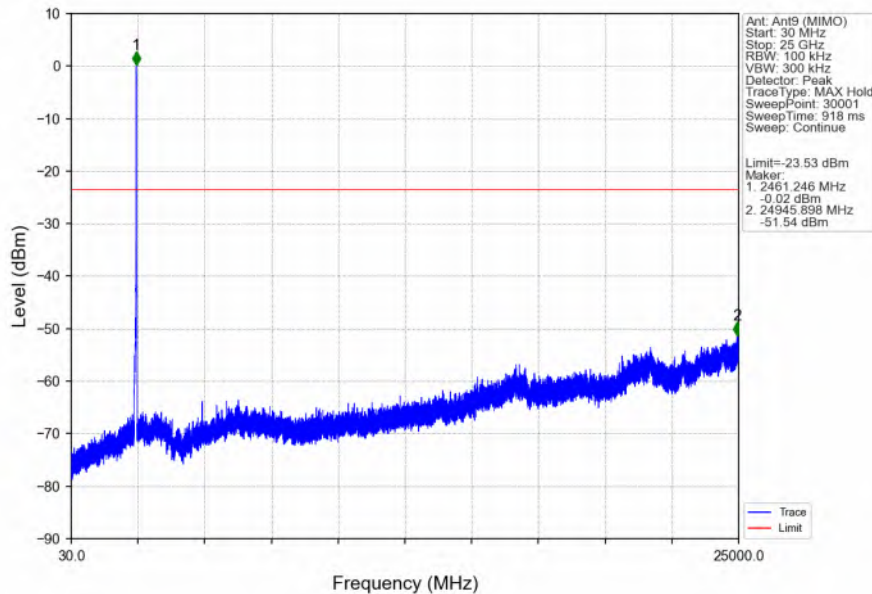


802.11ax(HEW40)_LCH_2422MHz_RU242_Left_Ant8 (MIMO)_NTNV

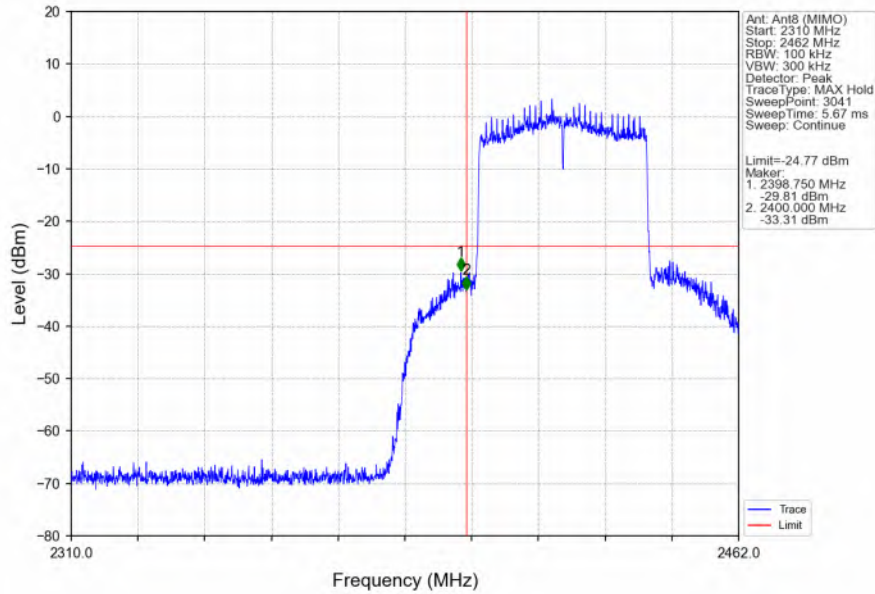


802.11ax(HEW40)_LCH_2422MHz_RU242_Left_Ant8 (MIMO)_NTNV

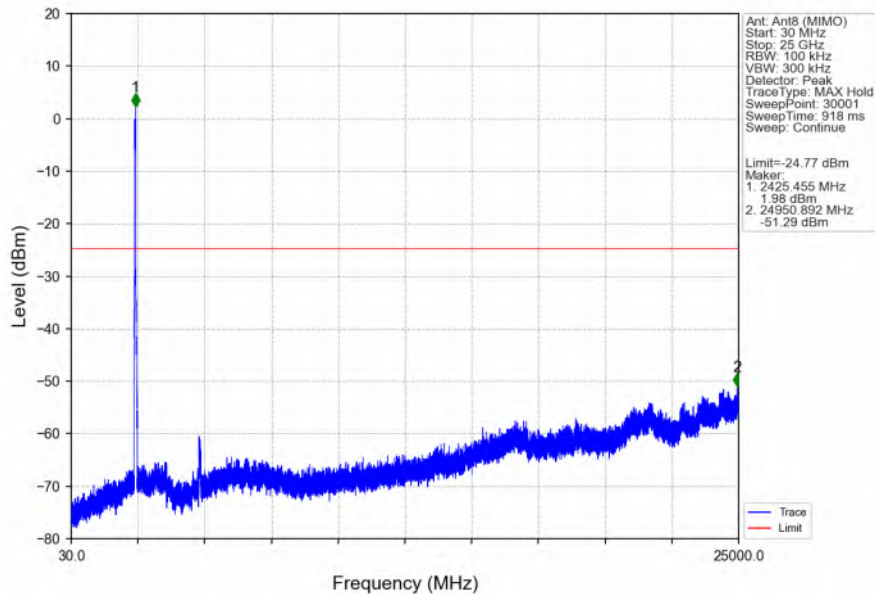


802.11ax(HEW40)_LCH_2422MHz_RU242_Left_Ant9 (MIMO)_NTNV

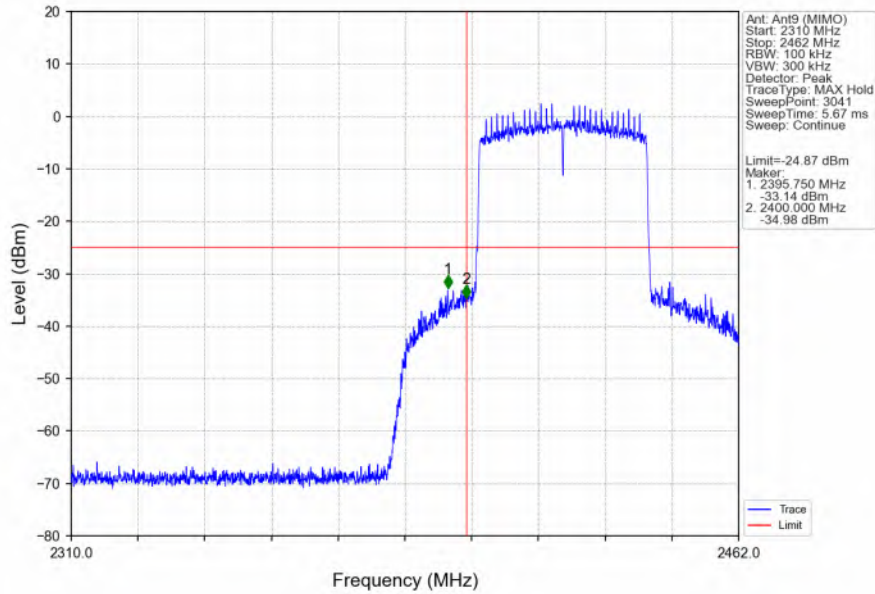


802.11ax(HEW40)_LCH_2422MHz_RU242_Left_Ant9 (MIMO)_NTNV

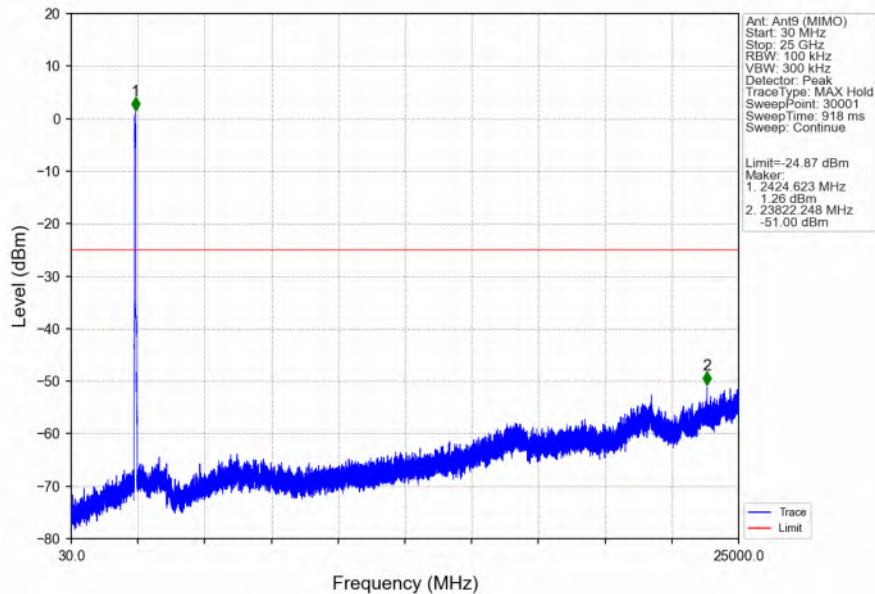


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant8 (MIMO)_NTNV

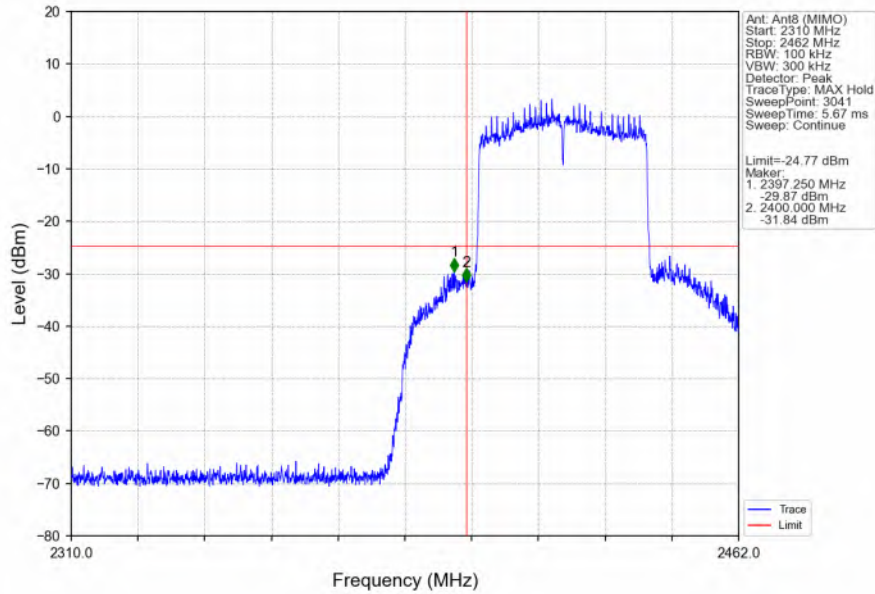


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant8 (MIMO)_NTNV

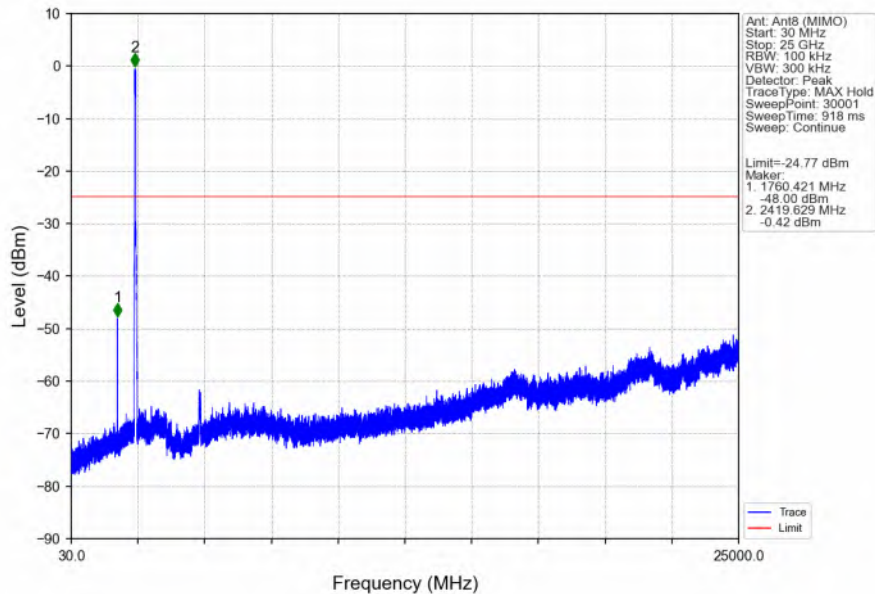


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant9 (MIMO)_NTNV

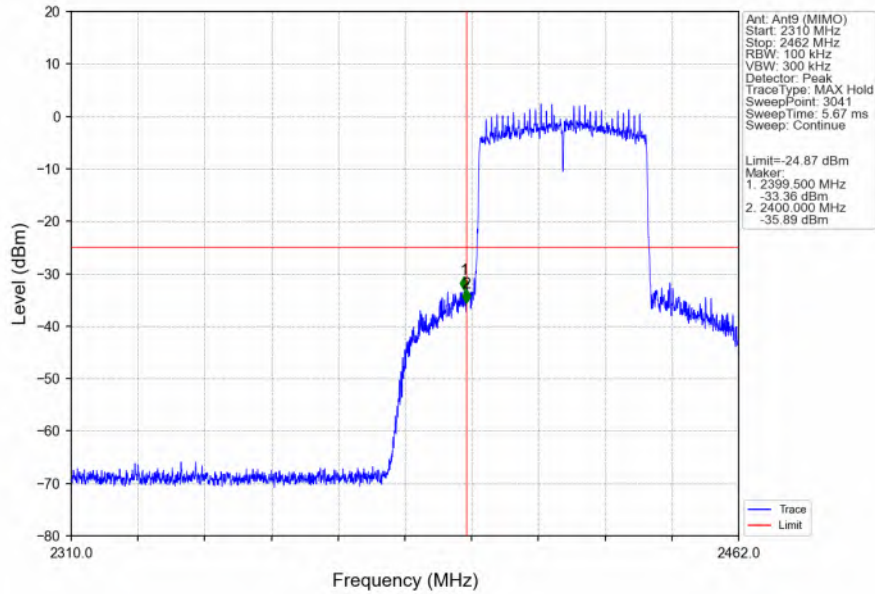


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant9 (MIMO)_NTNV

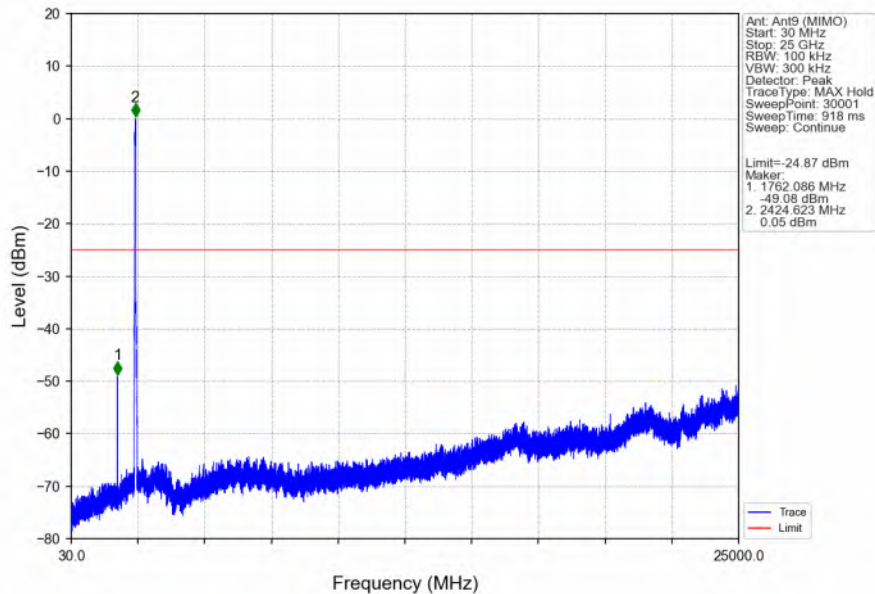


802.11ax(HEW40)_MCH_2437MHz_RU242_Left_Ant8 (MIMO)_NTNV

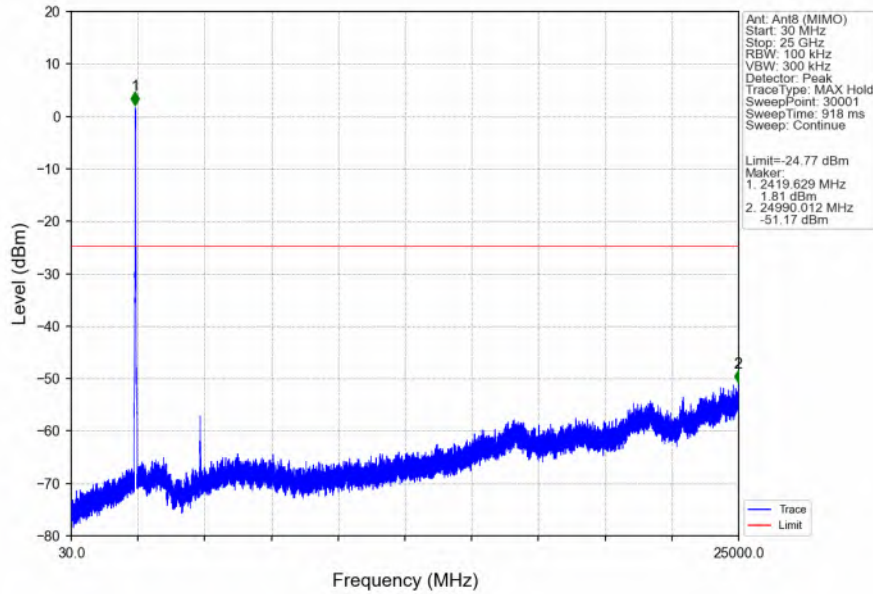


802.11ax(HEW40)_MCH_2437MHz_RU242_Left_Ant9 (MIMO)_NTNV

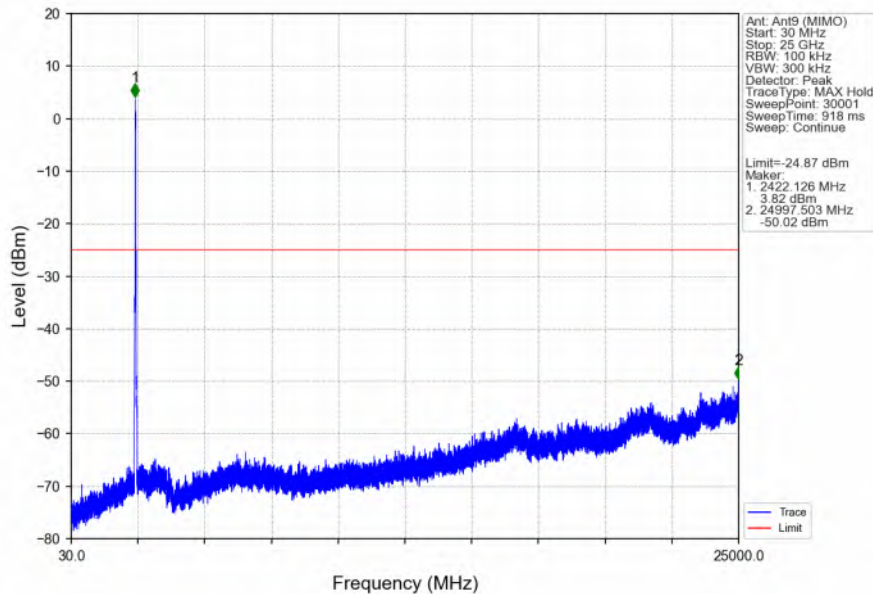


802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant8 (MIMO)_NTNV

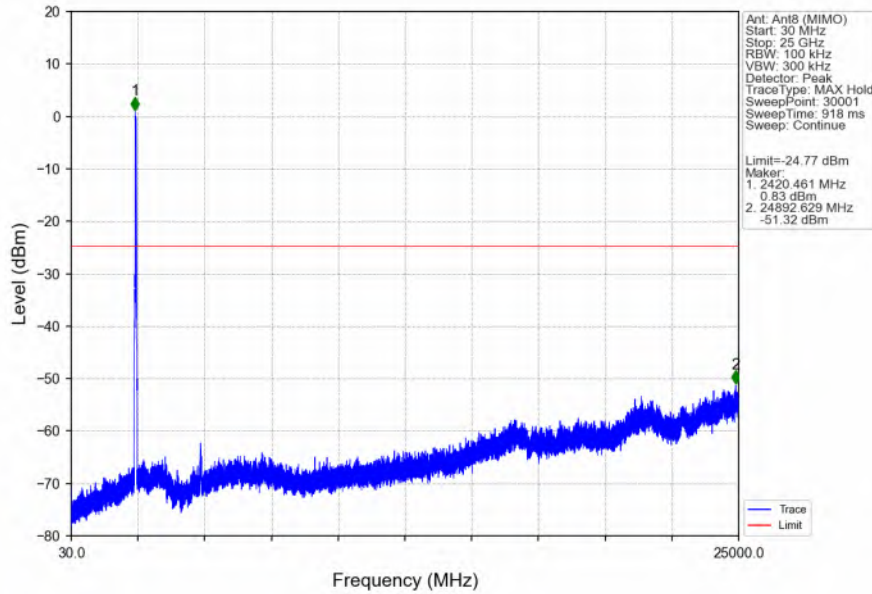


802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant9 (MIMO)_NTNV

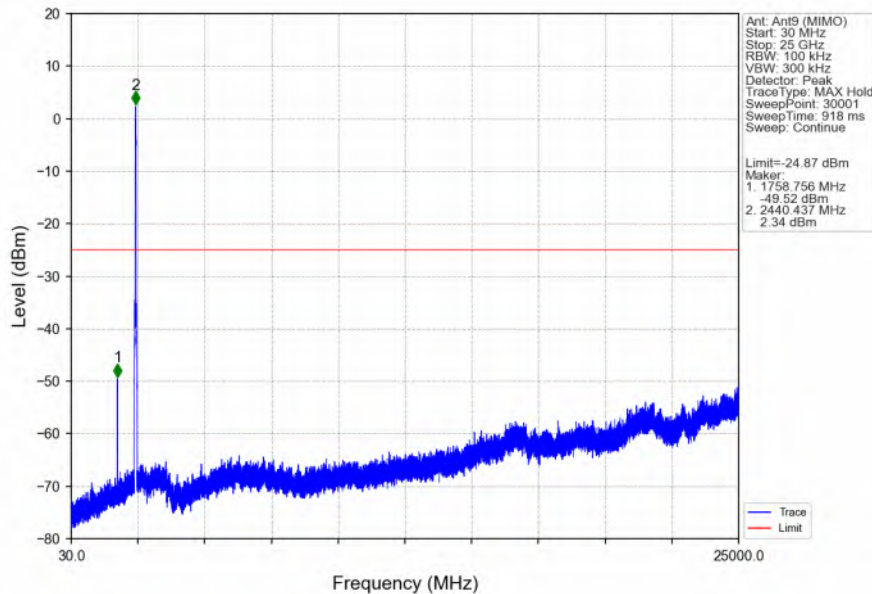


802.11ax(HEW40)_HCH_2452MHz_RU242_Right_Ant8 (MIMO)_NTNV

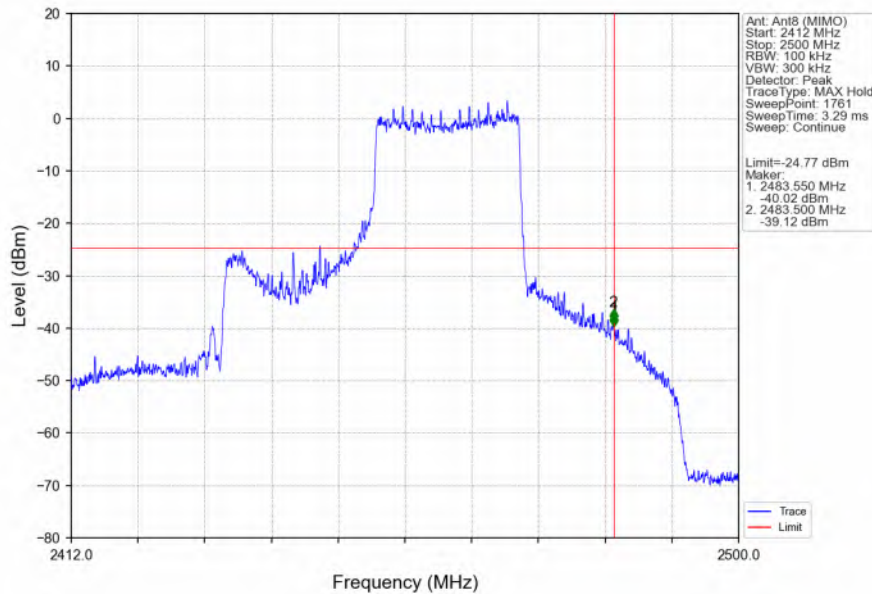


802.11ax(HEW40)_HCH_2452MHz_RU242_Right_Ant8 (MIMO)_NTNV

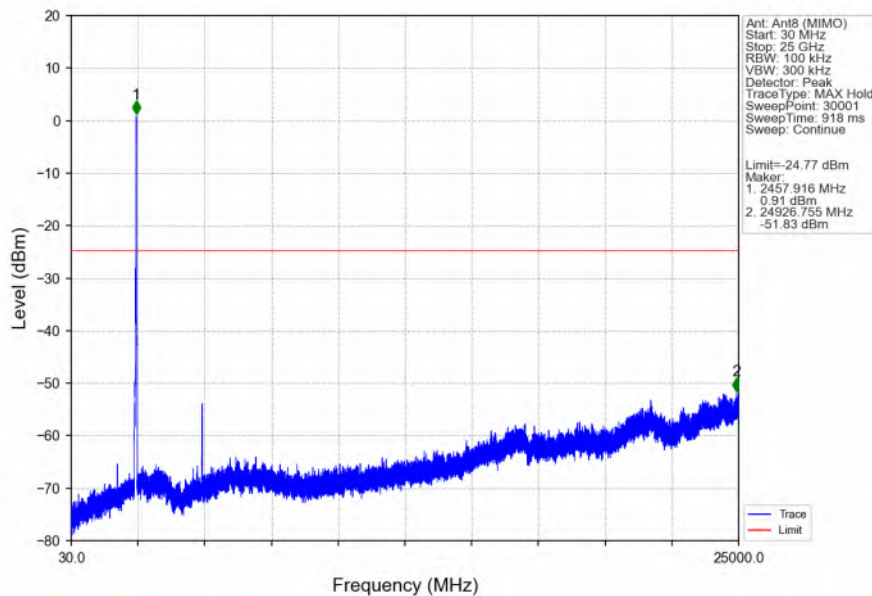


802.11ax(HEW40)_HCH_2452MHz_RU242_Right_Ant9 (MIMO)_NTNV

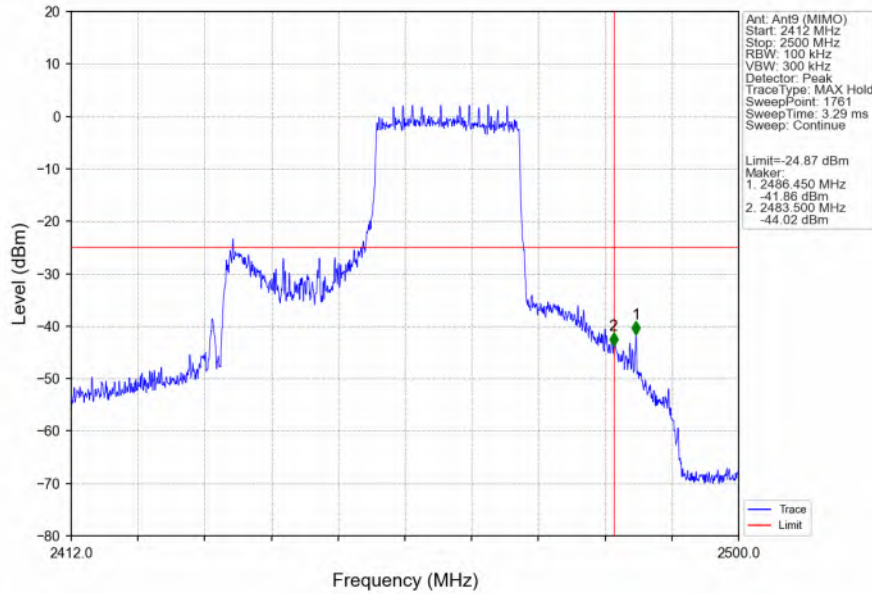


802.11ax(HEW40)_HCH_2452MHz_RU242_Right_Ant9 (MIMO)_NTNV

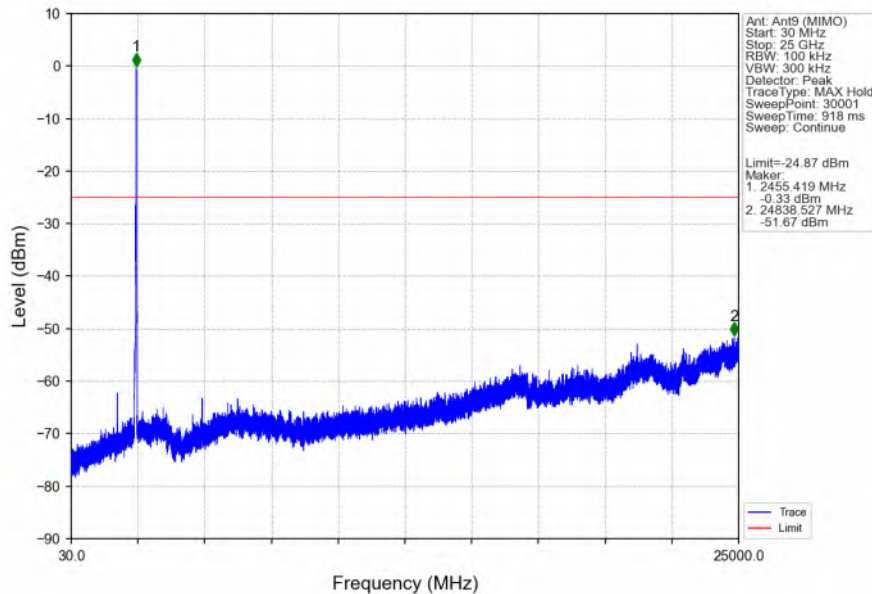


802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant8 (MIMO)_NTNV

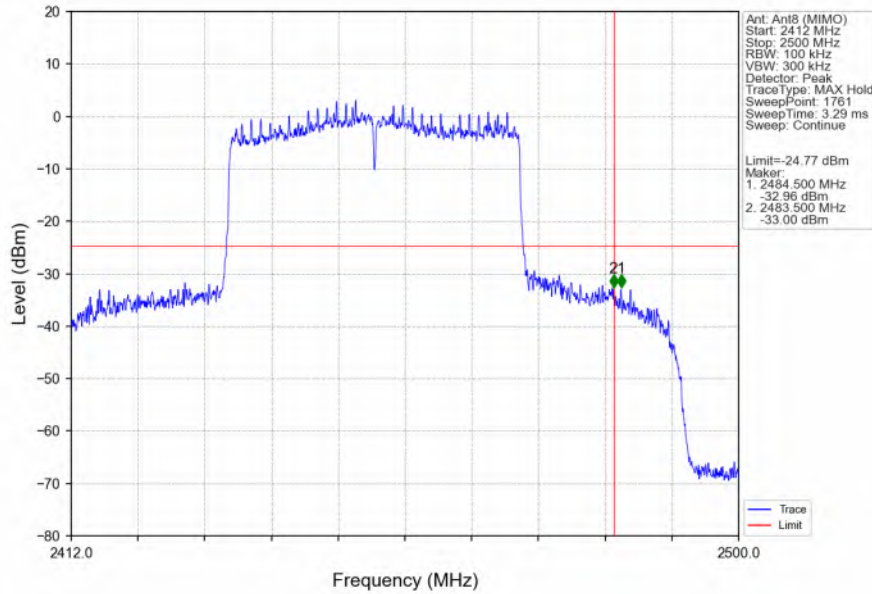


802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant8 (MIMO)_NTNV

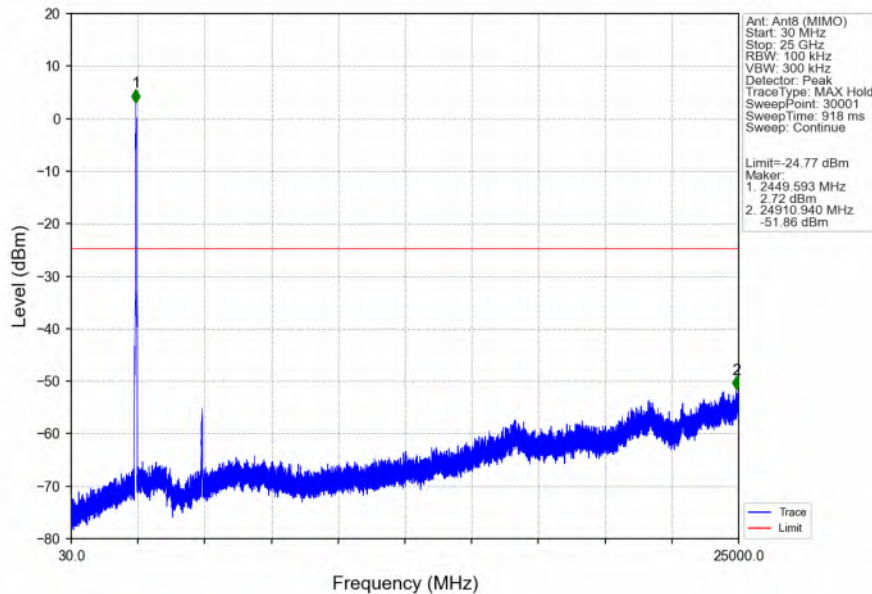

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant9 (MIMO)_NTNV

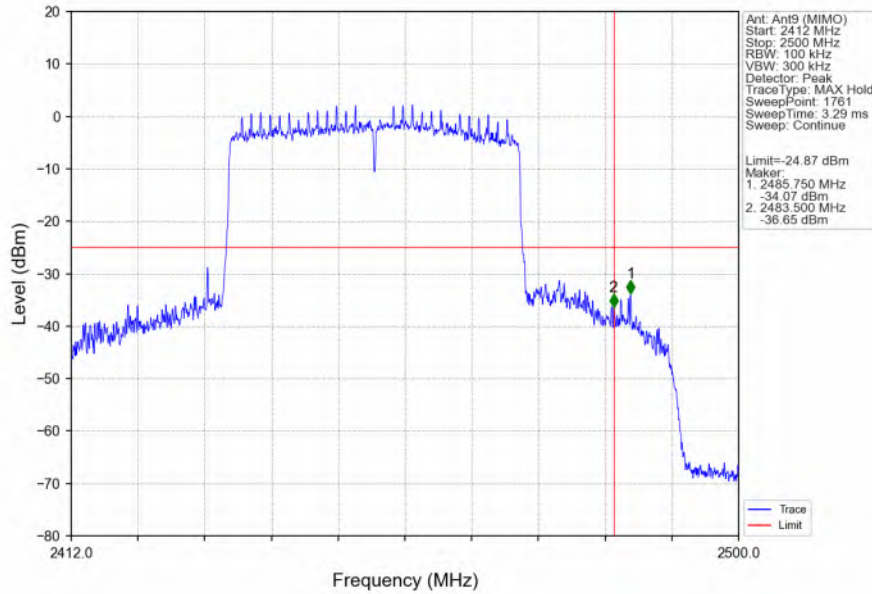

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant9 (MIMO)_NTNV

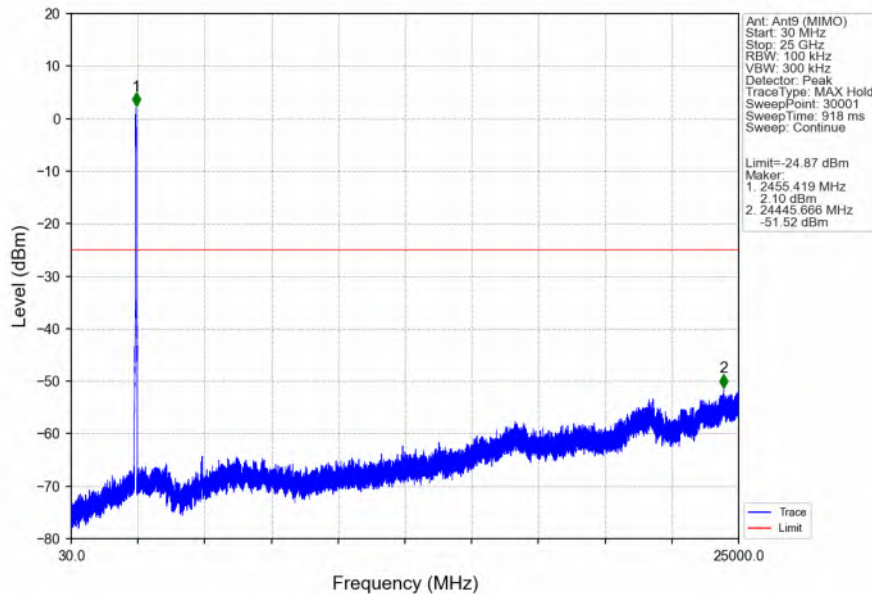

- End of the Report -