

Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.885	101	0.291	≤0.4	PASS
2DH5	Ant1	Hop	2.891	97	0.28	≤0.4	PASS
3DH5	Ant1	Hop	2.893	97	0.281	≤0.4	PASS


Test Graphs

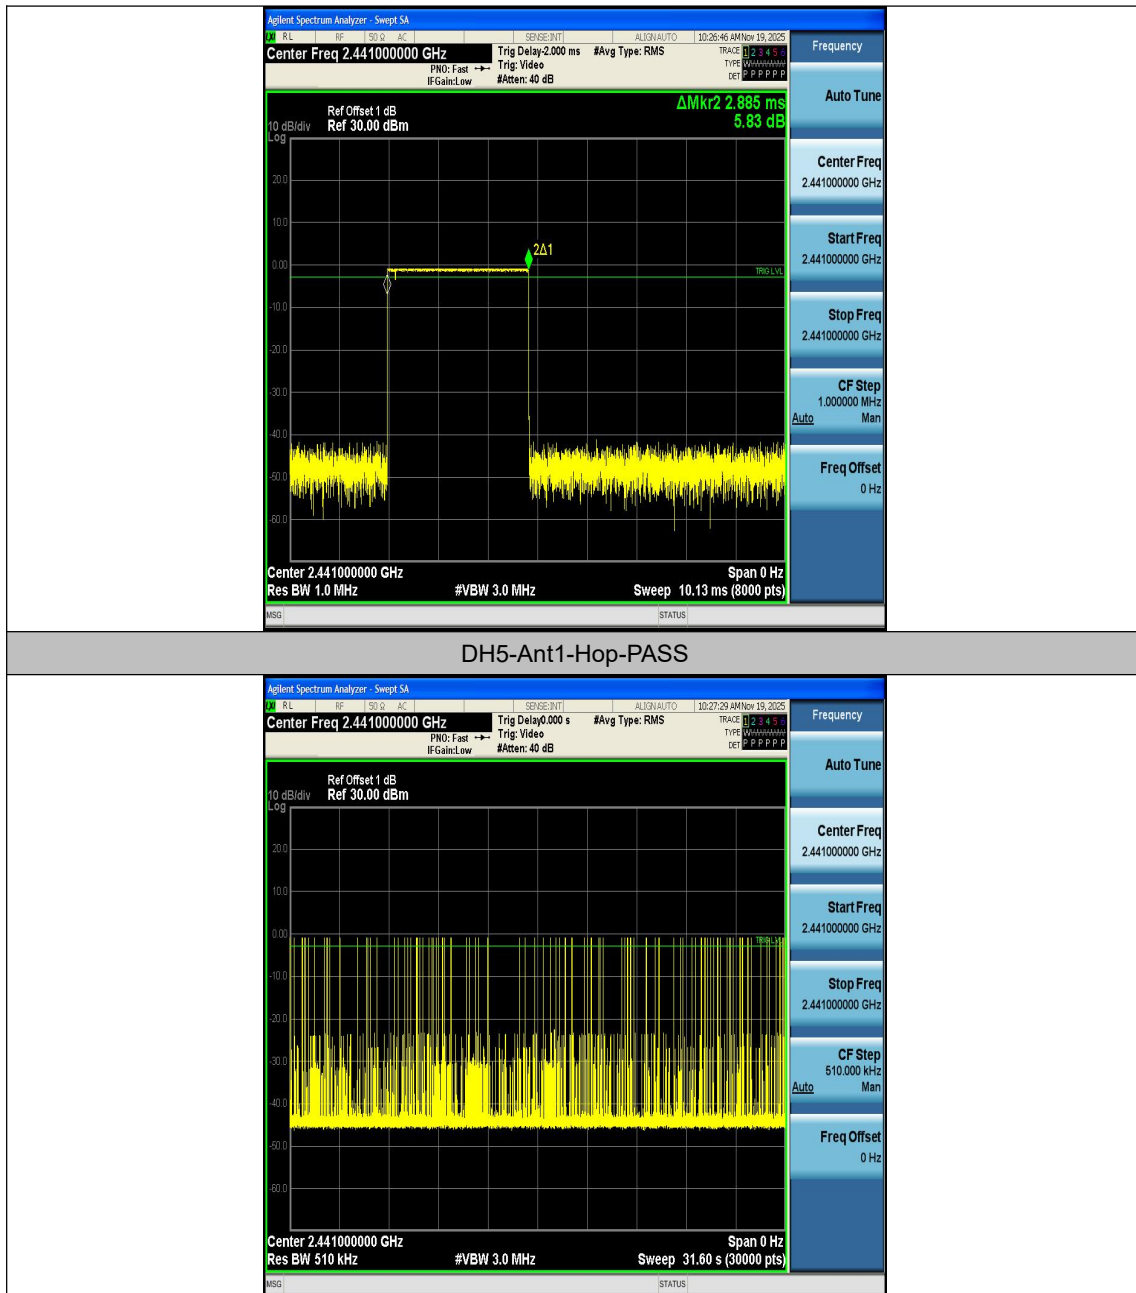

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

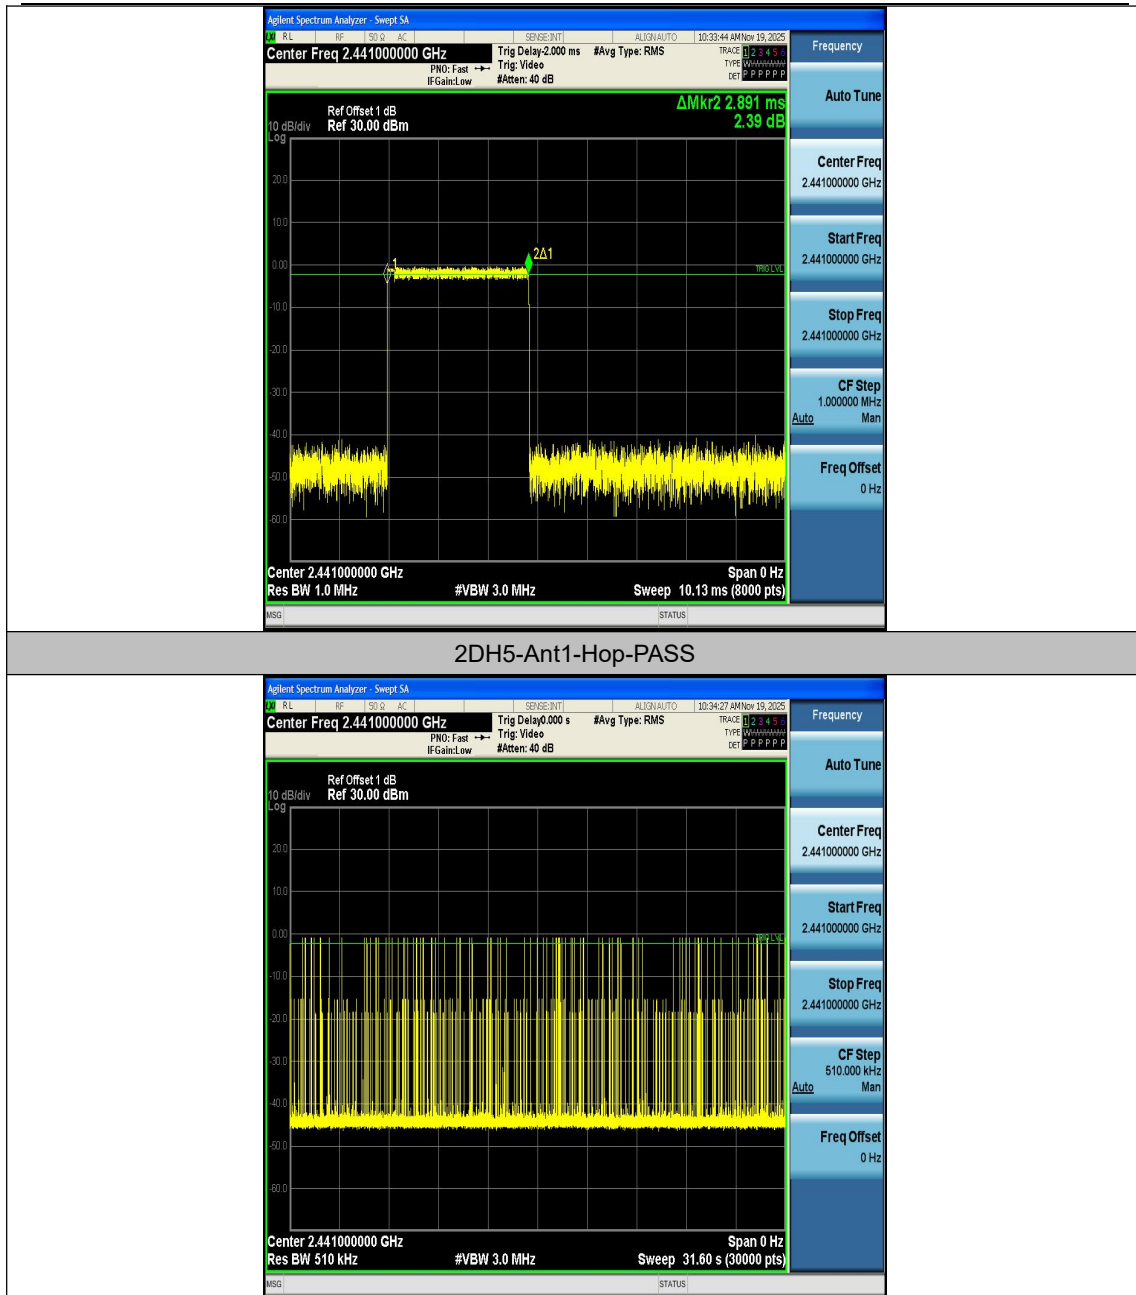

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

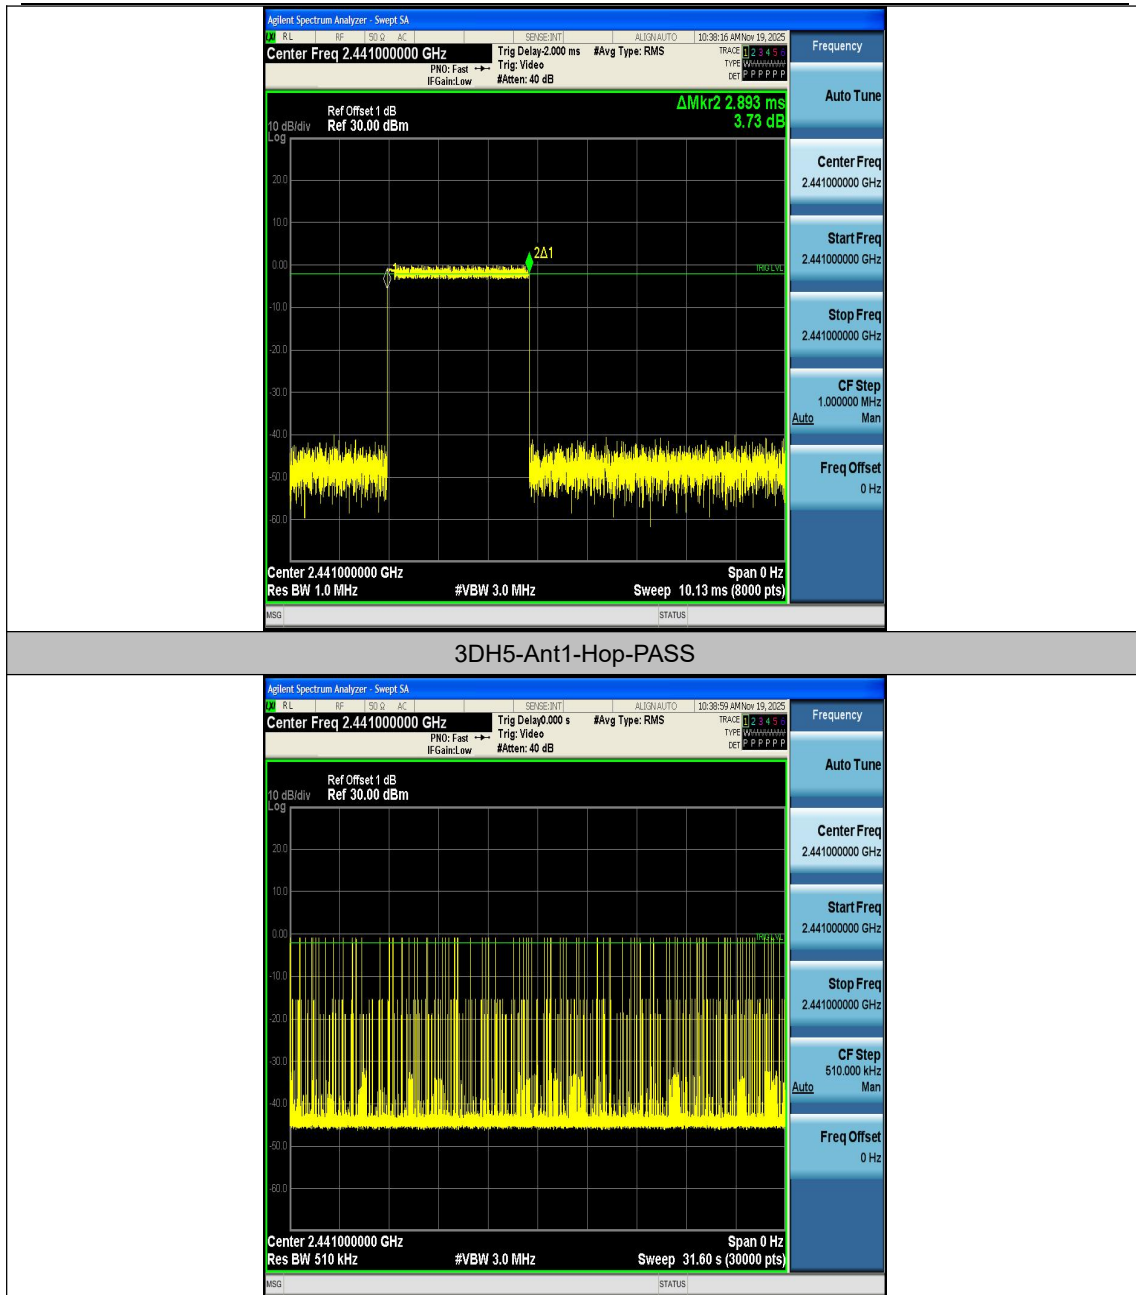

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS


Test Graphs

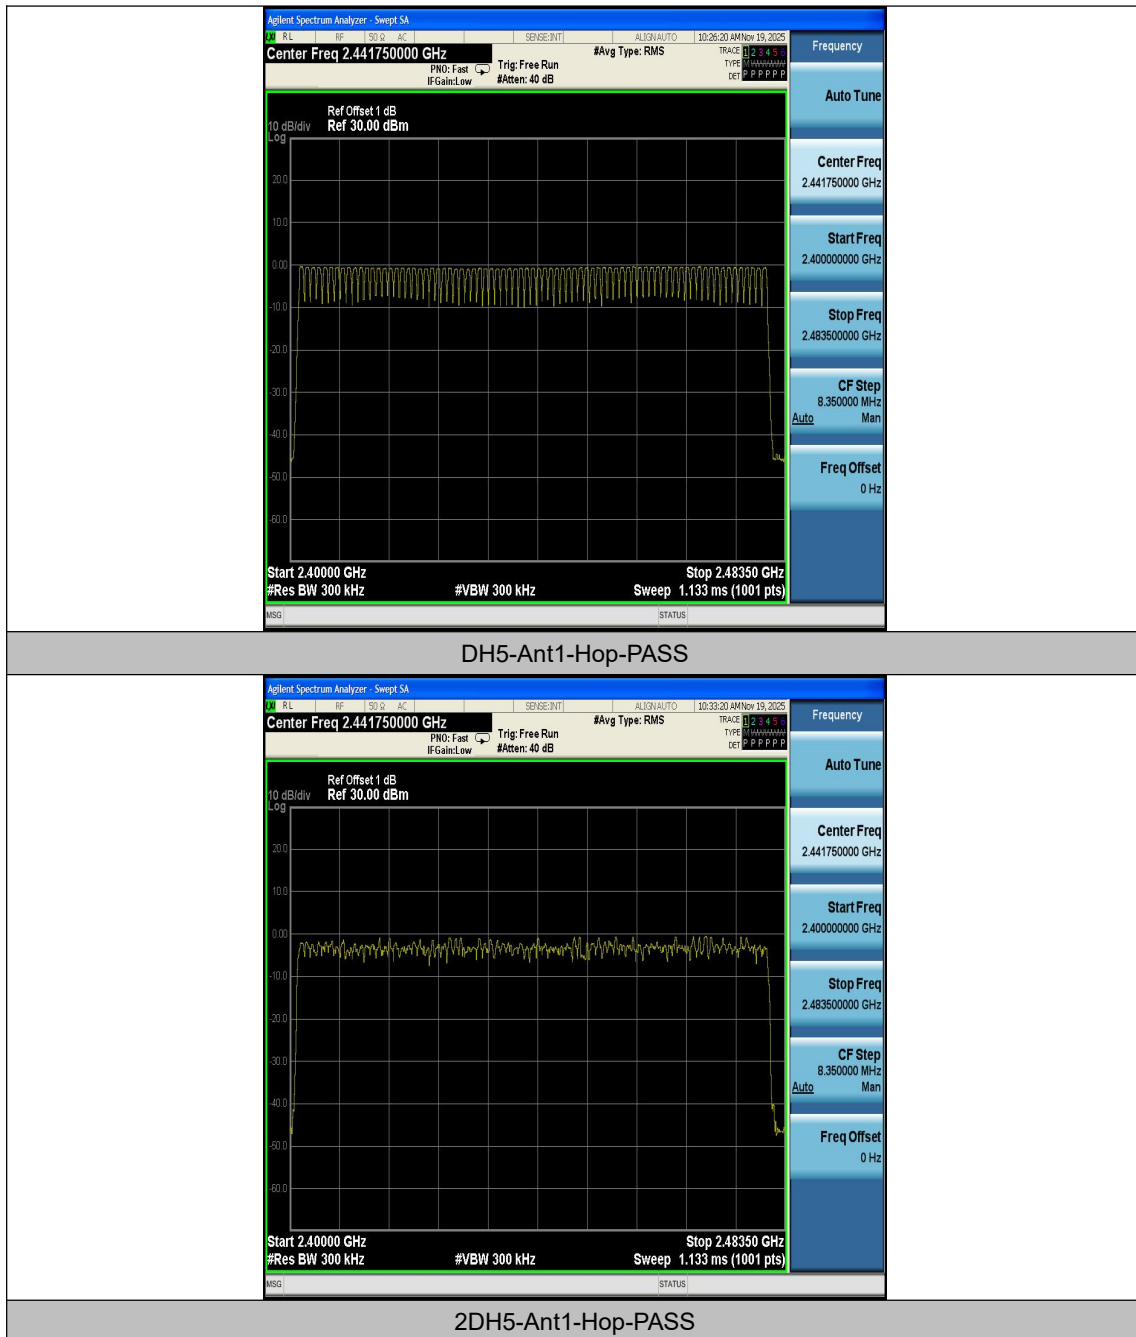

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

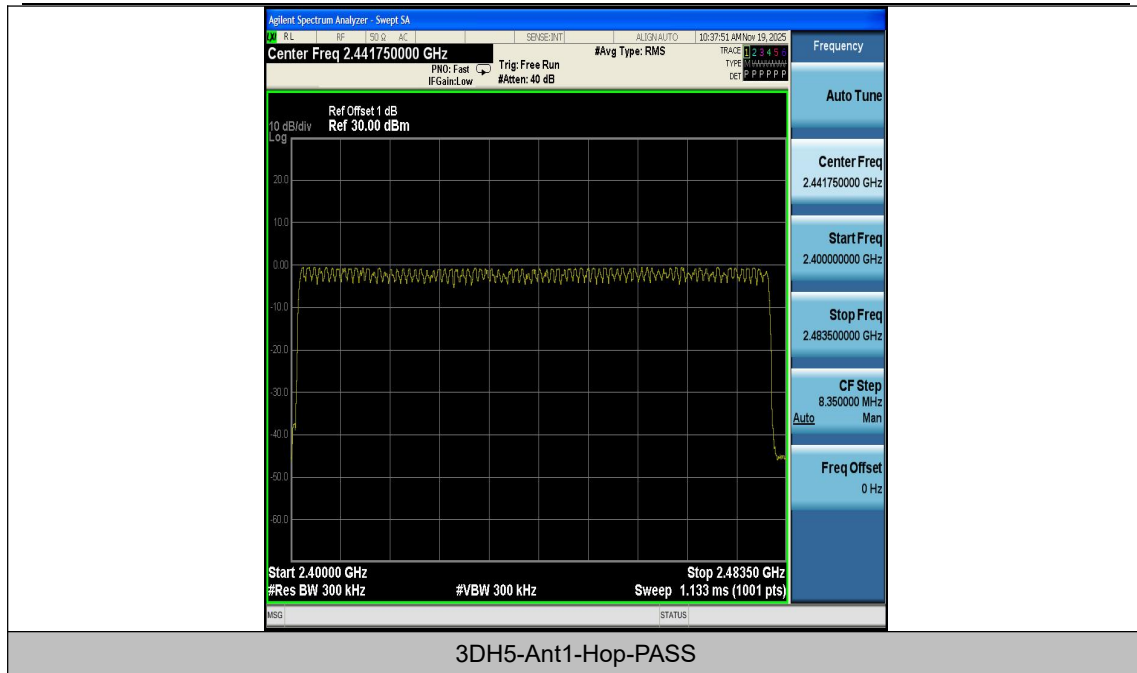

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	-0.67	-53.07	≤-20.67	PASS
DH5	Ant1	High	2480	-0.89	-56.31	≤-20.89	PASS
DH5	Ant1	Low	Hop_2402	-1.06	-57.1	≤-21.06	PASS
DH5	Ant1	High	Hop_2480	-0.92	-56.36	≤-20.92	PASS
2DH5	Ant1	Low	2402	-1.78	-53.2	≤-21.78	PASS
2DH5	Ant1	High	2480	-0.86	-52.45	≤-20.86	PASS
2DH5	Ant1	Low	Hop_2402	-2.46	-57.48	≤-22.46	PASS
2DH5	Ant1	High	Hop_2480	-1.10	-56.62	≤-21.1	PASS
3DH5	Ant1	Low	2402	-0.99	-49.81	≤-20.99	PASS
3DH5	Ant1	High	2480	-0.91	-57.46	≤-20.91	PASS
3DH5	Ant1	Low	Hop_2402	-1.14	-56.86	≤-21.14	PASS
3DH5	Ant1	High	Hop_2480	-3.64	-43.25	≤-23.64	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'offset' of the Spectrum Analyzer during the test.


Test Graphs

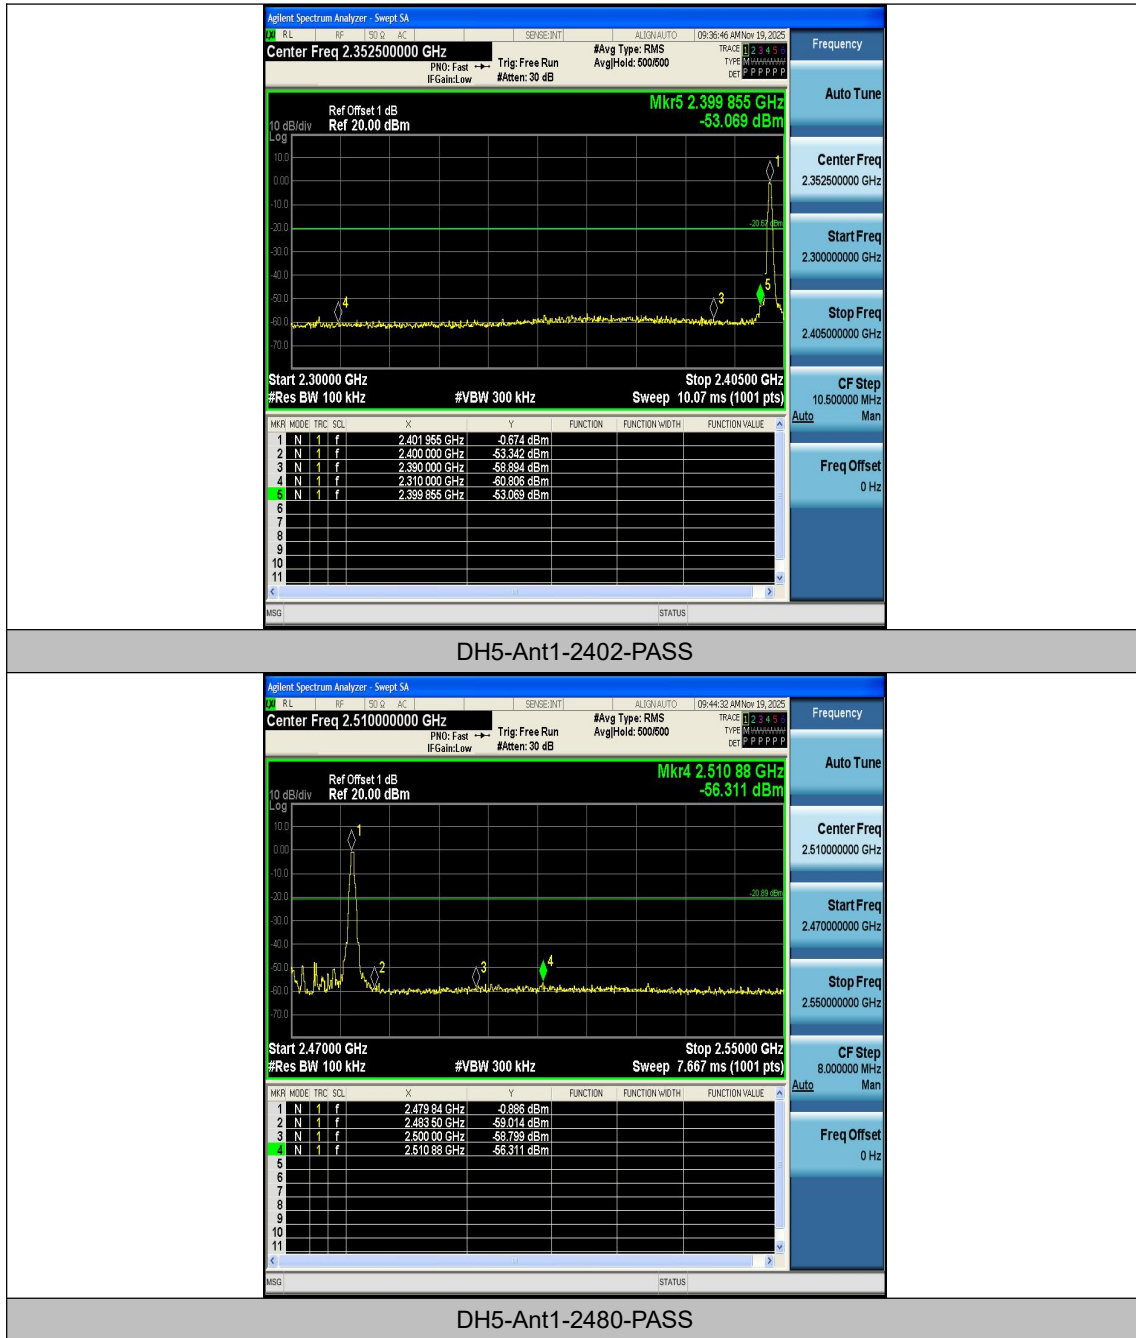


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

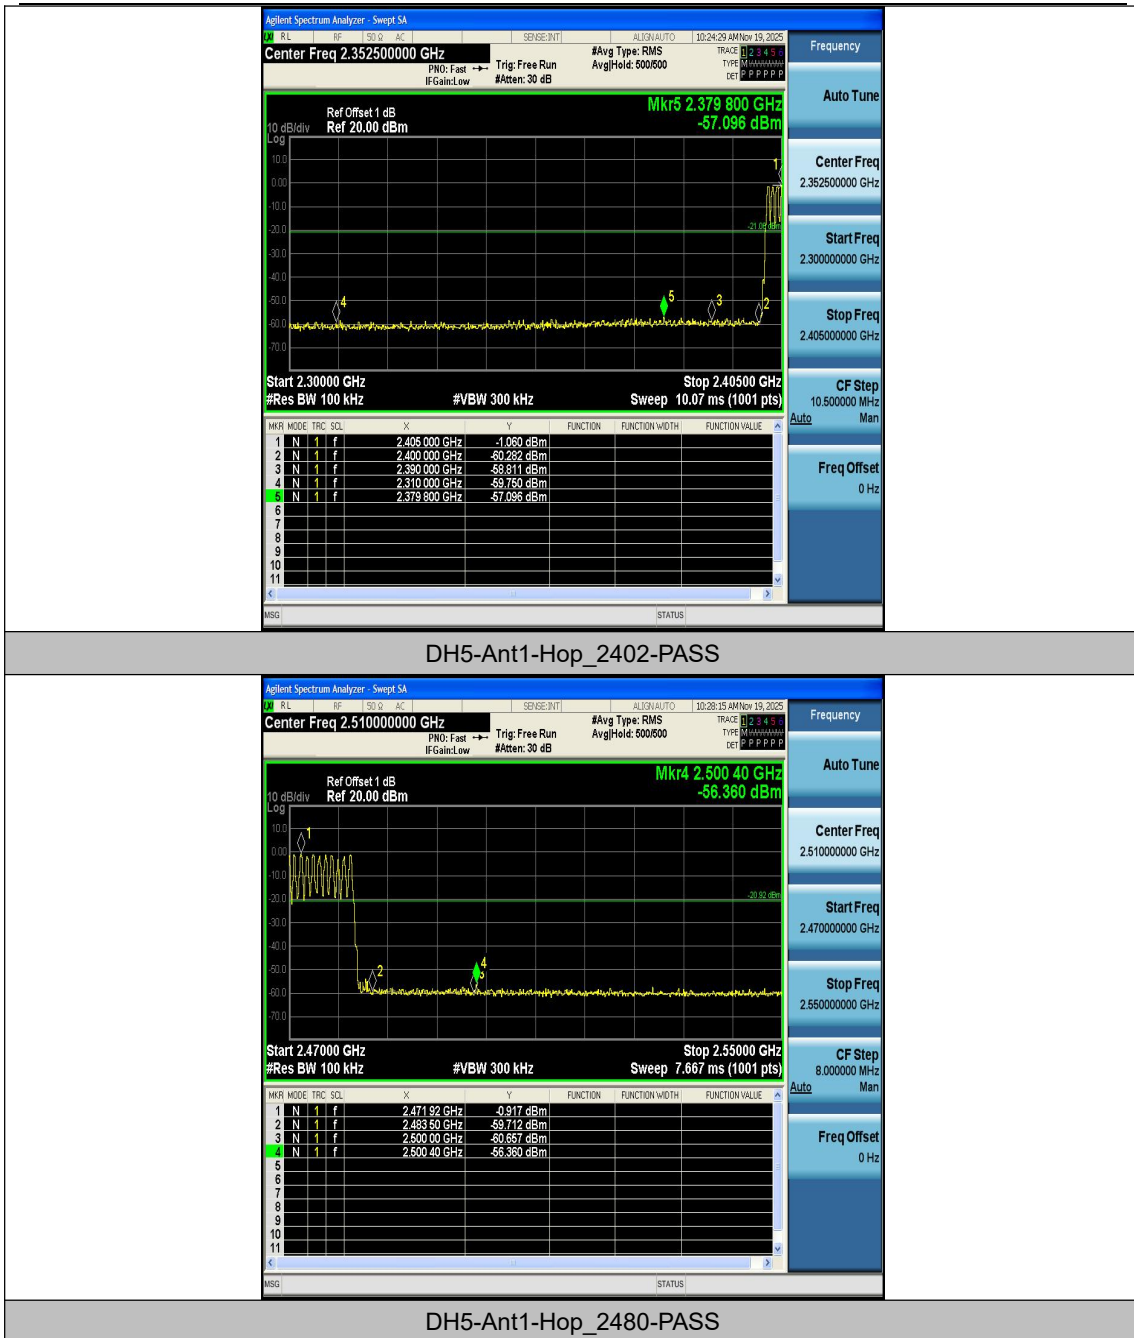


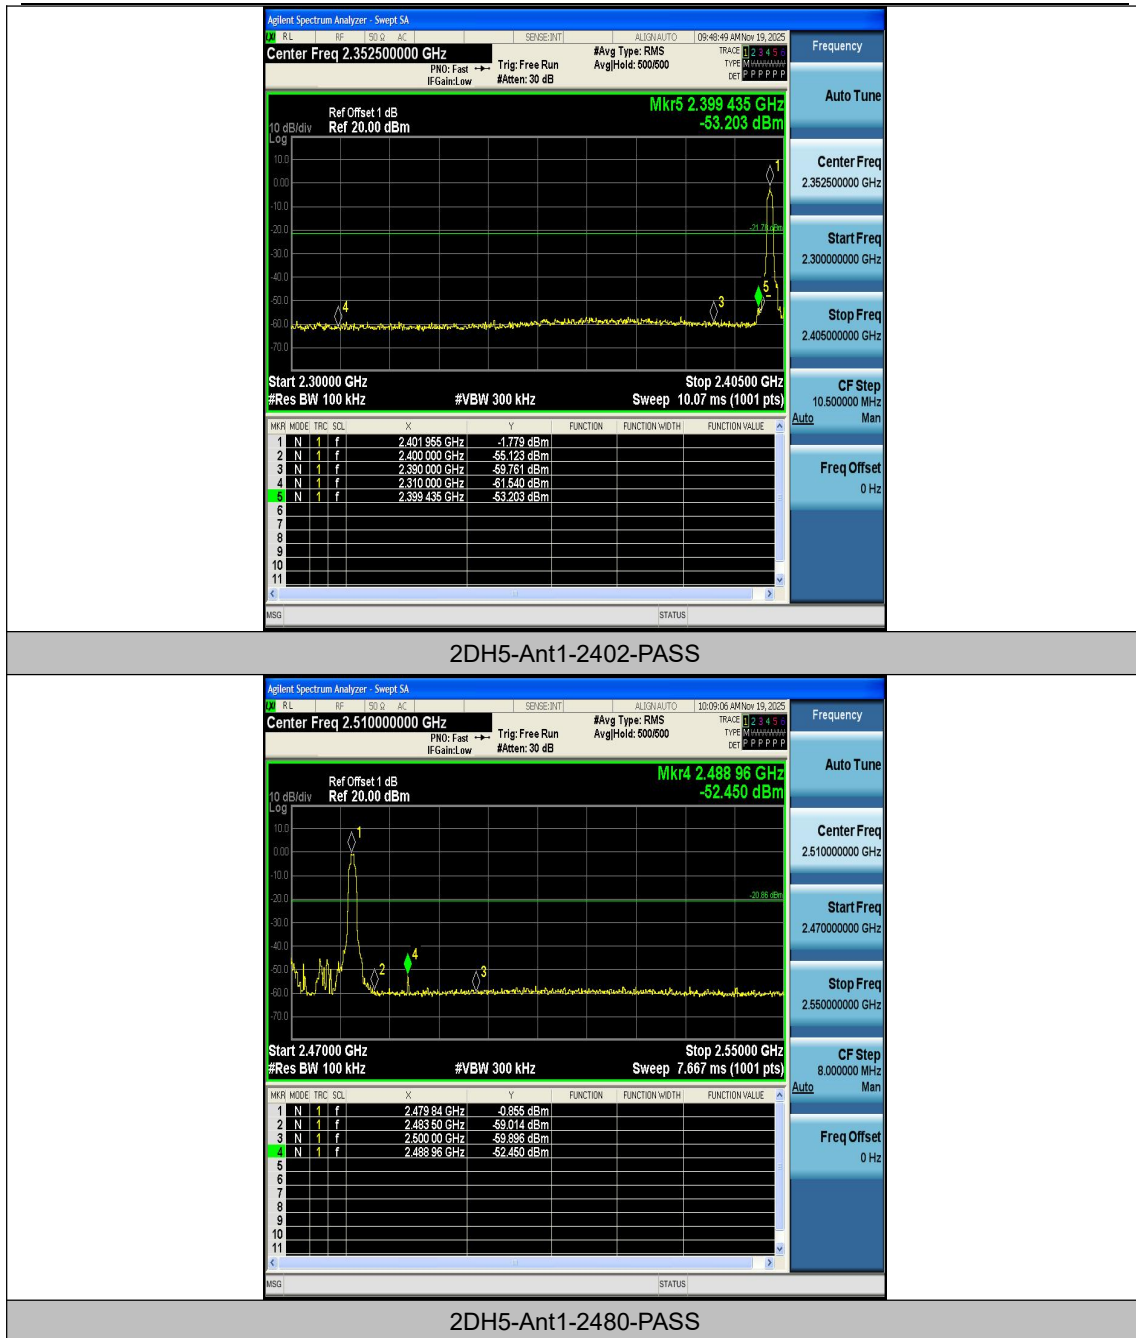

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

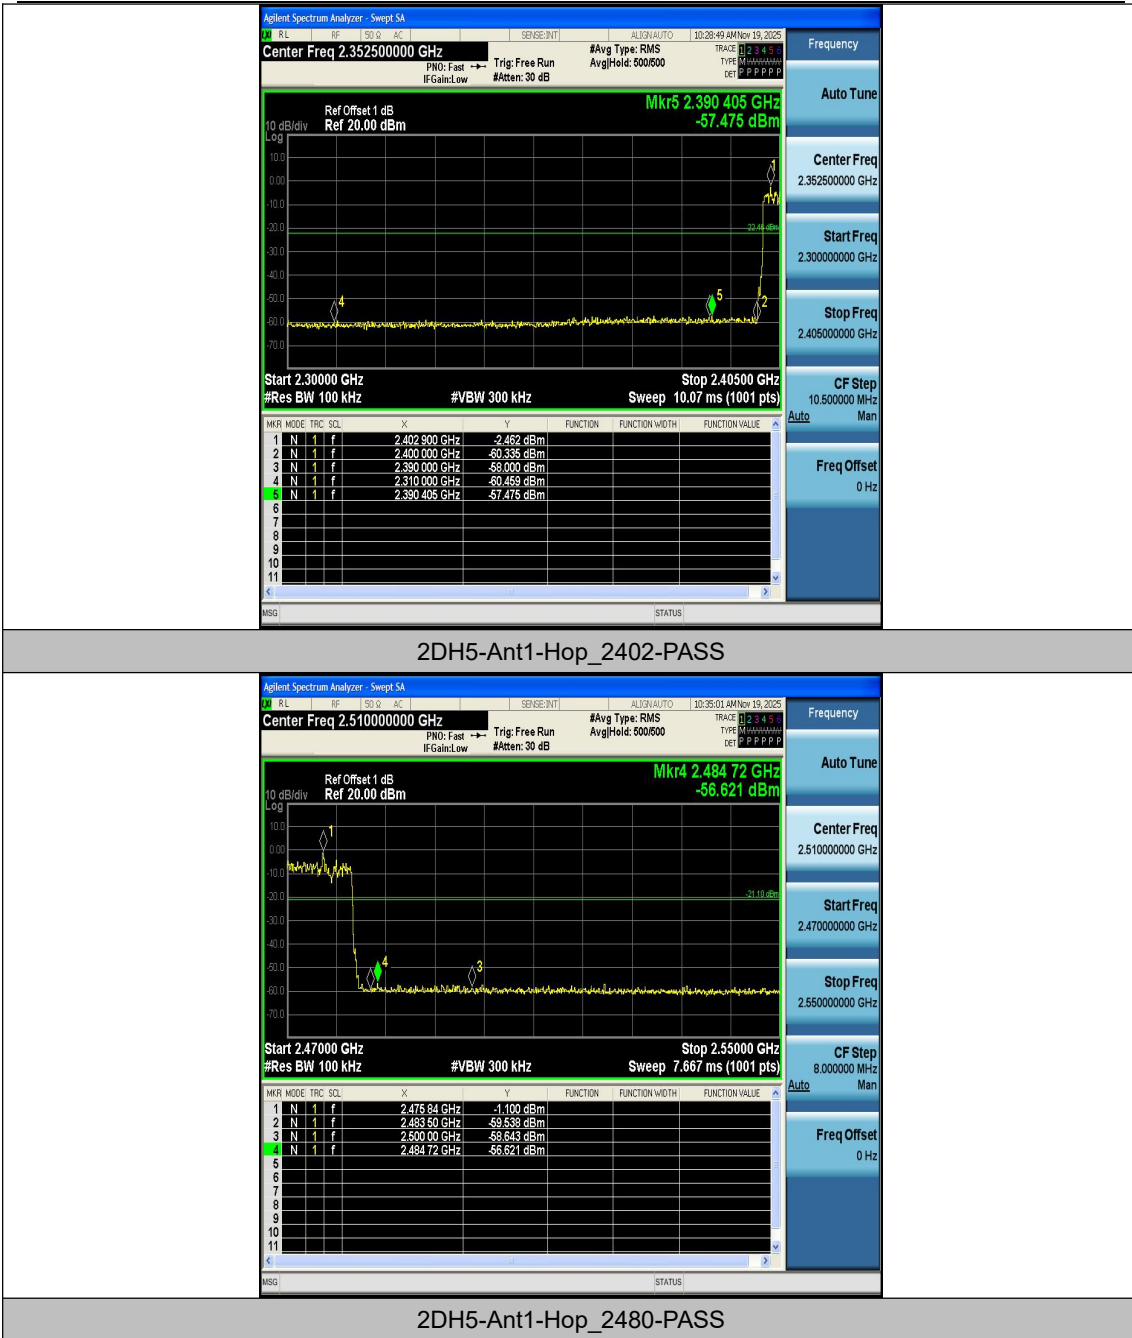

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

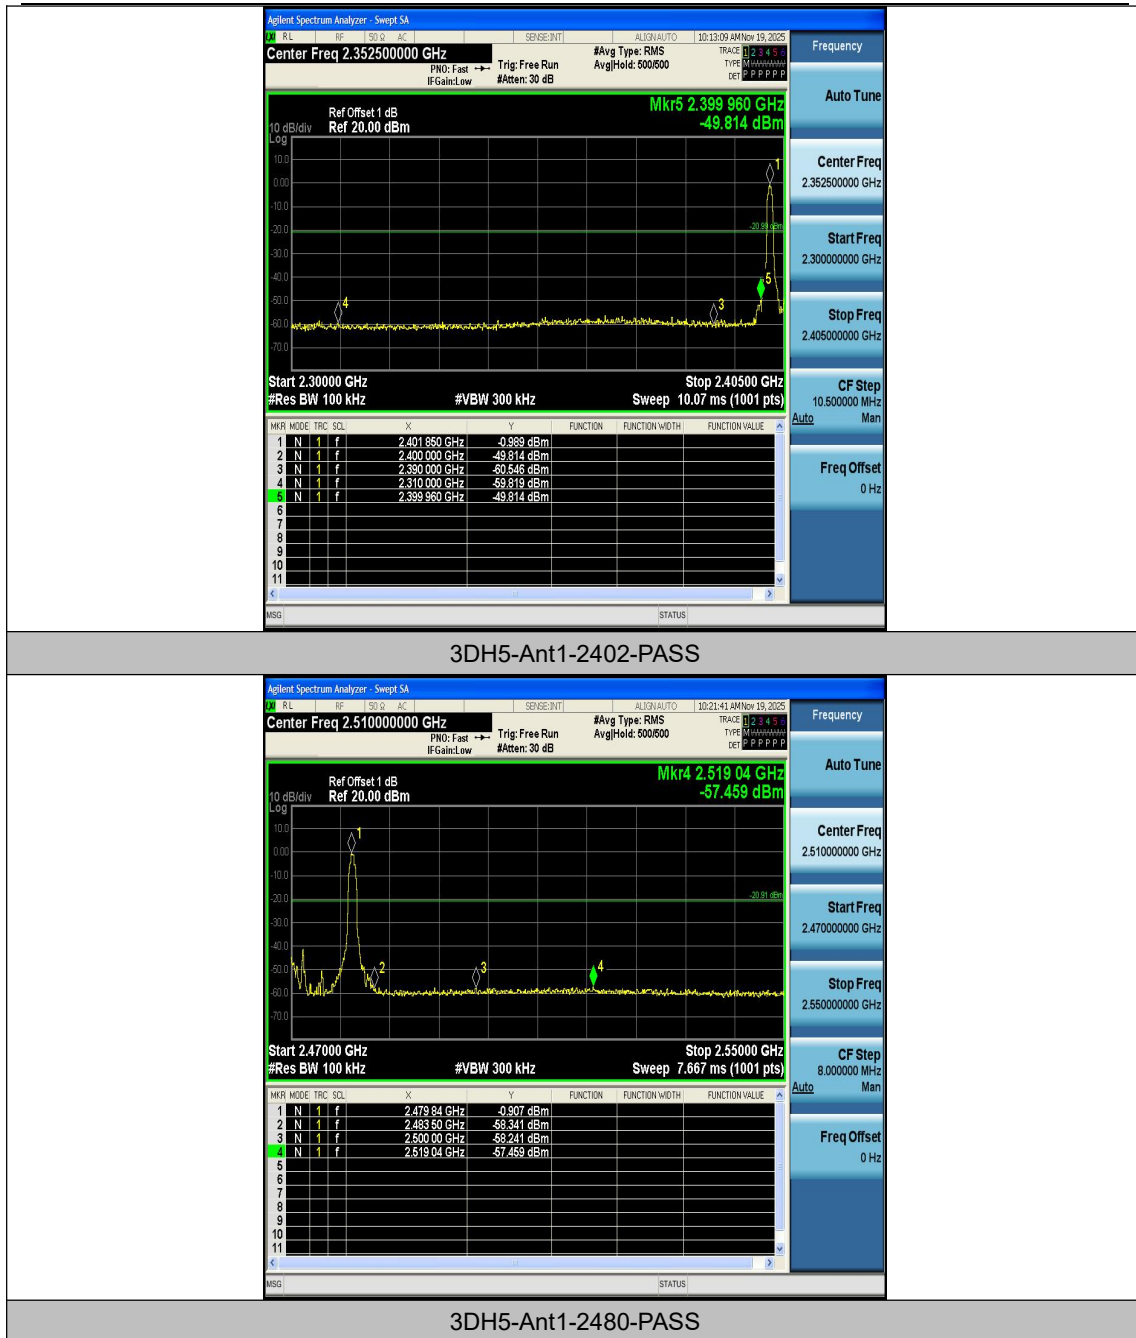

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

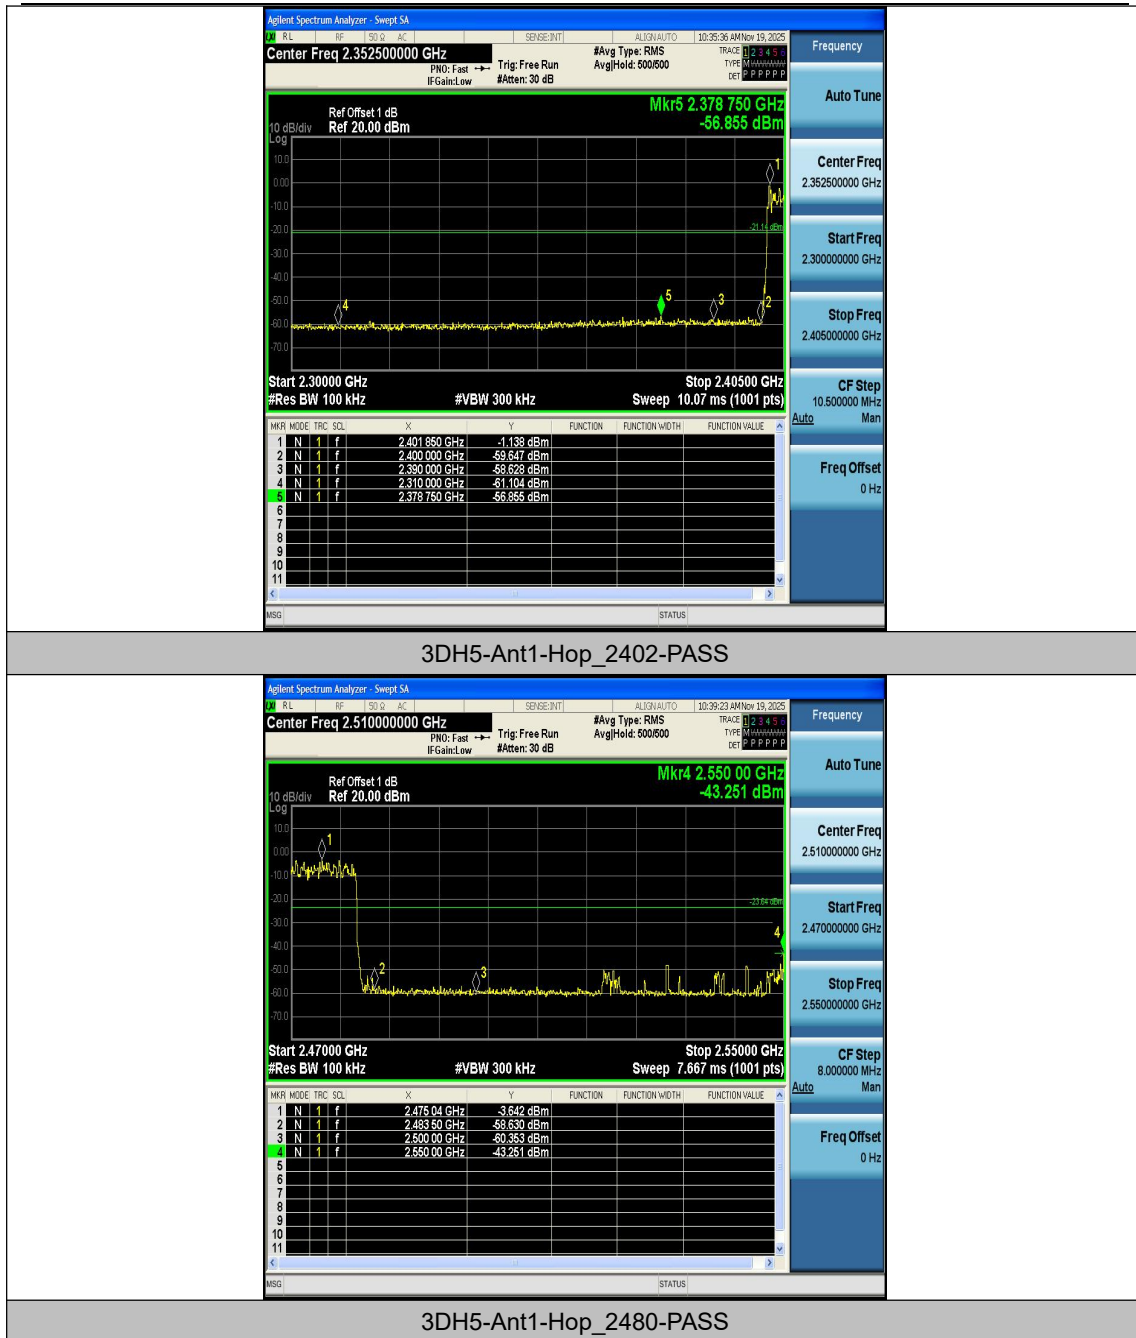

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	-1.33	-1.33	---	PASS
DH5	Ant1	2402	30~1000	-1.33	-59.85	≤-21.33	PASS
DH5	Ant1	2402	1000~26500	-1.33	-44.47	≤-21.33	PASS
DH5	Ant1	2441	0~Reference	-1.54	-1.54	---	PASS
DH5	Ant1	2441	30~1000	-1.54	-59.92	≤-21.54	PASS
DH5	Ant1	2441	1000~26500	-1.54	-41.55	≤-21.54	PASS
DH5	Ant1	2480	0~Reference	-1.54	-1.54	---	PASS
DH5	Ant1	2480	30~1000	-1.54	-59.87	≤-21.54	PASS
DH5	Ant1	2480	1000~26500	-1.54	-45.39	≤-21.54	PASS
2DH5	Ant1	2402	0~Reference	-1.43	-1.43	---	PASS
2DH5	Ant1	2402	30~1000	-1.43	-59.73	≤-21.43	PASS
2DH5	Ant1	2402	1000~26500	-1.43	-45.33	≤-21.43	PASS
2DH5	Ant1	2441	0~Reference	-1.18	-1.18	---	PASS
2DH5	Ant1	2441	30~1000	-1.18	-59.7	≤-21.18	PASS
2DH5	Ant1	2441	1000~26500	-1.18	-45.23	≤-21.18	PASS
2DH5	Ant1	2480	0~Reference	-1.45	-1.45	---	PASS
2DH5	Ant1	2480	30~1000	-1.45	-59.36	≤-21.45	PASS
2DH5	Ant1	2480	1000~26500	-1.45	-45.31	≤-21.45	PASS
3DH5	Ant1	2402	0~Reference	-0.91	-0.91	---	PASS
3DH5	Ant1	2402	30~1000	-0.91	-58.69	≤-20.91	PASS
3DH5	Ant1	2402	1000~26500	-0.91	-39.11	≤-20.91	PASS
3DH5	Ant1	2441	0~Reference	-3.42	-3.42	---	PASS
3DH5	Ant1	2441	30~1000	-3.42	-60.01	≤-23.42	PASS
3DH5	Ant1	2441	1000~26500	-3.42	-45.42	≤-23.42	PASS
3DH5	Ant1	2480	0~Reference	-4.65	-4.65	---	PASS
3DH5	Ant1	2480	30~1000	-4.65	-60.19	≤-24.65	PASS
3DH5	Ant1	2480	1000~26500	-4.65	-45.91	≤-24.65	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.


Test Graphs

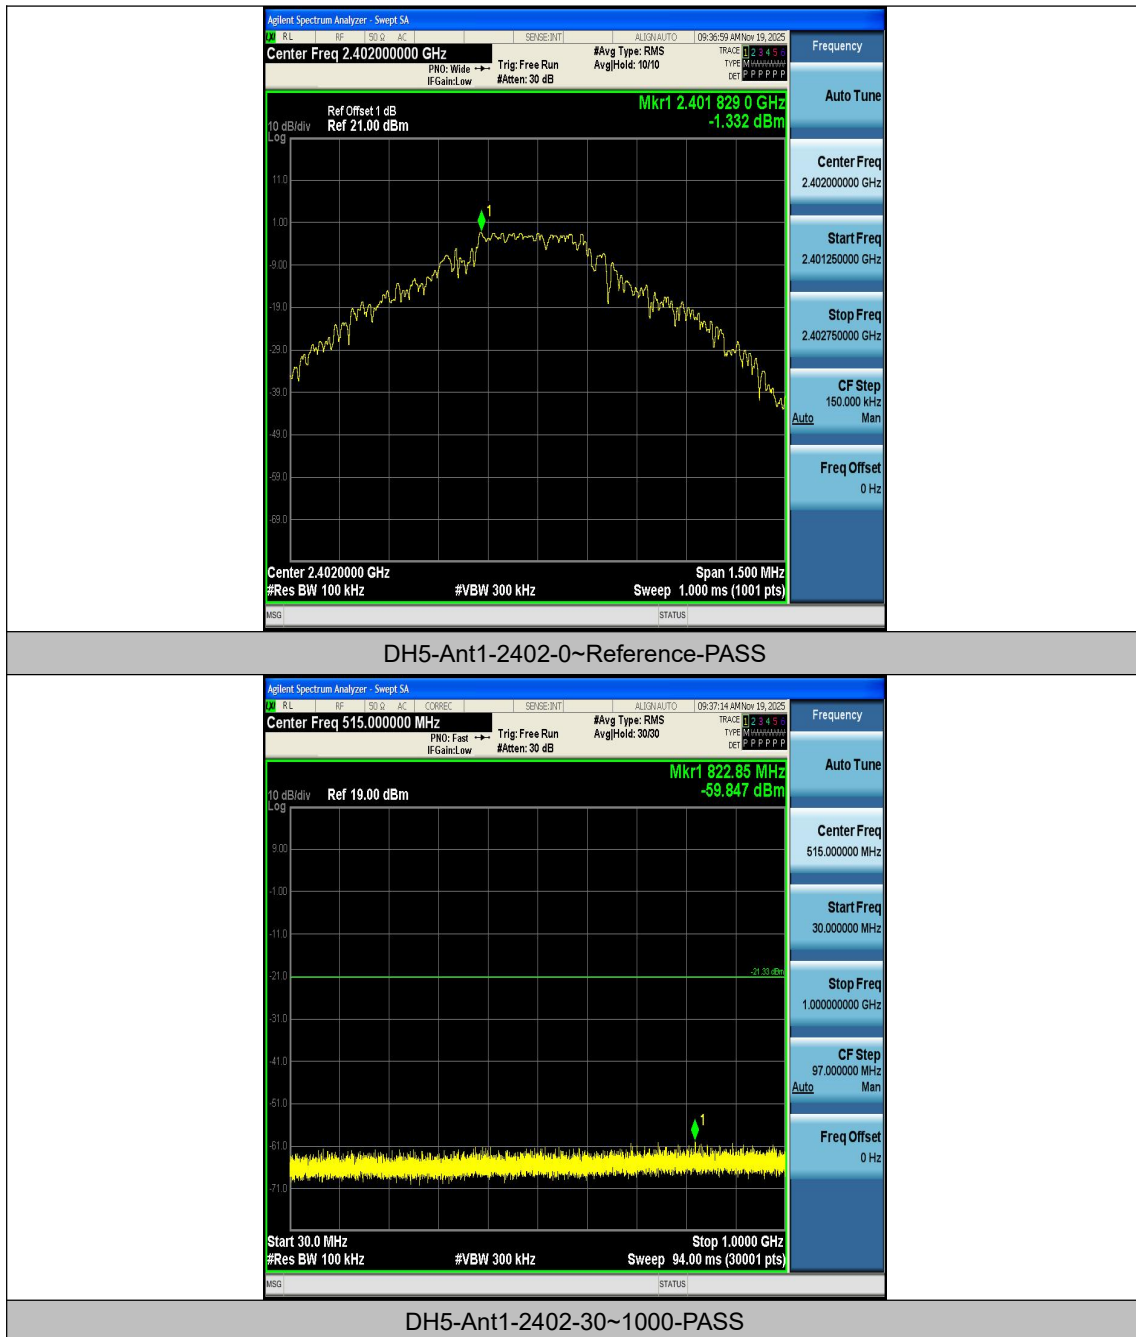

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

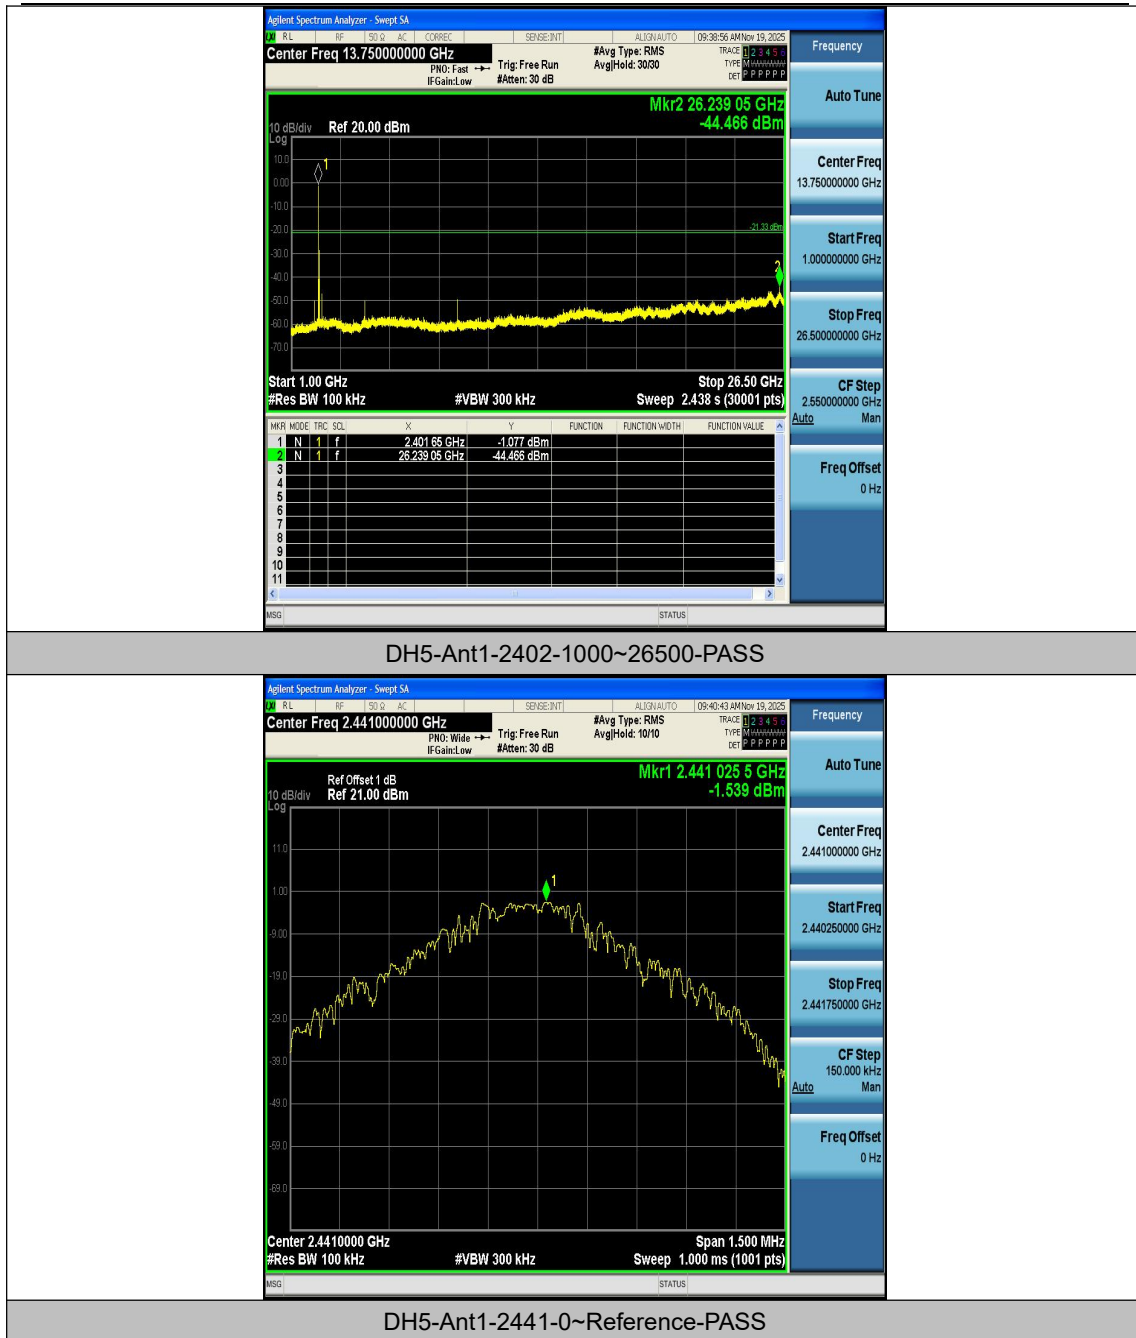


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

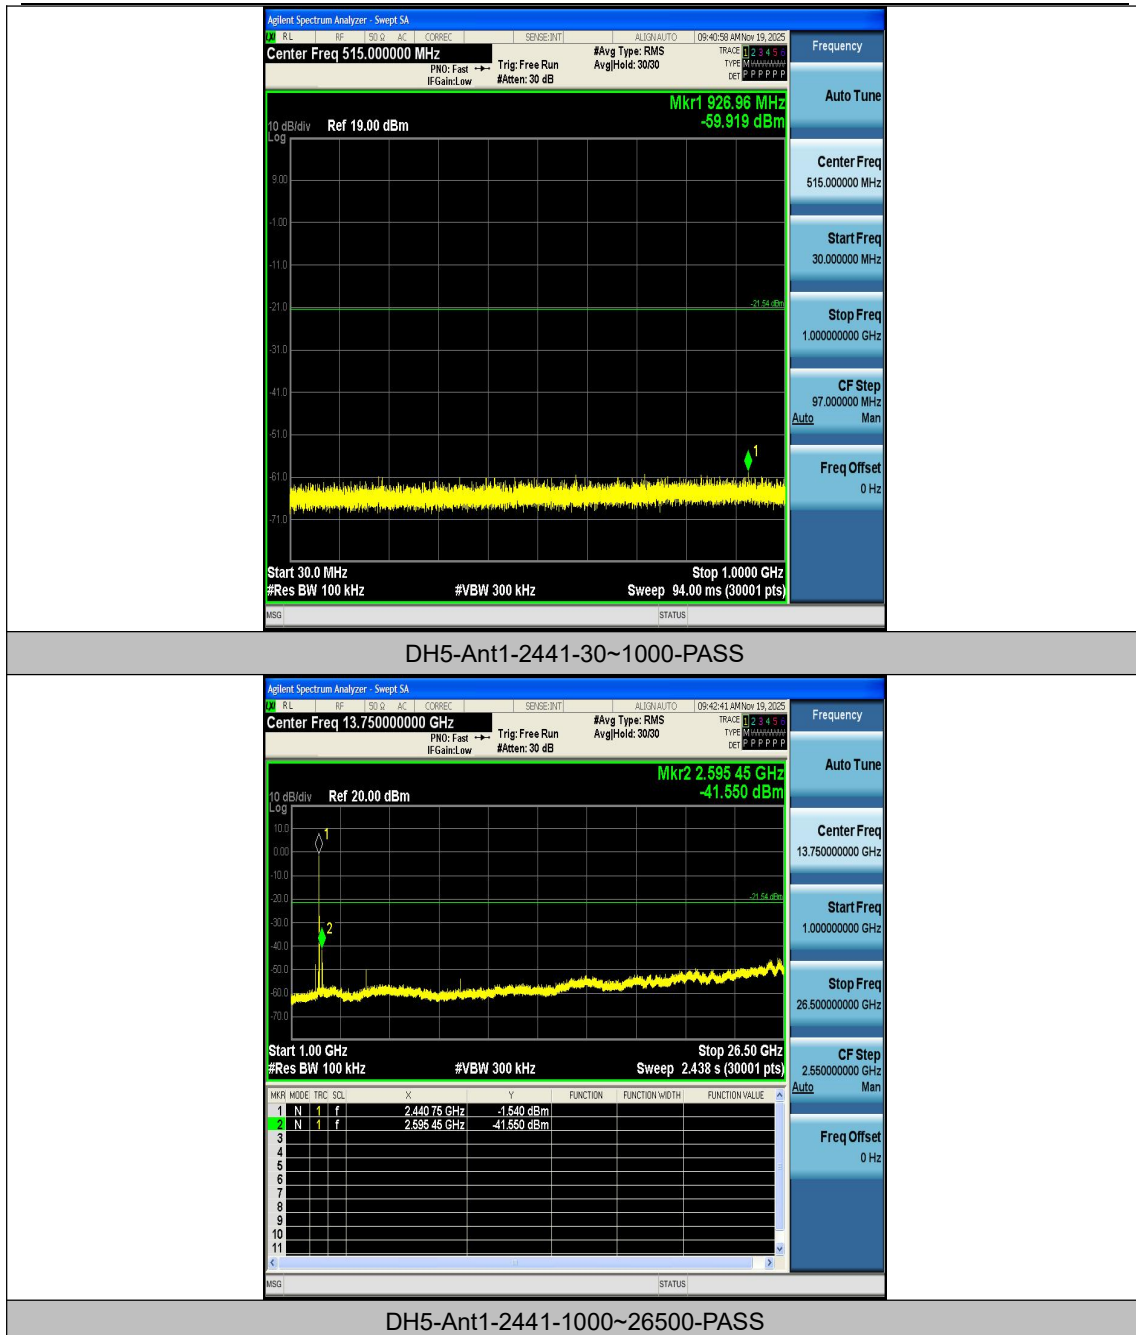


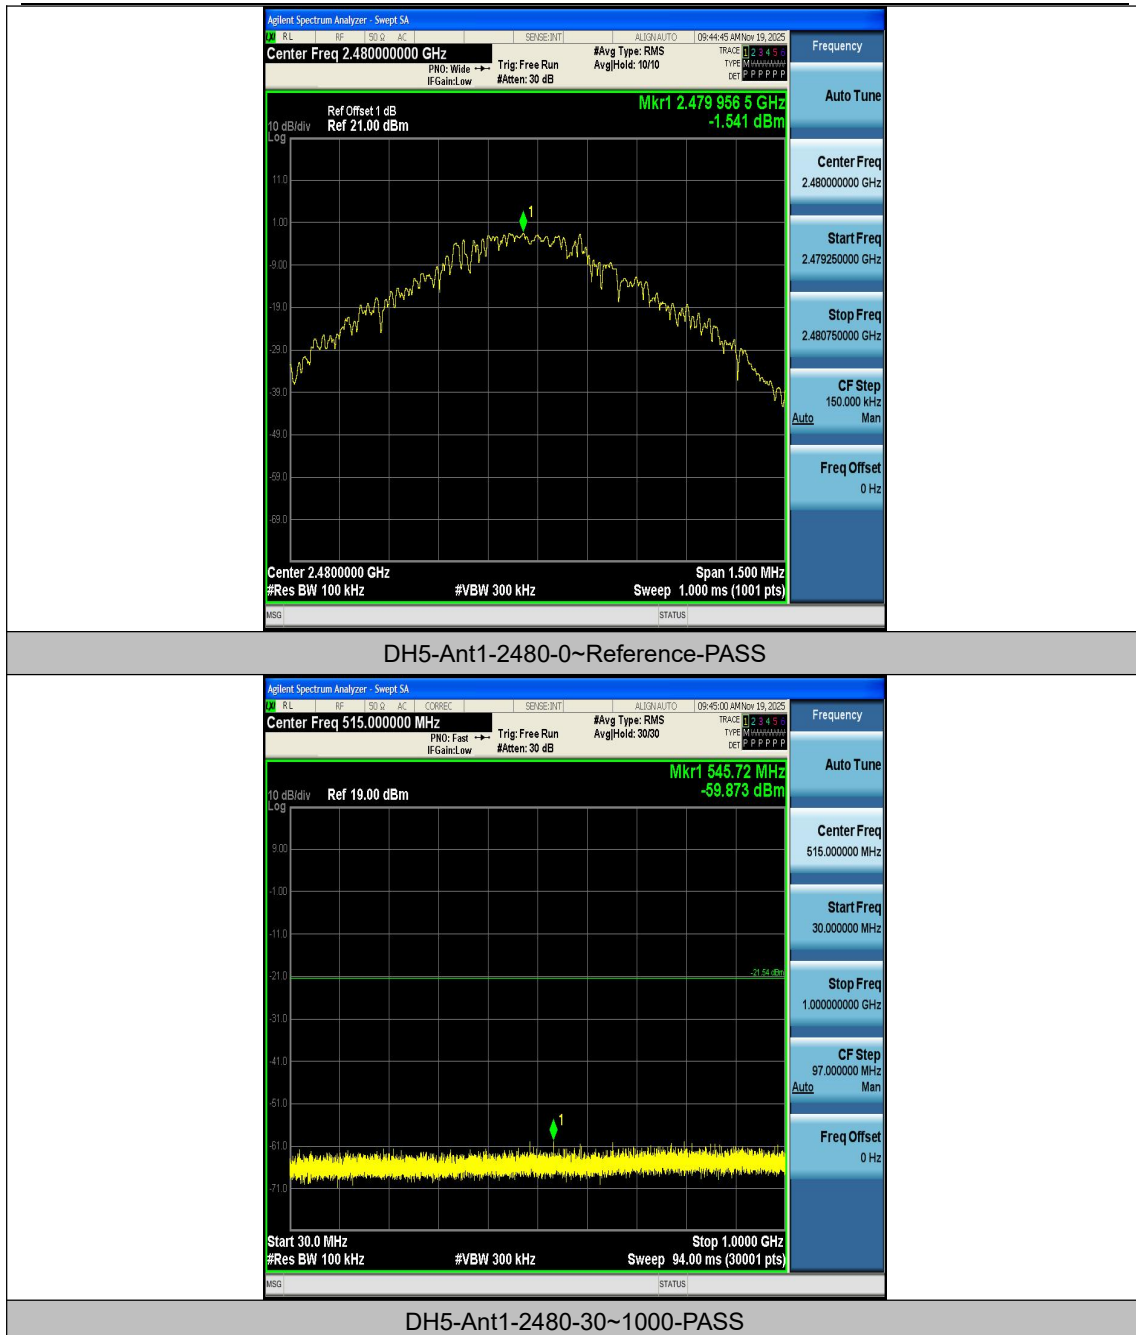

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

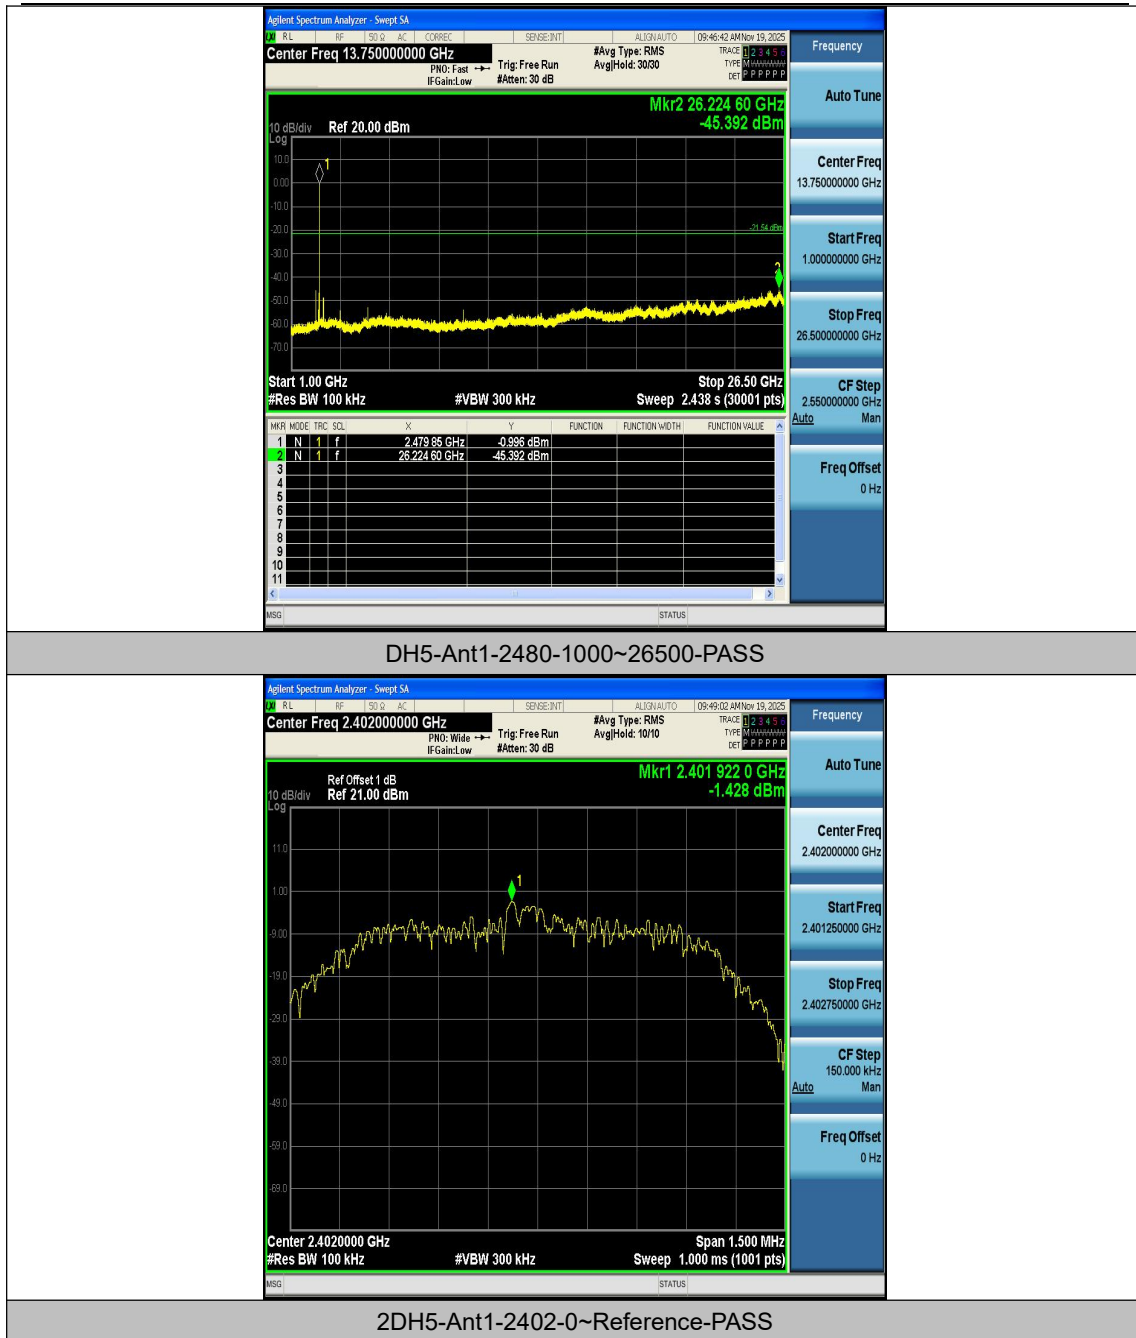

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com