
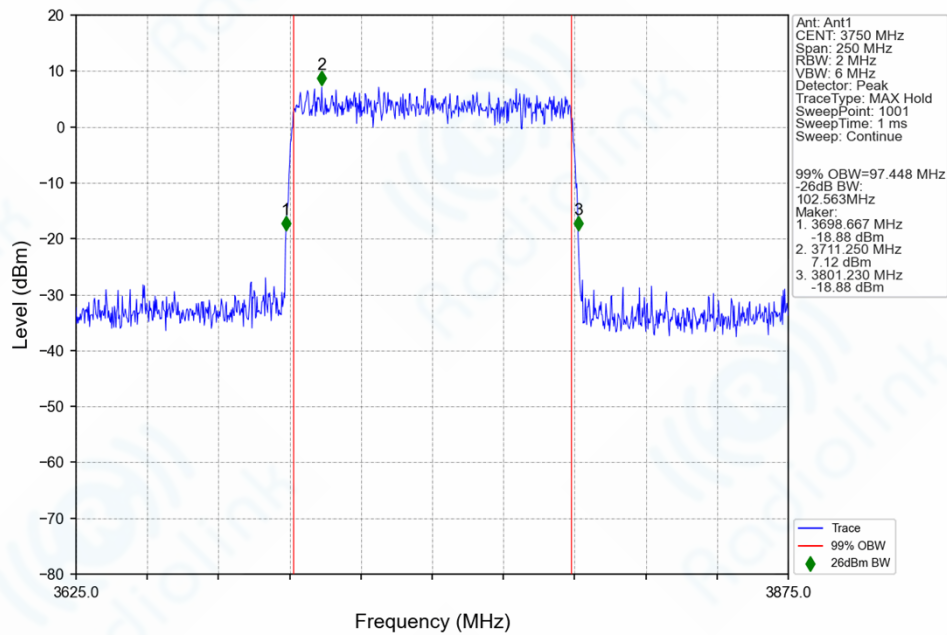



n77a_30kHz_SISO_NTNV_100MHz_CP-OFDM_256_QAM_3750MHz_Outer_Full_Ant1

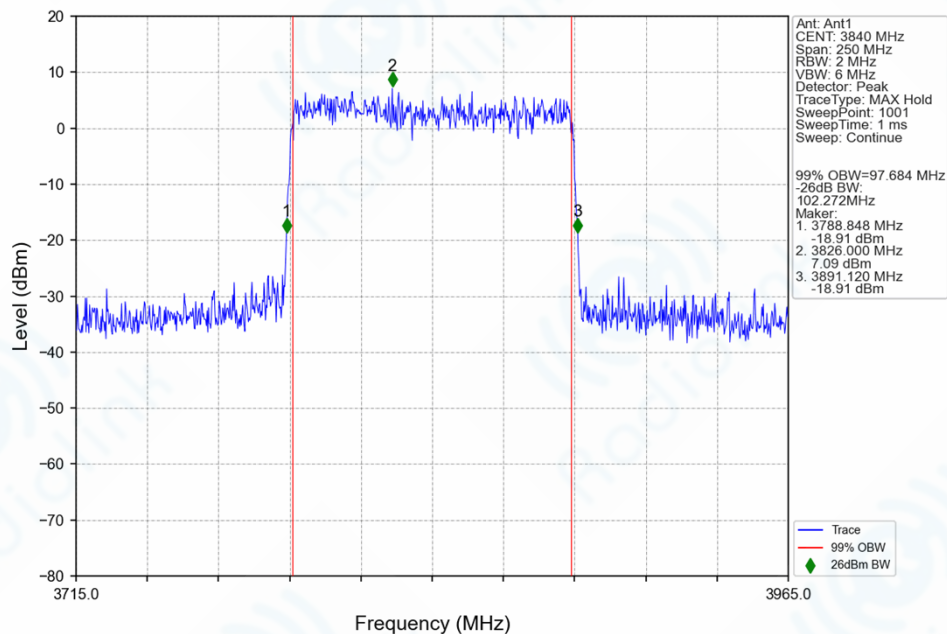

n77a_30kHz_SISO_NTNV_100MHz_CP-OFDM_256_QAM_3840MHz_Outer_Full_Ant1


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

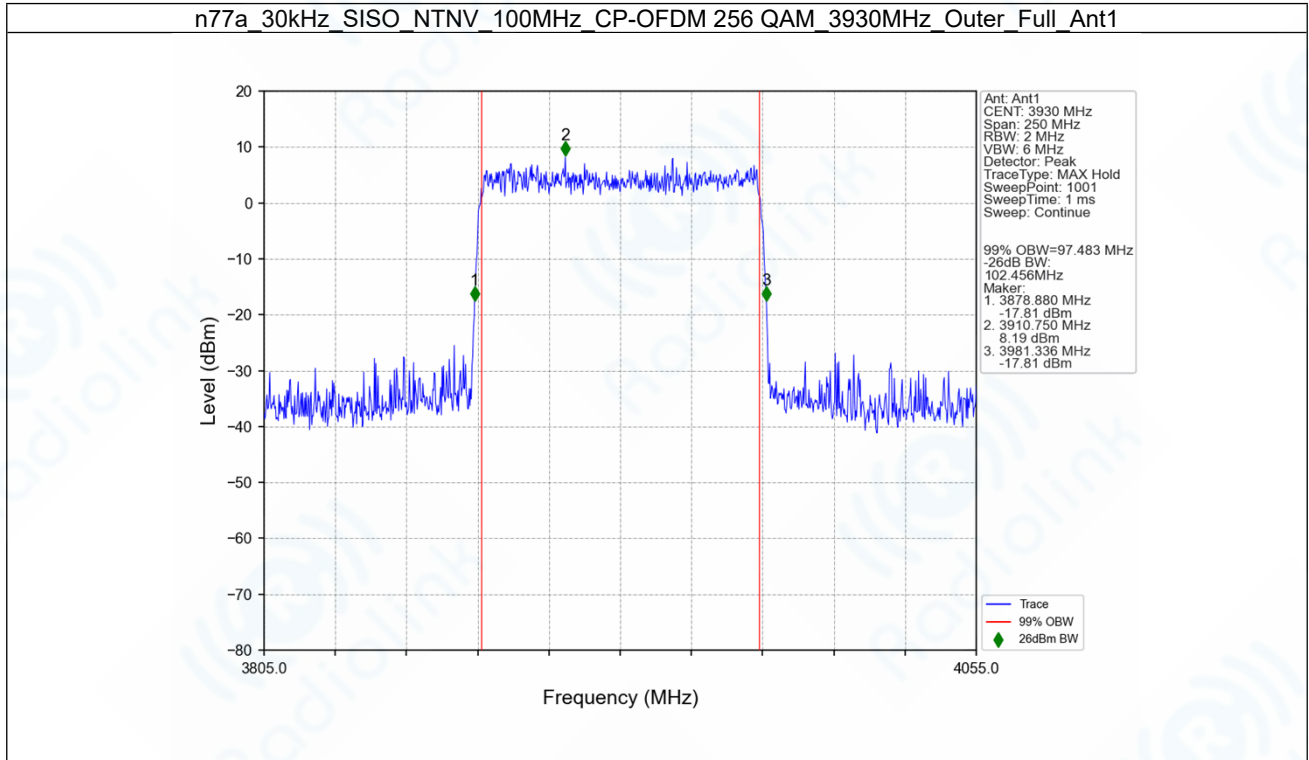

4. Peak-Average Ratio

4.1 Test Result

4.1.1 30_S_10M_NTNV

5G NR n77a SCS=30kHz SISO 10MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3705	Outer_Full	3.82	/	/	<=13	Pass
	3840	Outer_Full	3.86	/	/	<=13	Pass
	3975	Outer_Full	3.93	/	/	<=13	Pass
DFT-s-OFDM QPSK	3705	Outer_Full	4.40	/	/	<=13	Pass
	3840	Outer_Full	4.41	/	/	<=13	Pass
	3975	Outer_Full	4.39	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3705	Outer_Full	5.49	/	/	<=13	Pass
	3840	Outer_Full	5.50	/	/	<=13	Pass
	3975	Outer_Full	5.46	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3705	Outer_Full	5.88	/	/	<=13	Pass
	3840	Outer_Full	5.89	/	/	<=13	Pass
	3975	Outer_Full	5.93	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3705	Outer_Full	6.63	/	/	<=13	Pass
	3840	Outer_Full	6.61	/	/	<=13	Pass
	3975	Outer_Full	6.70	/	/	<=13	Pass
CP-OFDM QPSK	3705	Outer_Full	6.55	/	/	<=13	Pass
	3840	Outer_Full	6.57	/	/	<=13	Pass
	3975	Outer_Full	6.59	/	/	<=13	Pass
CP-OFDM 16 QAM	3705	Outer_Full	6.61	/	/	<=13	Pass
	3840	Outer_Full	6.62	/	/	<=13	Pass
	3975	Outer_Full	6.64	/	/	<=13	Pass
CP-OFDM 64 QAM	3705	Outer_Full	7.04	/	/	<=13	Pass
	3840	Outer_Full	7.07	/	/	<=13	Pass
	3975	Outer_Full	7.09	/	/	<=13	Pass
CP-OFDM 256 QAM	3705	Outer_Full	11.13	/	/	<=13	Pass
	3840	Outer_Full	8.82	/	/	<=13	Pass
	3975	Outer_Full	8.76	/	/	<=13	Pass

4.1.2 30_S_20M_NTNV

5G NR n77a SCS=30kHz SISO 20MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3710.01	Outer_Full	3.89	/	/	<=13	Pass
	3840	Outer_Full	4.17	/	/	<=13	Pass
	3969.99	Outer_Full	3.88	/	/	<=13	Pass
DFT-s-OFDM QPSK	3710.01	Outer_Full	4.53	/	/	<=13	Pass
	3840	Outer_Full	4.47	/	/	<=13	Pass
	3969.99	Outer_Full	4.42	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3710.01	Outer_Full	5.48	/	/	<=13	Pass
	3840	Outer_Full	5.42	/	/	<=13	Pass
	3969.99	Outer_Full	5.39	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3710.01	Outer_Full	5.90	/	/	<=13	Pass
	3840	Outer_Full	5.84	/	/	<=13	Pass
	3969.99	Outer_Full	5.82	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3710.01	Outer_Full	6.79	/	/	<=13	Pass
	3840	Outer_Full	6.72	/	/	<=13	Pass
	3969.99	Outer_Full	6.74	/	/	<=13	Pass
CP-OFDM QPSK	3710.01	Outer_Full	6.54	/	/	<=13	Pass
	3840	Outer_Full	6.51	/	/	<=13	Pass

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

	3969.99	Outer_Full	6.49	/	/	<=13	Pass
CP-OFDM 16 QAM	3710.01	Outer_Full	6.51	/	/	<=13	Pass
	3840	Outer_Full	6.48	/	/	<=13	Pass
	3969.99	Outer_Full	6.44	/	/	<=13	Pass
CP-OFDM 64 QAM	3710.01	Outer_Full	7.14	/	/	<=13	Pass
	3840	Outer_Full	7.11	/	/	<=13	Pass
	3969.99	Outer_Full	7.11	/	/	<=13	Pass
CP-OFDM 256 QAM	3710.01	Outer_Full	8.60	/	/	<=13	Pass
	3840	Outer_Full	8.62	/	/	<=13	Pass
	3969.99	Outer_Full	8.70	/	/	<=13	Pass

4.1.3 30_S_30M_NTNV

5G NR n77a SCS=30kHz SISO 30MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3715.02	Outer_Full	4.21	/	/	<=13	Pass
	3840	Outer_Full	4.12	/	/	<=13	Pass
	3964.98	Outer_Full	3.98	/	/	<=13	Pass
DFT-s-OFDM QPSK	3715.02	Outer_Full	4.79	/	/	<=13	Pass
	3840	Outer_Full	4.71	/	/	<=13	Pass
	3964.98	Outer_Full	4.65	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3715.02	Outer_Full	5.63	/	/	<=13	Pass
	3840	Outer_Full	5.57	/	/	<=13	Pass
	3964.98	Outer_Full	5.53	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3715.02	Outer_Full	6.13	/	/	<=13	Pass
	3840	Outer_Full	6.09	/	/	<=13	Pass
	3964.98	Outer_Full	6.07	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3715.02	Outer_Full	6.81	/	/	<=13	Pass
	3840	Outer_Full	6.78	/	/	<=13	Pass
	3964.98	Outer_Full	6.80	/	/	<=13	Pass
CP-OFDM QPSK	3715.02	Outer_Full	7.18	/	/	<=13	Pass
	3840	Outer_Full	7.15	/	/	<=13	Pass
	3964.98	Outer_Full	7.17	/	/	<=13	Pass
CP-OFDM 16 QAM	3715.02	Outer_Full	7.26	/	/	<=13	Pass
	3840	Outer_Full	7.24	/	/	<=13	Pass
	3964.98	Outer_Full	7.24	/	/	<=13	Pass
CP-OFDM 64 QAM	3715.02	Outer_Full	7.58	/	/	<=13	Pass
	3840	Outer_Full	7.55	/	/	<=13	Pass
	3964.98	Outer_Full	7.56	/	/	<=13	Pass
CP-OFDM 256 QAM	3715.02	Outer_Full	8.34	/	/	<=13	Pass
	3840	Outer_Full	8.31	/	/	<=13	Pass
	3964.98	Outer_Full	8.40	/	/	<=13	Pass

4.1.4 30_S_40M_NTNV

5G NR n77a SCS=30kHz SISO 40MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3720	Outer_Full	5.14	/	/	<=13	Pass
	3840	Outer_Full	4.94	/	/	<=13	Pass
	3960	Outer_Full	4.94	/	/	<=13	Pass
DFT-s-OFDM QPSK	3720	Outer_Full	6.02	/	/	<=13	Pass
	3840	Outer_Full	5.94	/	/	<=13	Pass
	3960	Outer_Full	5.91	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3720	Outer_Full	6.81	/	/	<=13	Pass
	3840	Outer_Full	6.75	/	/	<=13	Pass
	3960	Outer_Full	6.74	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3720	Outer_Full	6.91	/	/	<=13	Pass
	3840	Outer_Full	6.88	/	/	<=13	Pass
	3960	Outer_Full	6.90	/	/	<=13	Pass

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

DFT-s-OFDM 256 QAM	3720	Outer_Full	6.98	/	/	<=13	Pass
	3840	Outer_Full	6.98	/	/	<=13	Pass
	3960	Outer_Full	6.95	/	/	<=13	Pass
CP-OFDM QPSK	3720	Outer_Full	7.89	/	/	<=13	Pass
	3840	Outer_Full	7.86	/	/	<=13	Pass
	3960	Outer_Full	7.90	/	/	<=13	Pass
CP-OFDM 16 QAM	3720	Outer_Full	7.88	/	/	<=13	Pass
	3840	Outer_Full	7.87	/	/	<=13	Pass
	3960	Outer_Full	7.89	/	/	<=13	Pass
CP-OFDM 64 QAM	3720	Outer_Full	8.09	/	/	<=13	Pass
	3840	Outer_Full	8.13	/	/	<=13	Pass
	3960	Outer_Full	8.08	/	/	<=13	Pass
CP-OFDM 256 QAM	3720	Outer_Full	8.53	/	/	<=13	Pass
	3840	Outer_Full	8.58	/	/	<=13	Pass
	3960	Outer_Full	8.60	/	/	<=13	Pass

4.1.5 30_S_50M_NTNV

5G NR n77a SCS=30kHz SISO 50MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3725.01	Outer_Full	6.05	/	/	<=13	Pass
	3840	Outer_Full	6.01	/	/	<=13	Pass
	3954.99	Outer_Full	5.95	/	/	<=13	Pass
DFT-s-OFDM QPSK	3725.01	Outer_Full	6.42	/	/	<=13	Pass
	3840	Outer_Full	6.39	/	/	<=13	Pass
	3954.99	Outer_Full	6.37	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3725.01	Outer_Full	7.07	/	/	<=13	Pass
	3840	Outer_Full	7.05	/	/	<=13	Pass
	3954.99	Outer_Full	7.05	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3725.01	Outer_Full	7.24	/	/	<=13	Pass
	3840	Outer_Full	7.19	/	/	<=13	Pass
	3954.99	Outer_Full	7.20	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3725.01	Outer_Full	7.23	/	/	<=13	Pass
	3840	Outer_Full	7.20	/	/	<=13	Pass
	3954.99	Outer_Full	7.21	/	/	<=13	Pass
CP-OFDM QPSK	3725.01	Outer_Full	8.02	/	/	<=13	Pass
	3840	Outer_Full	8.02	/	/	<=13	Pass
	3954.99	Outer_Full	8.05	/	/	<=13	Pass
CP-OFDM 16 QAM	3725.01	Outer_Full	7.97	/	/	<=13	Pass
	3840	Outer_Full	7.97	/	/	<=13	Pass
	3954.99	Outer_Full	7.96	/	/	<=13	Pass
CP-OFDM 64 QAM	3725.01	Outer_Full	8.26	/	/	<=13	Pass
	3840	Outer_Full	8.24	/	/	<=13	Pass
	3954.99	Outer_Full	8.23	/	/	<=13	Pass
CP-OFDM 256 QAM	3725.01	Outer_Full	8.38	/	/	<=13	Pass
	3840	Outer_Full	8.42	/	/	<=13	Pass
	3954.99	Outer_Full	8.45	/	/	<=13	Pass

4.1.6 30_S_60M_NTNV

5G NR n77a SCS=30kHz SISO 60MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3730.02	Outer_Full	6.66	/	/	<=13	Pass
	3840	Outer_Full	6.64	/	/	<=13	Pass
	3949.98	Outer_Full	6.63	/	/	<=13	Pass
DFT-s-OFDM QPSK	3730.02	Outer_Full	6.83	/	/	<=13	Pass
	3840	Outer_Full	6.81	/	/	<=13	Pass
	3949.98	Outer_Full	6.79	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3730.02	Outer_Full	7.32	/	/	<=13	Pass

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

	3840	Outer_Full	7.28	/	/	<=13	Pass
	3949.98	Outer_Full	7.28	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3730.02	Outer_Full	7.38	/	/	<=13	Pass
	3840	Outer_Full	7.36	/	/	<=13	Pass
	3949.98	Outer_Full	7.34	/	/	<=13	Pass
	3730.02	Outer_Full	7.40	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3840	Outer_Full	7.37	/	/	<=13	Pass
	3949.98	Outer_Full	7.37	/	/	<=13	Pass
CP-OFDM QPSK	3730.02	Outer_Full	8.11	/	/	<=13	Pass
	3840	Outer_Full	8.17	/	/	<=13	Pass
	3949.98	Outer_Full	8.19	/	/	<=13	Pass
	3730.02	Outer_Full	8.20	/	/	<=13	Pass
CP-OFDM 16 QAM	3840	Outer_Full	8.22	/	/	<=13	Pass
	3949.98	Outer_Full	8.22	/	/	<=13	Pass
CP-OFDM 64 QAM	3730.02	Outer_Full	8.16	/	/	<=13	Pass
	3840	Outer_Full	8.17	/	/	<=13	Pass
	3949.98	Outer_Full	8.20	/	/	<=13	Pass
	3730.02	Outer_Full	8.37	/	/	<=13	Pass
CP-OFDM 256 QAM	3840	Outer_Full	8.45	/	/	<=13	Pass
	3949.98	Outer_Full	8.42	/	/	<=13	Pass

4.1.7 30_S_70M_NTNV

5G NR n77a SCS=30kHz SISO 70MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3735	Outer_Full	6.17	/	/	<=13	Pass
	3840	Outer_Full	6.15	/	/	<=13	Pass
	3945	Outer_Full	6.05	/	/	<=13	Pass
DFT-s-OFDM QPSK	3735	Outer_Full	6.92	/	/	<=13	Pass
	3840	Outer_Full	6.89	/	/	<=13	Pass
	3945	Outer_Full	6.85	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3735	Outer_Full	7.39	/	/	<=13	Pass
	3840	Outer_Full	7.36	/	/	<=13	Pass
	3945	Outer_Full	7.35	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3735	Outer_Full	7.40	/	/	<=13	Pass
	3840	Outer_Full	7.41	/	/	<=13	Pass
	3945	Outer_Full	7.40	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3735	Outer_Full	7.57	/	/	<=13	Pass
	3840	Outer_Full	7.54	/	/	<=13	Pass
	3945	Outer_Full	7.51	/	/	<=13	Pass
CP-OFDM QPSK	3735	Outer_Full	8.09	/	/	<=13	Pass
	3840	Outer_Full	8.14	/	/	<=13	Pass
	3945	Outer_Full	8.11	/	/	<=13	Pass
CP-OFDM 16 QAM	3735	Outer_Full	8.15	/	/	<=13	Pass
	3840	Outer_Full	8.12	/	/	<=13	Pass
	3945	Outer_Full	8.15	/	/	<=13	Pass
CP-OFDM 64 QAM	3735	Outer_Full	8.38	/	/	<=13	Pass
	3840	Outer_Full	8.41	/	/	<=13	Pass
	3945	Outer_Full	8.40	/	/	<=13	Pass
CP-OFDM 256 QAM	3735	Outer_Full	8.30	/	/	<=13	Pass
	3840	Outer_Full	8.31	/	/	<=13	Pass
	3945	Outer_Full	8.32	/	/	<=13	Pass

4.1.8 30_S_80M_NTNV

5G NR n77a SCS=30kHz SISO 80MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3740.01	Outer_Full	6.05	/	/	<=13	Pass
	3840	Outer_Full	6.00	/	/	<=13	Pass

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

	3939.99	Outer_Full	5.97	/	/	<=13	Pass
DFT-s-OFDM QPSK	3740.01	Outer_Full	7.17	/	/	<=13	Pass
	3840	Outer_Full	7.16	/	/	<=13	Pass
	3939.99	Outer_Full	7.15	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3740.01	Outer_Full	7.41	/	/	<=13	Pass
	3840	Outer_Full	7.39	/	/	<=13	Pass
	3939.99	Outer_Full	7.40	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3740.01	Outer_Full	7.56	/	/	<=13	Pass
	3840	Outer_Full	7.54	/	/	<=13	Pass
	3939.99	Outer_Full	7.54	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3740.01	Outer_Full	7.57	/	/	<=13	Pass
	3840	Outer_Full	7.57	/	/	<=13	Pass
	3939.99	Outer_Full	7.56	/	/	<=13	Pass
CP-OFDM QPSK	3740.01	Outer_Full	8.08	/	/	<=13	Pass
	3840	Outer_Full	8.09	/	/	<=13	Pass
	3939.99	Outer_Full	8.10	/	/	<=13	Pass
CP-OFDM 16 QAM	3740.01	Outer_Full	8.34	/	/	<=13	Pass
	3840	Outer_Full	8.33	/	/	<=13	Pass
	3939.99	Outer_Full	8.29	/	/	<=13	Pass
CP-OFDM 64 QAM	3740.01	Outer_Full	8.27	/	/	<=13	Pass
	3840	Outer_Full	8.27	/	/	<=13	Pass
	3939.99	Outer_Full	8.28	/	/	<=13	Pass
CP-OFDM 256 QAM	3740.01	Outer_Full	8.38	/	/	<=13	Pass
	3840	Outer_Full	8.42	/	/	<=13	Pass
	3939.99	Outer_Full	8.40	/	/	<=13	Pass

4.1.9 30_S_90M_NTNV

5G NR n77a SCS=30kHz SISO 90MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3745.02	Outer_Full	6.27	/	/	<=13	Pass
	3840	Outer_Full	6.20	/	/	<=13	Pass
	3934.98	Outer_Full	6.15	/	/	<=13	Pass
DFT-s-OFDM QPSK	3745.02	Outer_Full	7.17	/	/	<=13	Pass
	3840	Outer_Full	7.12	/	/	<=13	Pass
	3934.98	Outer_Full	7.11	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3745.02	Outer_Full	7.60	/	/	<=13	Pass
	3840	Outer_Full	7.62	/	/	<=13	Pass
	3934.98	Outer_Full	7.58	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3745.02	Outer_Full	7.58	/	/	<=13	Pass
	3840	Outer_Full	7.60	/	/	<=13	Pass
	3934.98	Outer_Full	7.58	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3745.02	Outer_Full	7.65	/	/	<=13	Pass
	3840	Outer_Full	7.63	/	/	<=13	Pass
	3934.98	Outer_Full	7.63	/	/	<=13	Pass
CP-OFDM QPSK	3745.02	Outer_Full	8.12	/	/	<=13	Pass
	3840	Outer_Full	8.13	/	/	<=13	Pass
	3934.98	Outer_Full	8.29	/	/	<=13	Pass
CP-OFDM 16 QAM	3745.02	Outer_Full	8.32	/	/	<=13	Pass
	3840	Outer_Full	8.33	/	/	<=13	Pass
	3934.98	Outer_Full	8.35	/	/	<=13	Pass
CP-OFDM 64 QAM	3745.02	Outer_Full	8.32	/	/	<=13	Pass
	3840	Outer_Full	8.32	/	/	<=13	Pass
	3934.98	Outer_Full	8.32	/	/	<=13	Pass
CP-OFDM 256 QAM	3745.02	Outer_Full	8.32	/	/	<=13	Pass
	3840	Outer_Full	8.33	/	/	<=13	Pass
	3934.98	Outer_Full	8.34	/	/	<=13	Pass

4.1.10 30_S_100M_NTNV


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

5G NR n77a SCS=30kHz SISO 100MHz NTN							
Modulation	Frequency (MHz)	RB Allocation	Peak-Average Ratio (dB)				Verdict
			Ant1	Ant2	Sum	Limit	
DFT-s-OFDM PI/2 BPSK	3750	Outer_Full	6.51	/	/	<=13	Pass
	3840	Outer_Full	6.45	/	/	<=13	Pass
	3930	Outer_Full	6.45	/	/	<=13	Pass
DFT-s-OFDM QPSK	3750	Outer_Full	7.28	/	/	<=13	Pass
	3840	Outer_Full	7.25	/	/	<=13	Pass
	3930	Outer_Full	7.26	/	/	<=13	Pass
DFT-s-OFDM 16 QAM	3750	Outer_Full	7.67	/	/	<=13	Pass
	3840	Outer_Full	7.64	/	/	<=13	Pass
	3930	Outer_Full	7.66	/	/	<=13	Pass
DFT-s-OFDM 64 QAM	3750	Outer_Full	7.76	/	/	<=13	Pass
	3840	Outer_Full	7.75	/	/	<=13	Pass
	3930	Outer_Full	7.75	/	/	<=13	Pass
DFT-s-OFDM 256 QAM	3750	Outer_Full	7.86	/	/	<=13	Pass
	3840	Outer_Full	7.85	/	/	<=13	Pass
	3930	Outer_Full	7.87	/	/	<=13	Pass
CP-OFDM QPSK	3750	Outer_Full	8.21	/	/	<=13	Pass
	3840	Outer_Full	8.24	/	/	<=13	Pass
	3930	Outer_Full	8.23	/	/	<=13	Pass
CP-OFDM 16 QAM	3750	Outer_Full	8.47	/	/	<=13	Pass
	3840	Outer_Full	8.44	/	/	<=13	Pass
	3930	Outer_Full	8.46	/	/	<=13	Pass
CP-OFDM 64 QAM	3750	Outer_Full	8.27	/	/	<=13	Pass
	3840	Outer_Full	8.27	/	/	<=13	Pass
	3930	Outer_Full	8.27	/	/	<=13	Pass
CP-OFDM 256 QAM	3750	Outer_Full	8.68	/	/	<=13	Pass
	3840	Outer_Full	8.68	/	/	<=13	Pass
	3930	Outer_Full	8.69	/	/	<=13	Pass

4.2 Test Graph

4.2.1 30_S_10M_NTNV

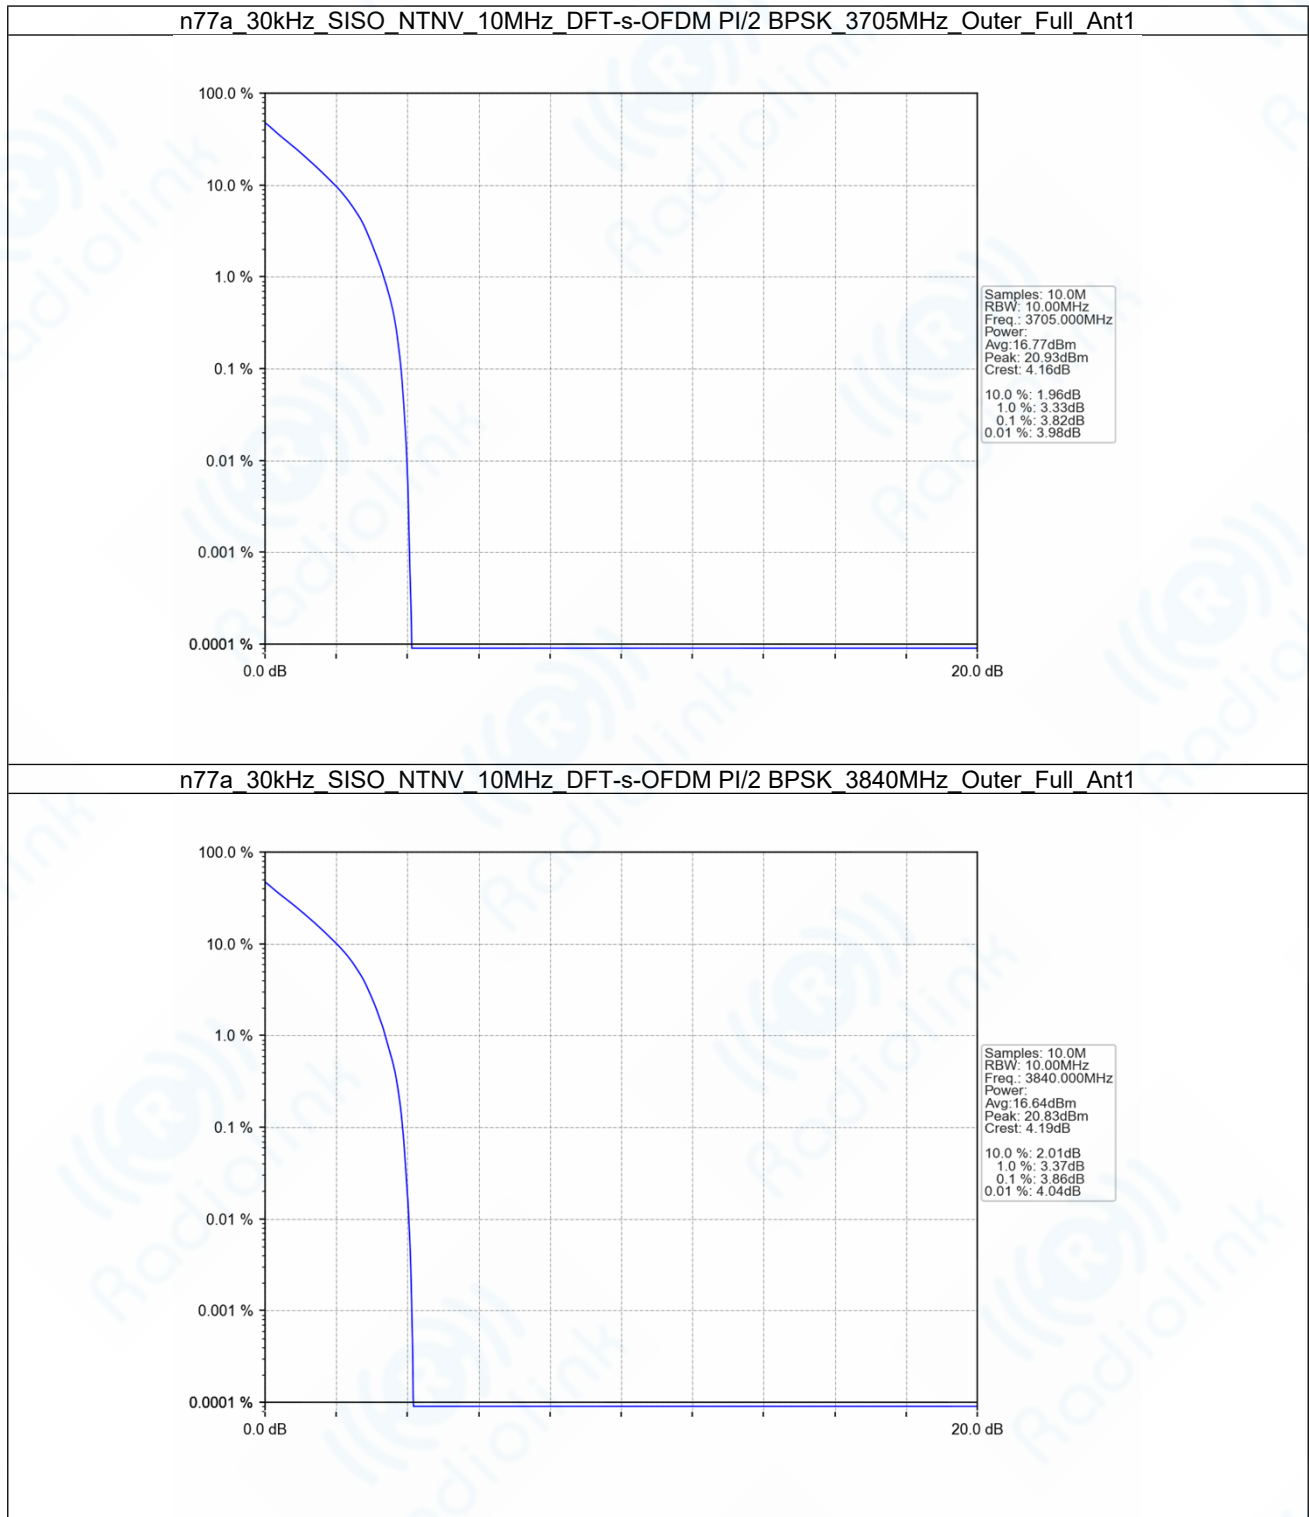


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM PI/2 BPSK_3975MHz_Outer_Full_Ant1

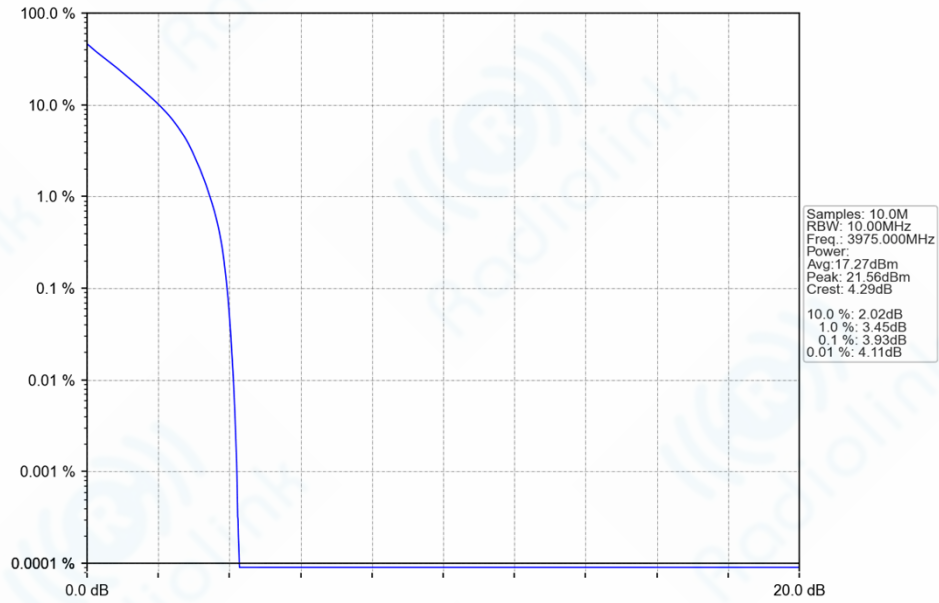

n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM QPSK_3705MHz_Outer_Full_Ant1

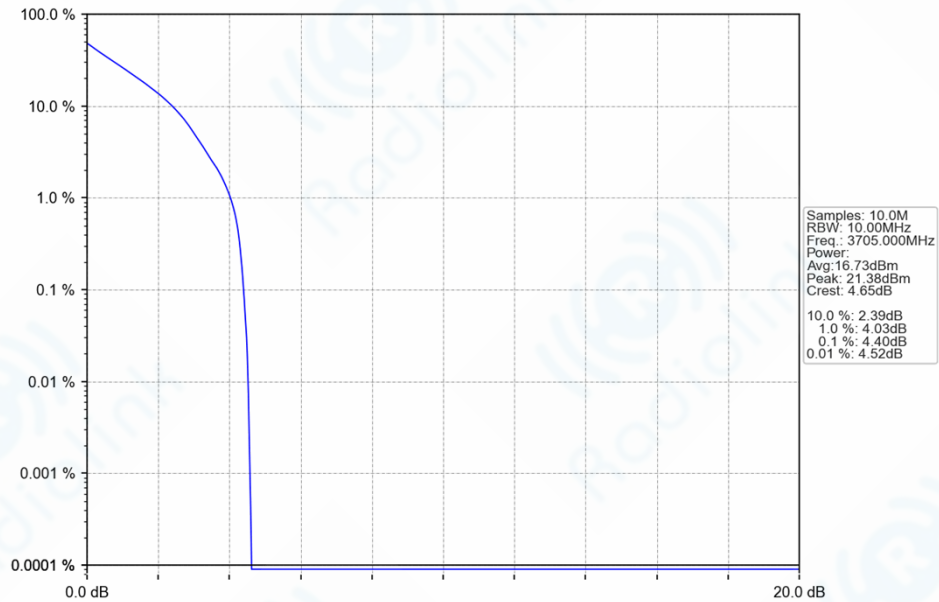


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_QPSK_3840MHz_Outer_Full_Ant1

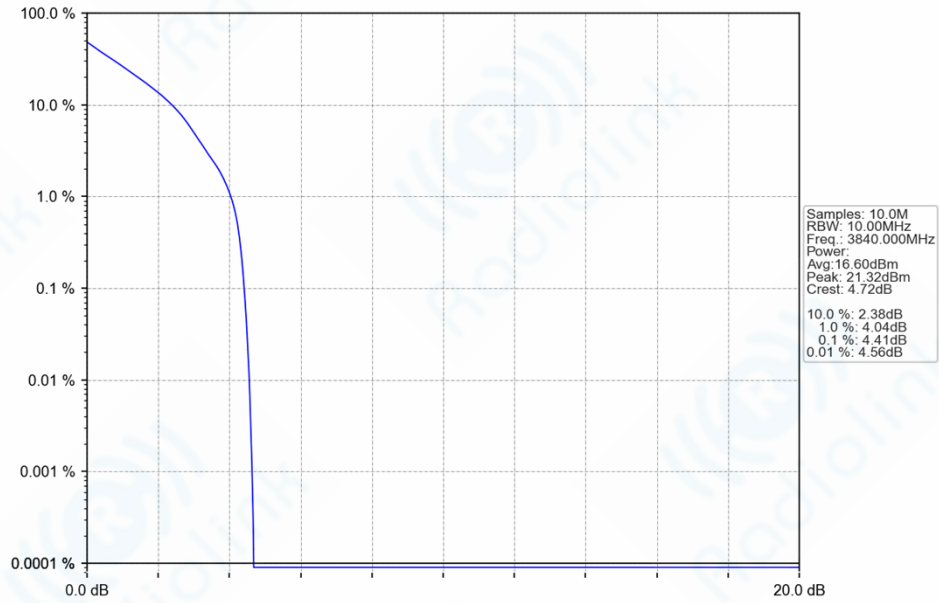


n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_QPSK_3975MHz_Outer_Full_Ant1

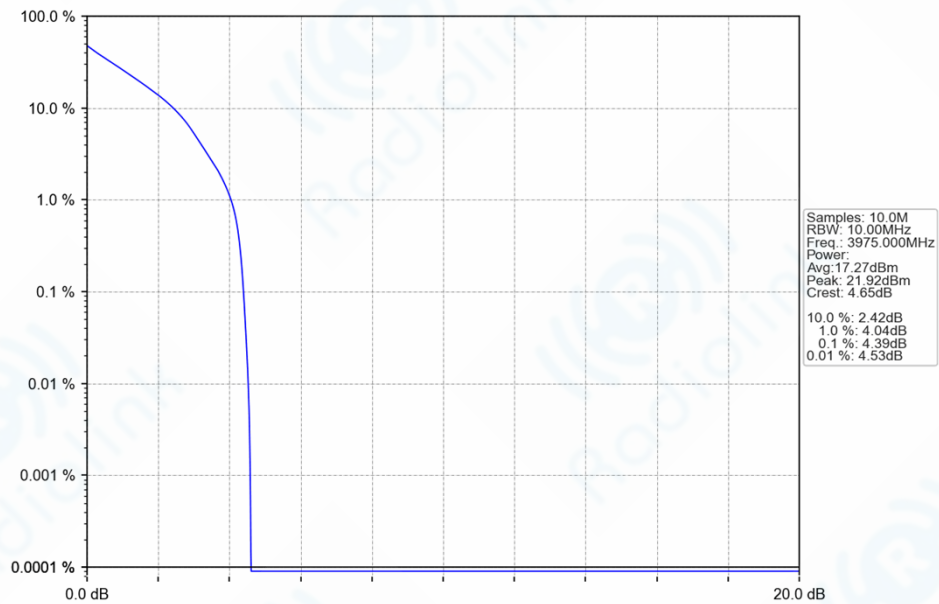

n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_16_QAM_3705MHz_Outer_Full_Ant1

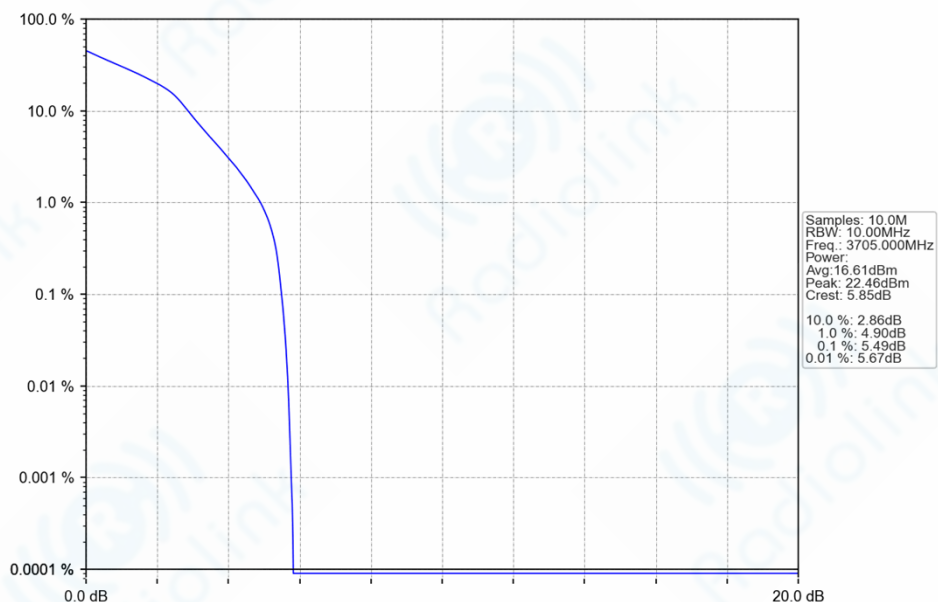


n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_16_QAM_3840MHz_Outer_Full_Ant1

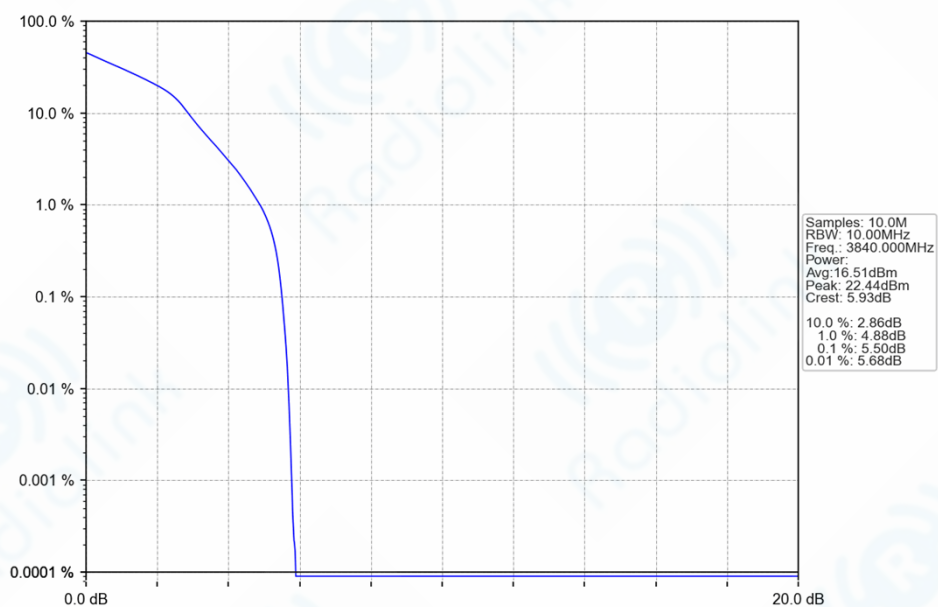


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_16_QAM_3975MHz_Outer_Full_Ant1

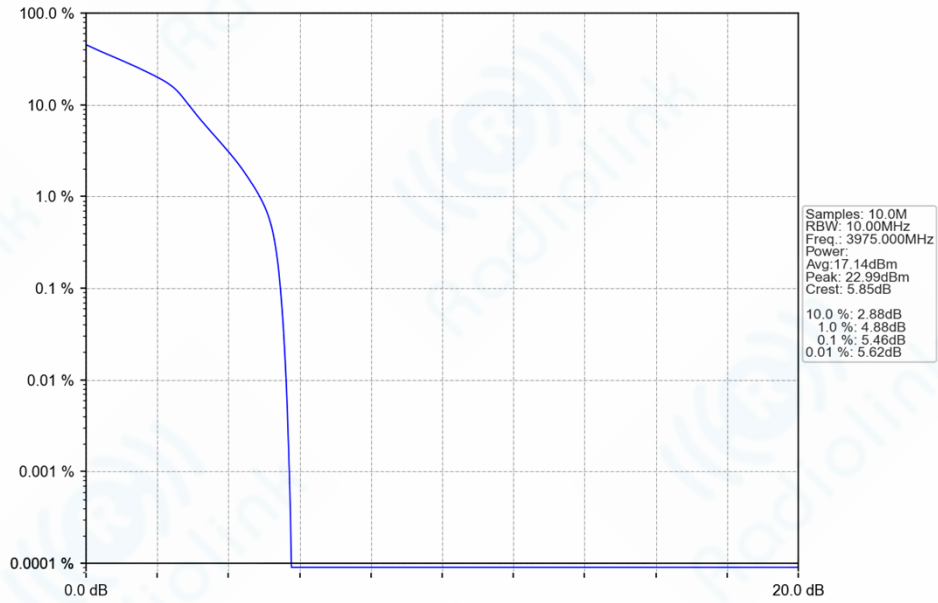

n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_64_QAM_3705MHz_Outer_Full_Ant1

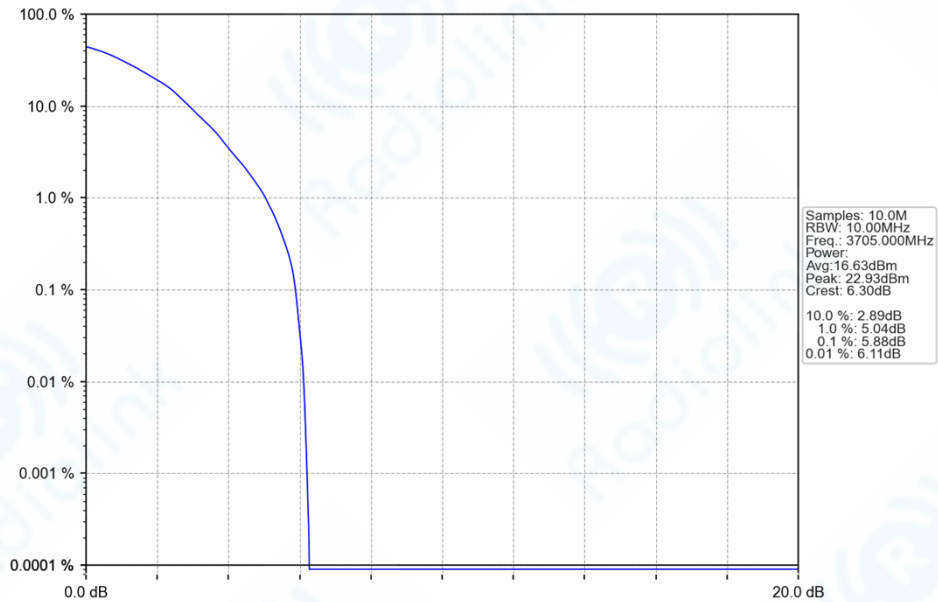


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_64_QAM_3840MHz_Outer_Full_Ant1

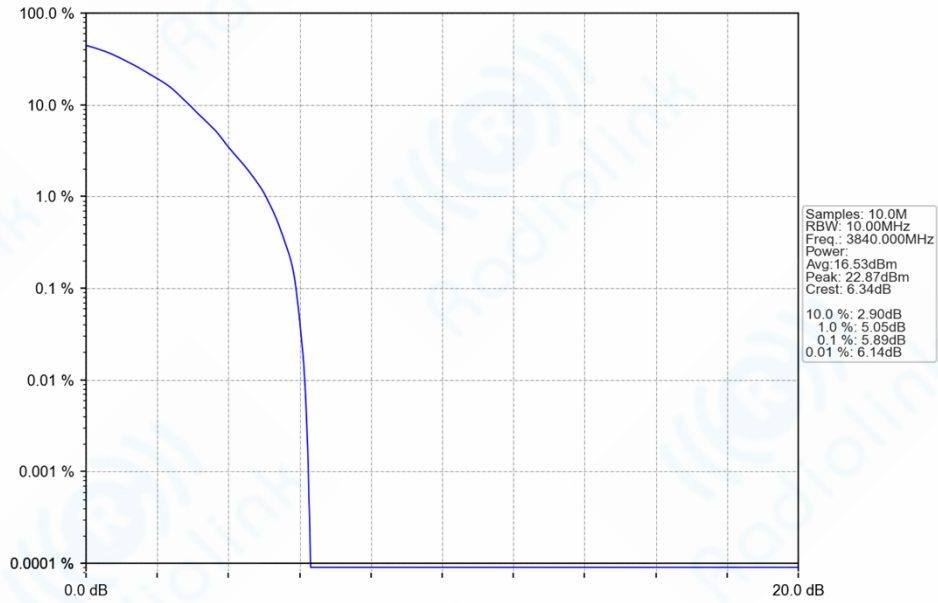


n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_64_QAM_3975MHz_Outer_Full_Ant1

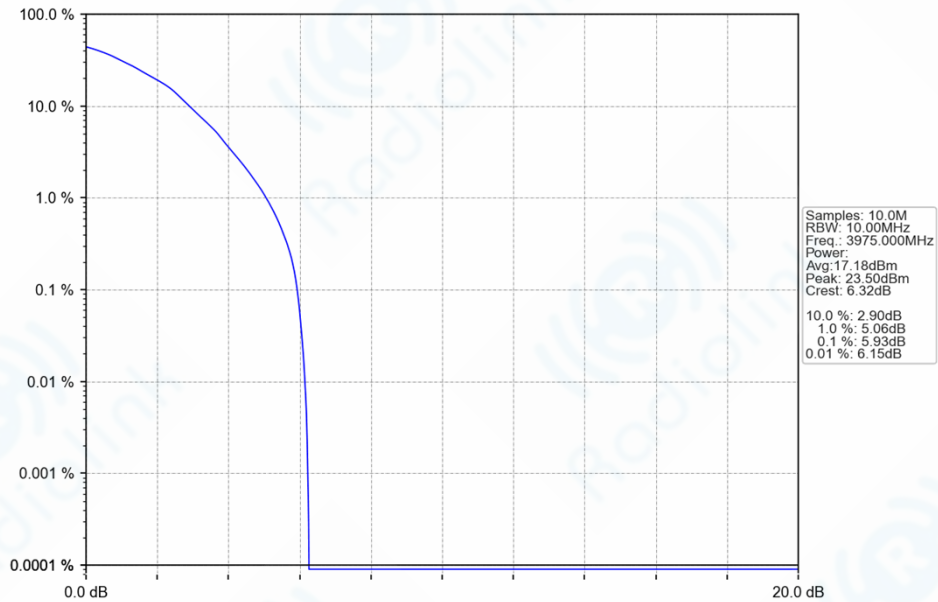

n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_256_QAM_3705MHz_Outer_Full_Ant1

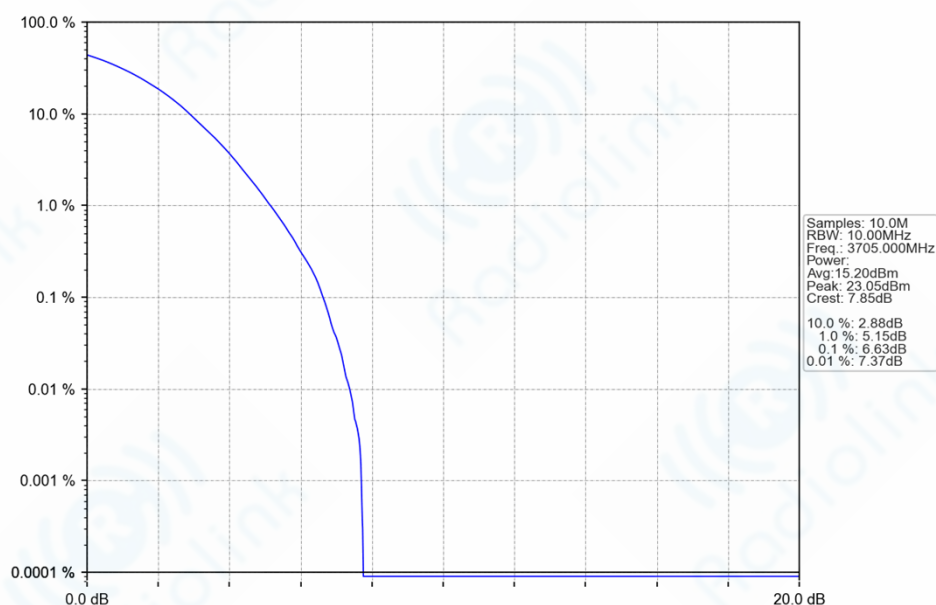


n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_256_QAM_3840MHz_Outer_Full_Ant1

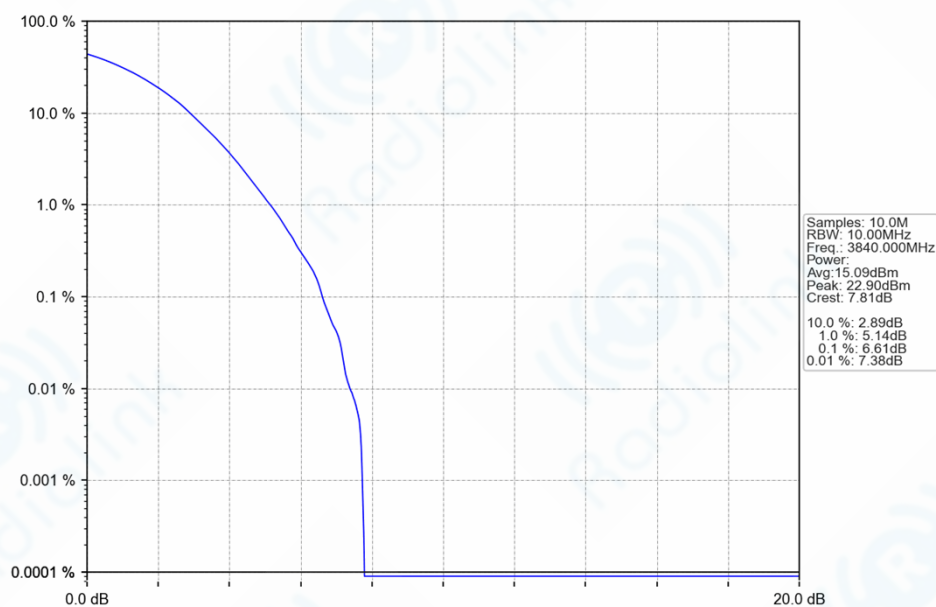


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

n77a_30kHz_SISO_NTNV_10MHz_DFT-s-OFDM_256_QAM_3975MHz_Outer_Full_Ant1

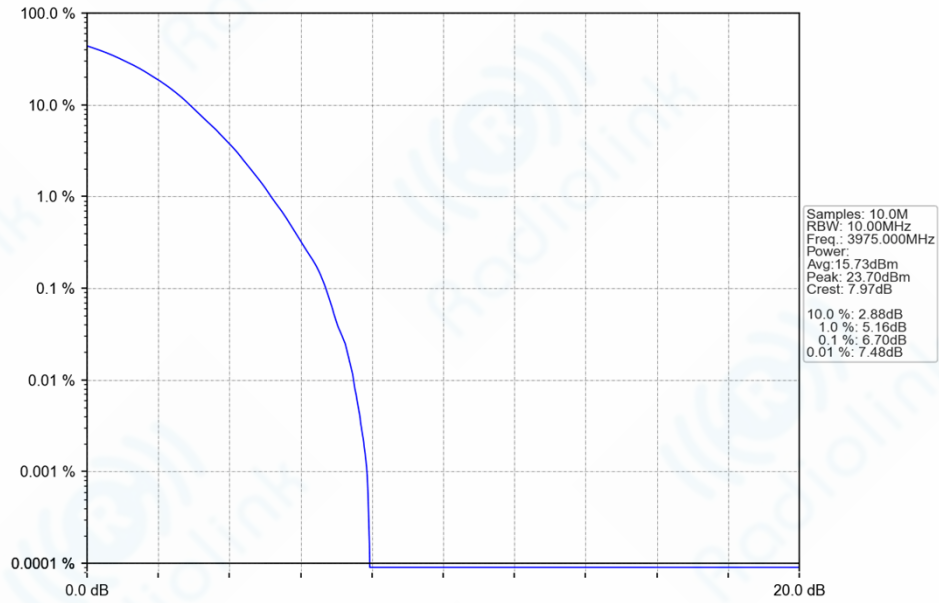

n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_QPSK_3705MHz_Outer_Full_Ant1

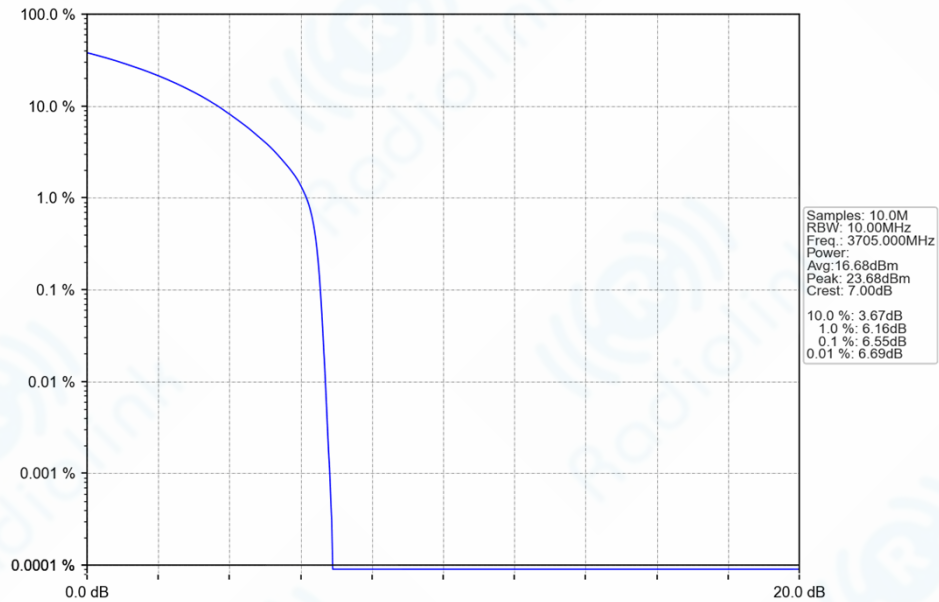


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_QPSK_3840MHz_Outer_Full_Ant1

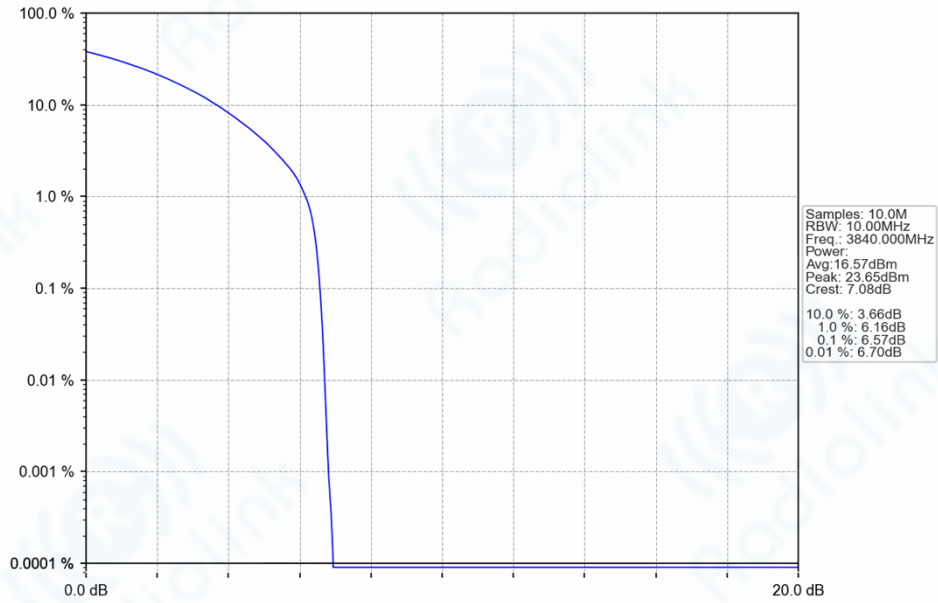


n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_QPSK_3975MHz_Outer_Full_Ant1

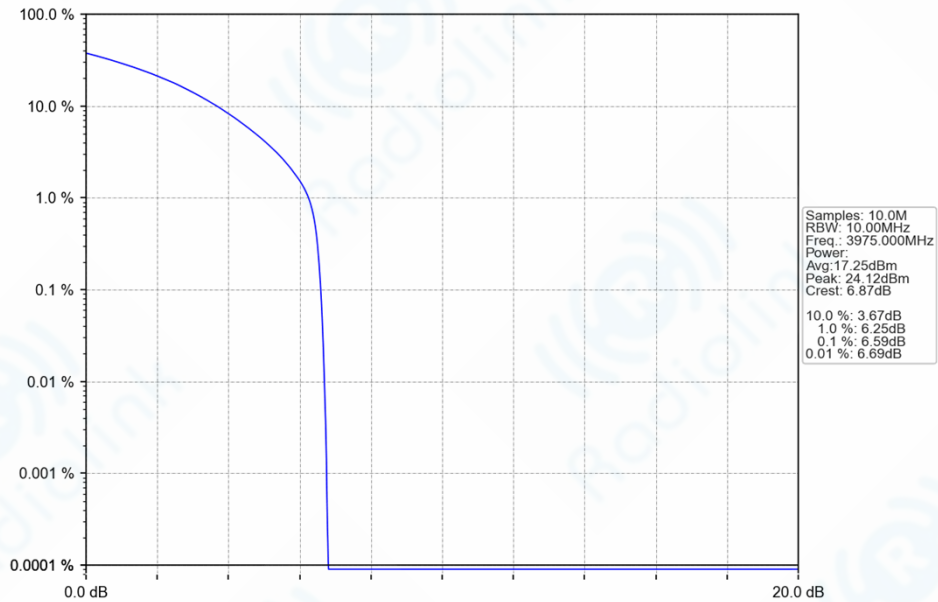

n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_16_QAM_3705MHz_Outer_Full_Ant1

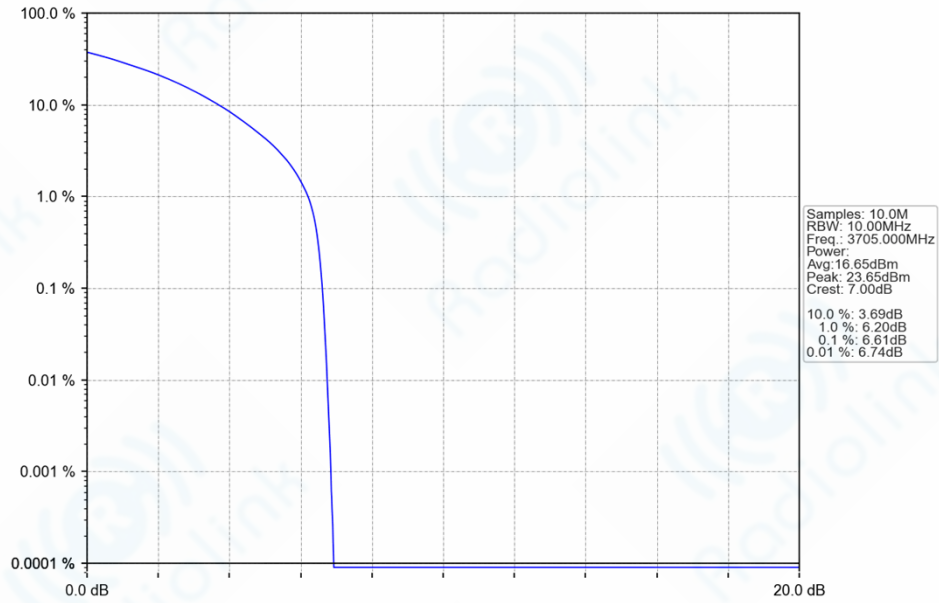

n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_16_QAM_3840MHz_Outer_Full_Ant1

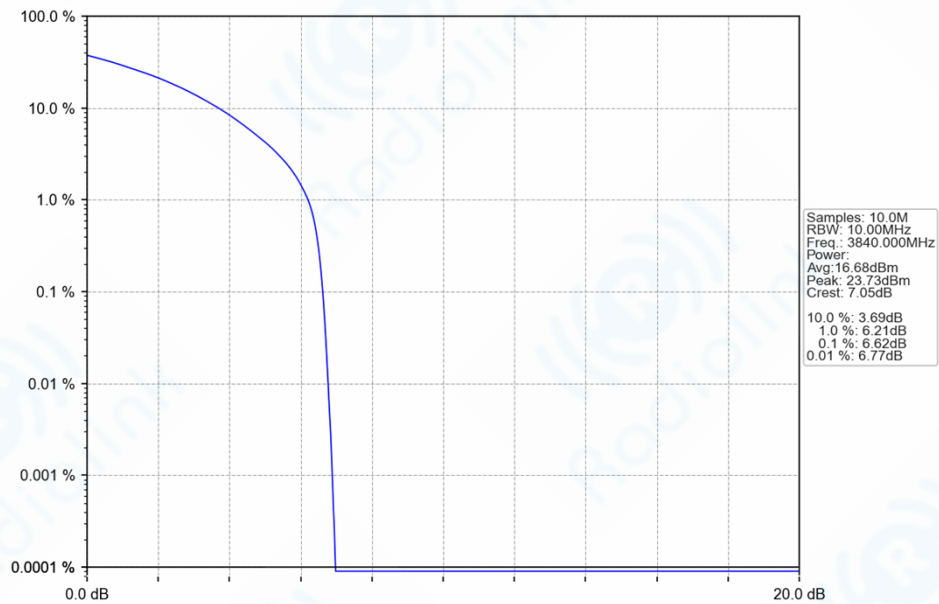


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_16_QAM_3975MHz_Outer_Full_Ant1

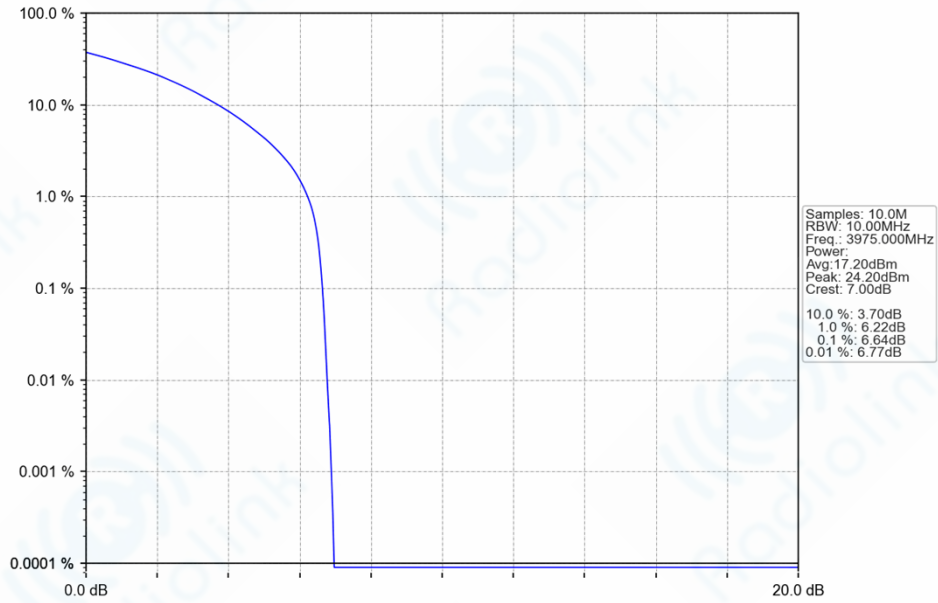

n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_64_QAM_3705MHz_Outer_Full_Ant1

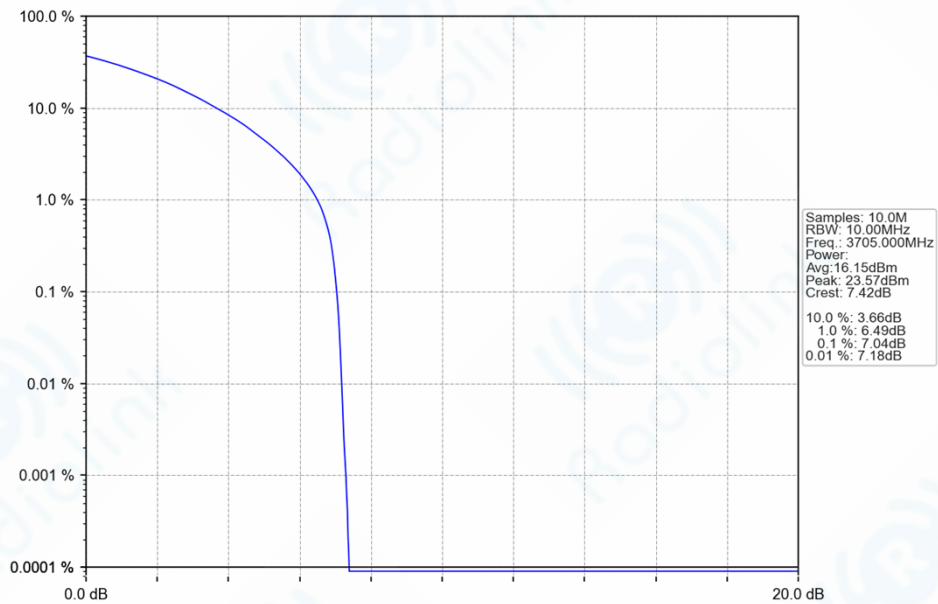


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_64_QAM_3840MHz_Outer_Full_Ant1

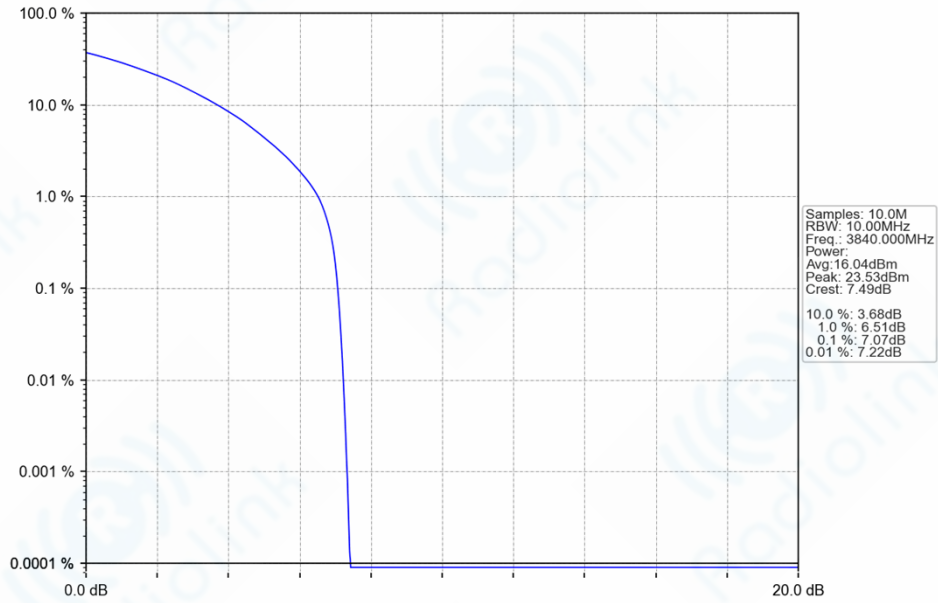


n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_64_QAM_3975MHz_Outer_Full_Ant1

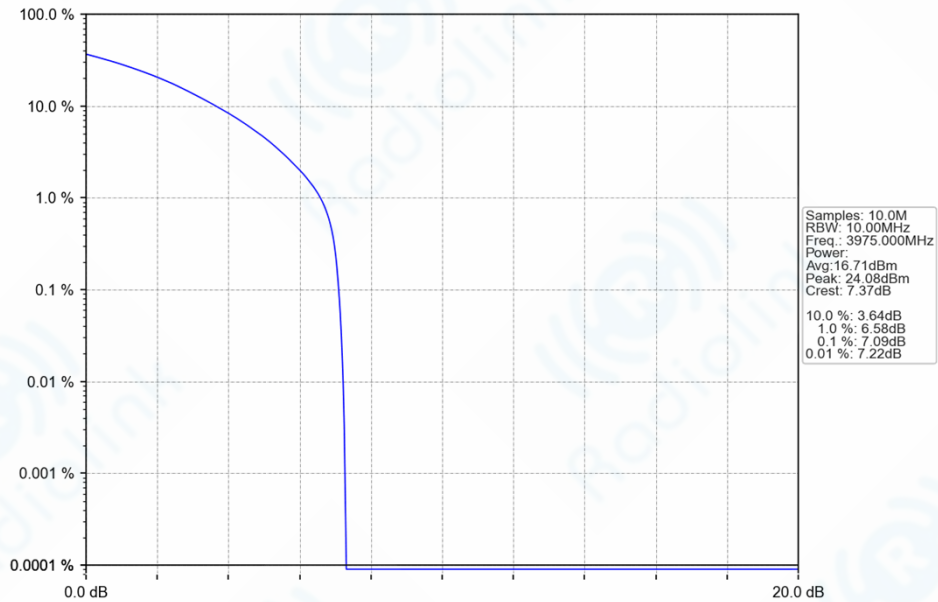

n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_256_QAM_3705MHz_Outer_Full_Ant1

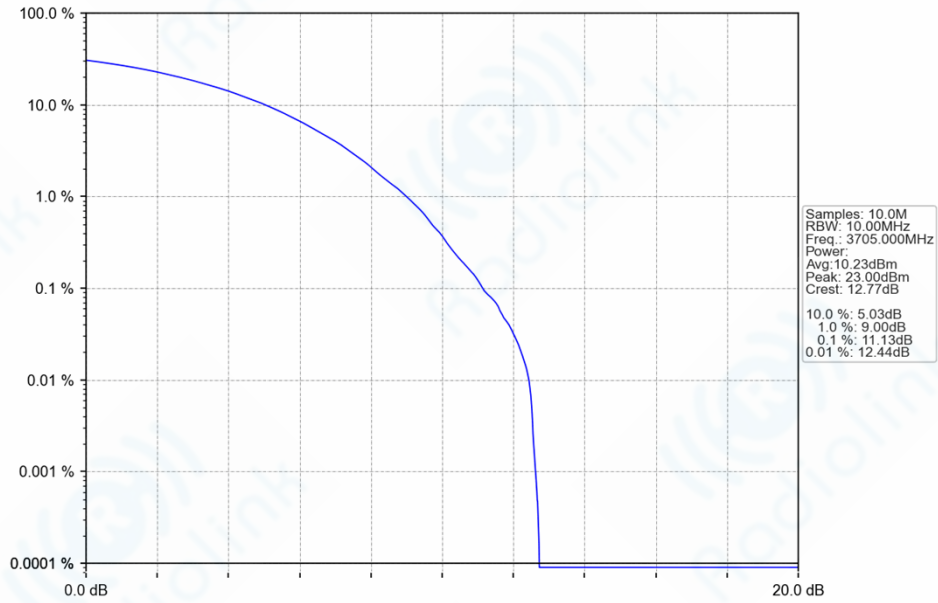


n77a_30kHz_SISO_NTNV_10MHz_CP-OFDM_256_QAM_3840MHz_Outer_Full_Ant1

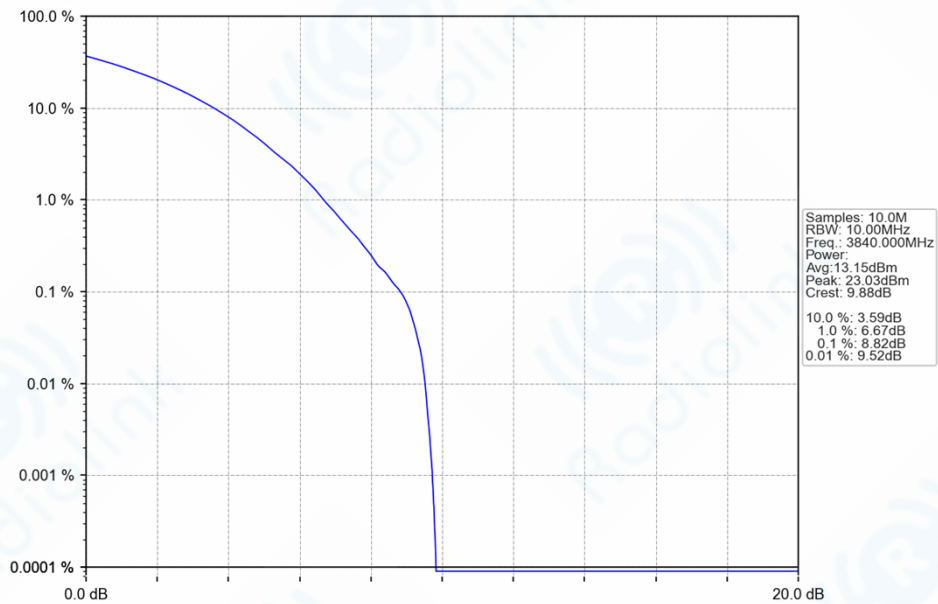
Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China


Tel: +86 0755 23080694

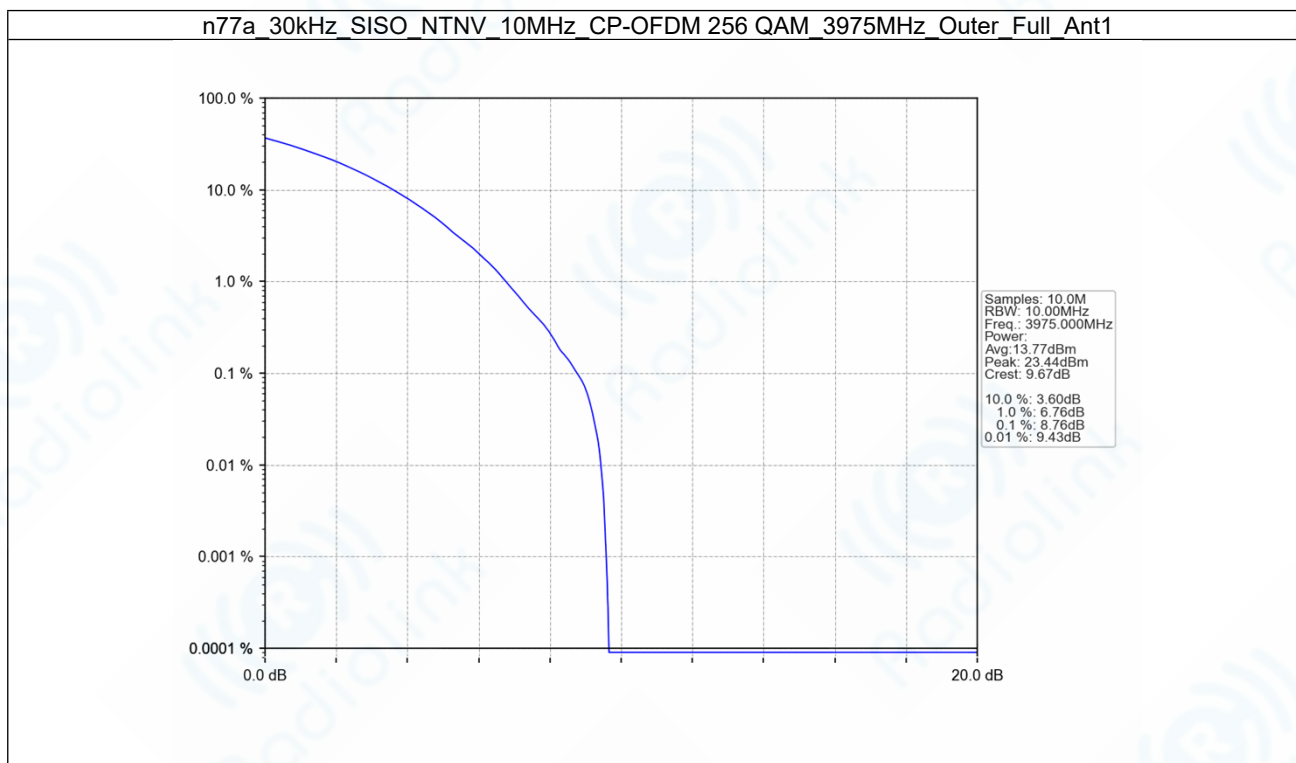


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


4.2.2 30_S_20M_NTNV

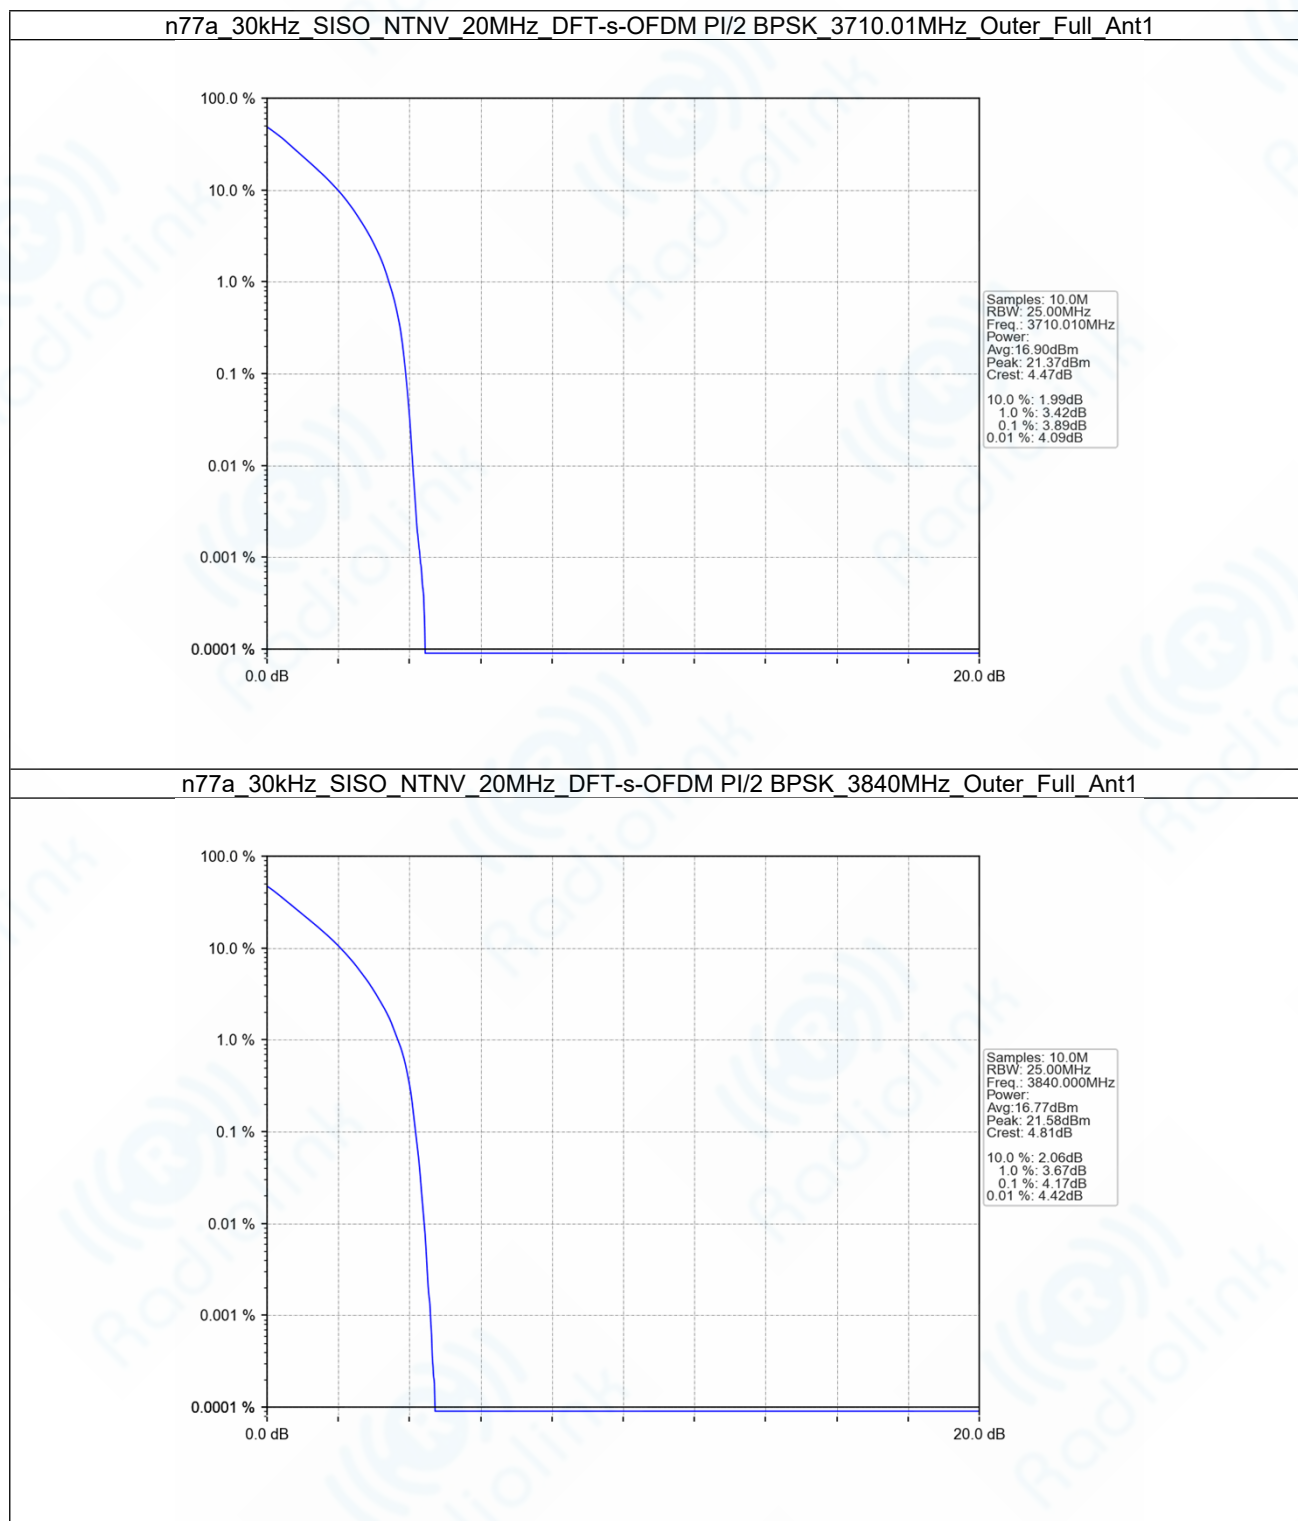

n77a_30kHz_SISO_NTNV_20MHz_DFT-s-OFDM_PI/2_BPSK_3969.99MHz_Outer_Full_Ant1

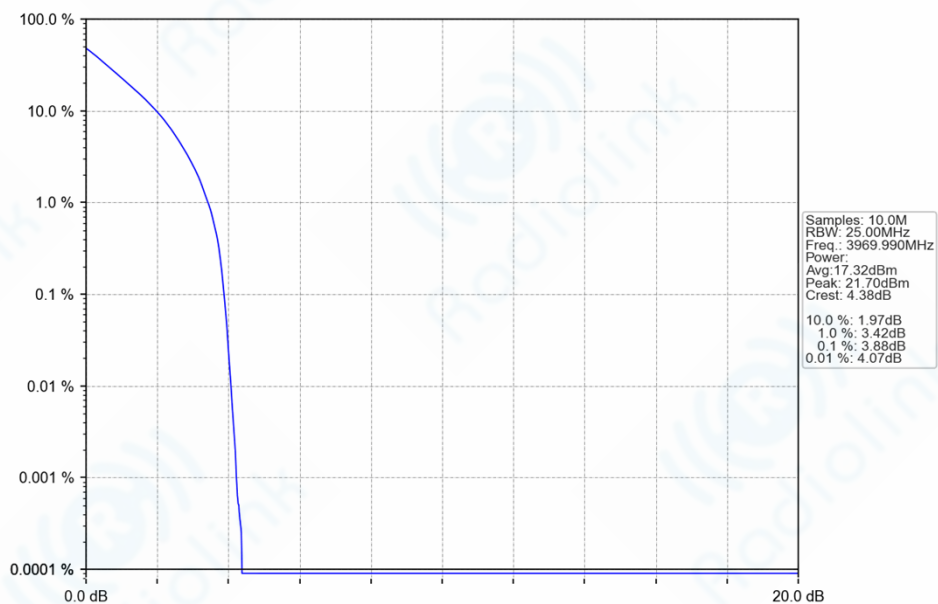


n77a_30kHz_SISO_NTNV_20MHz_DFT-s-OFDM_QPSK_3710.01MHz_Outer_Full_Ant1

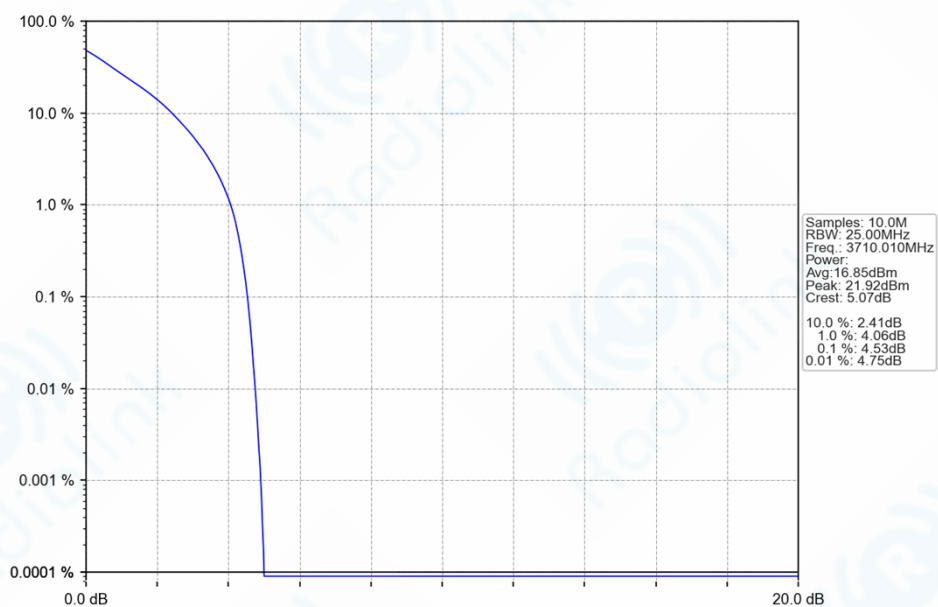


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

n77a_30kHz_SISO_NTNV_20MHz_DFT-s-OFDM_QPSK_3840MHz_Outer_Full_Ant1

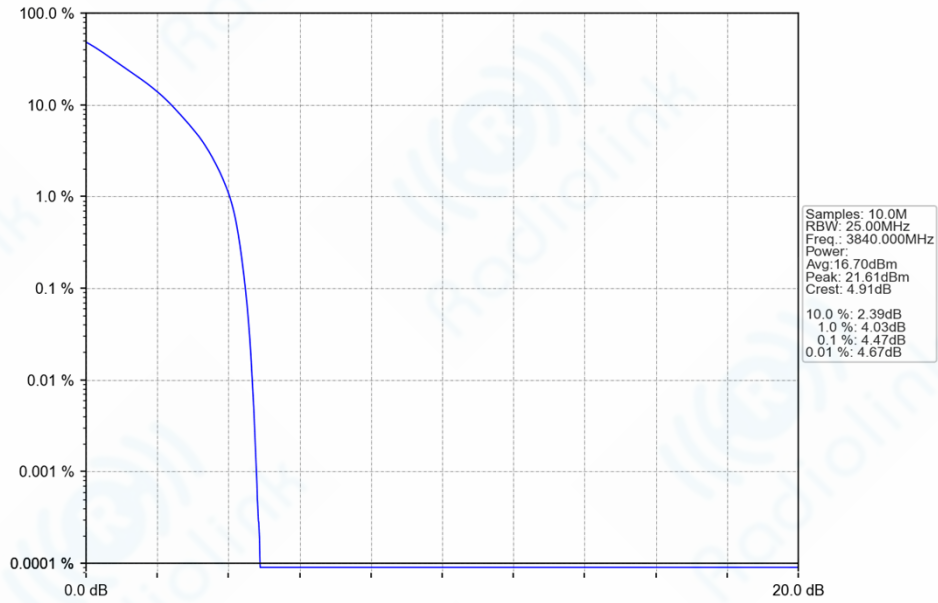

n77a_30kHz_SISO_NTNV_20MHz_DFT-s-OFDM_QPSK_3969.99MHz_Outer_Full_Ant1

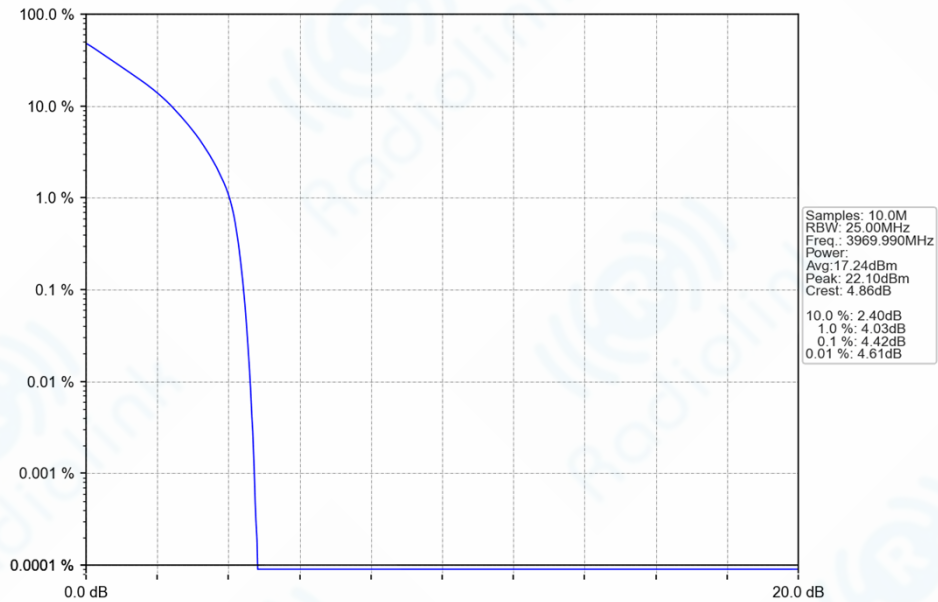


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

n77a_30kHz_SISO_NTNV_20MHz_DFT-s-OFDM_16_QAM_3710.01MHz_Outer_Full_Ant1

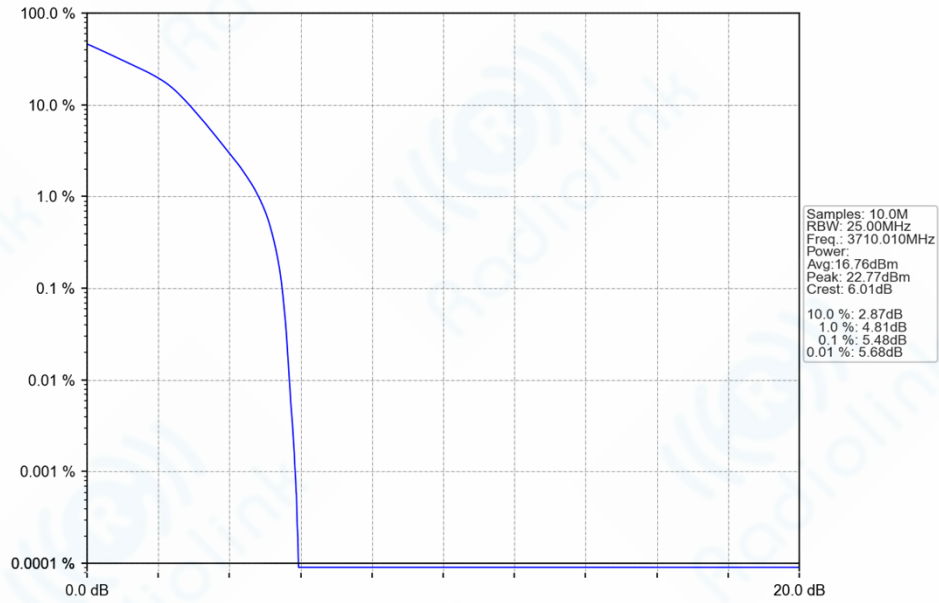


n77a_30kHz_SISO_NTNV_20MHz_DFT-s-OFDM_16_QAM_3840MHz_Outer_Full_Ant1

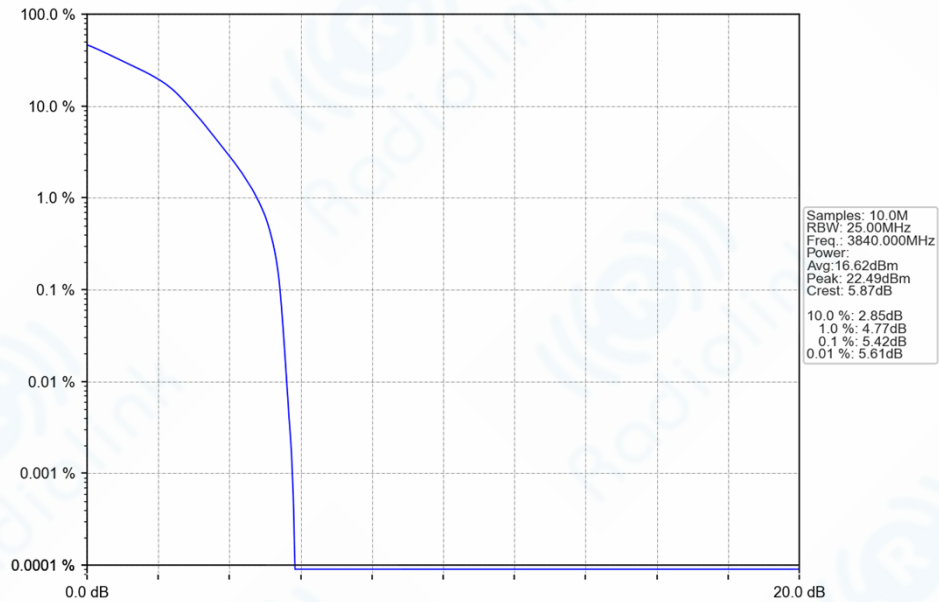


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

n77a_30kHz_SISO_NTNV_20MHz_DFT-s-OFDM_16_QAM_3969.99MHz_Outer_Full_Ant1

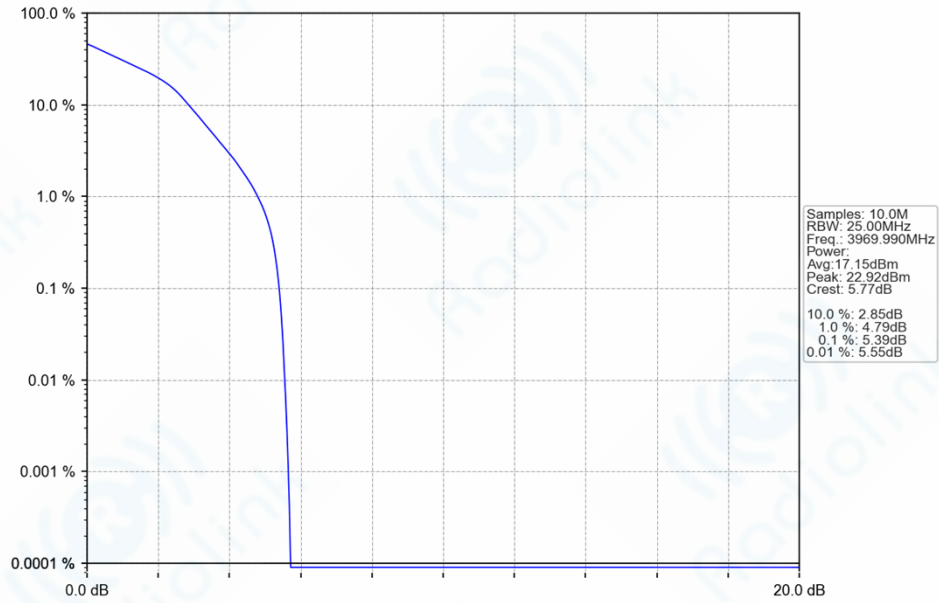

n77a_30kHz_SISO_NTNV_20MHz_DFT-s-OFDM_64_QAM_3710.01MHz_Outer_Full_Ant1

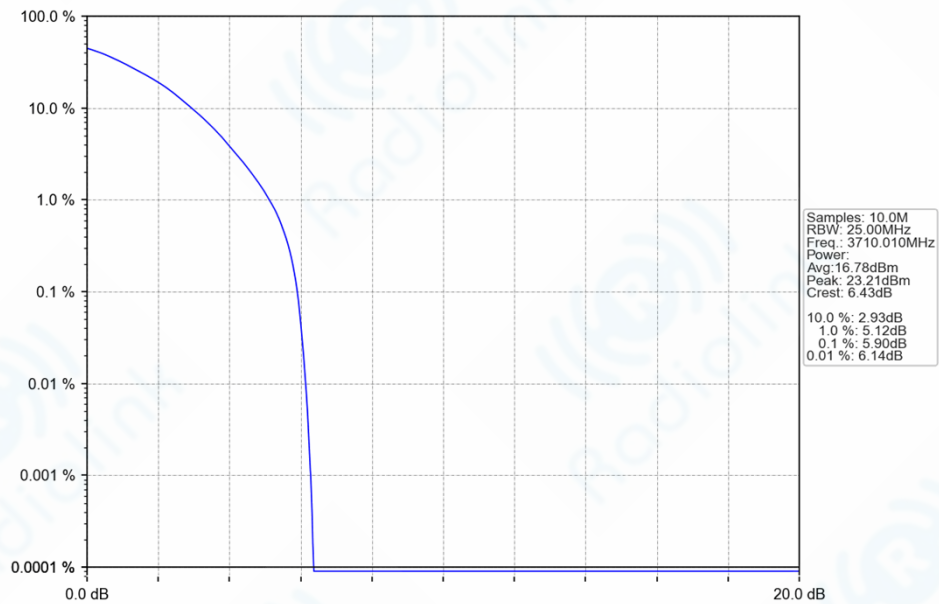

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694