



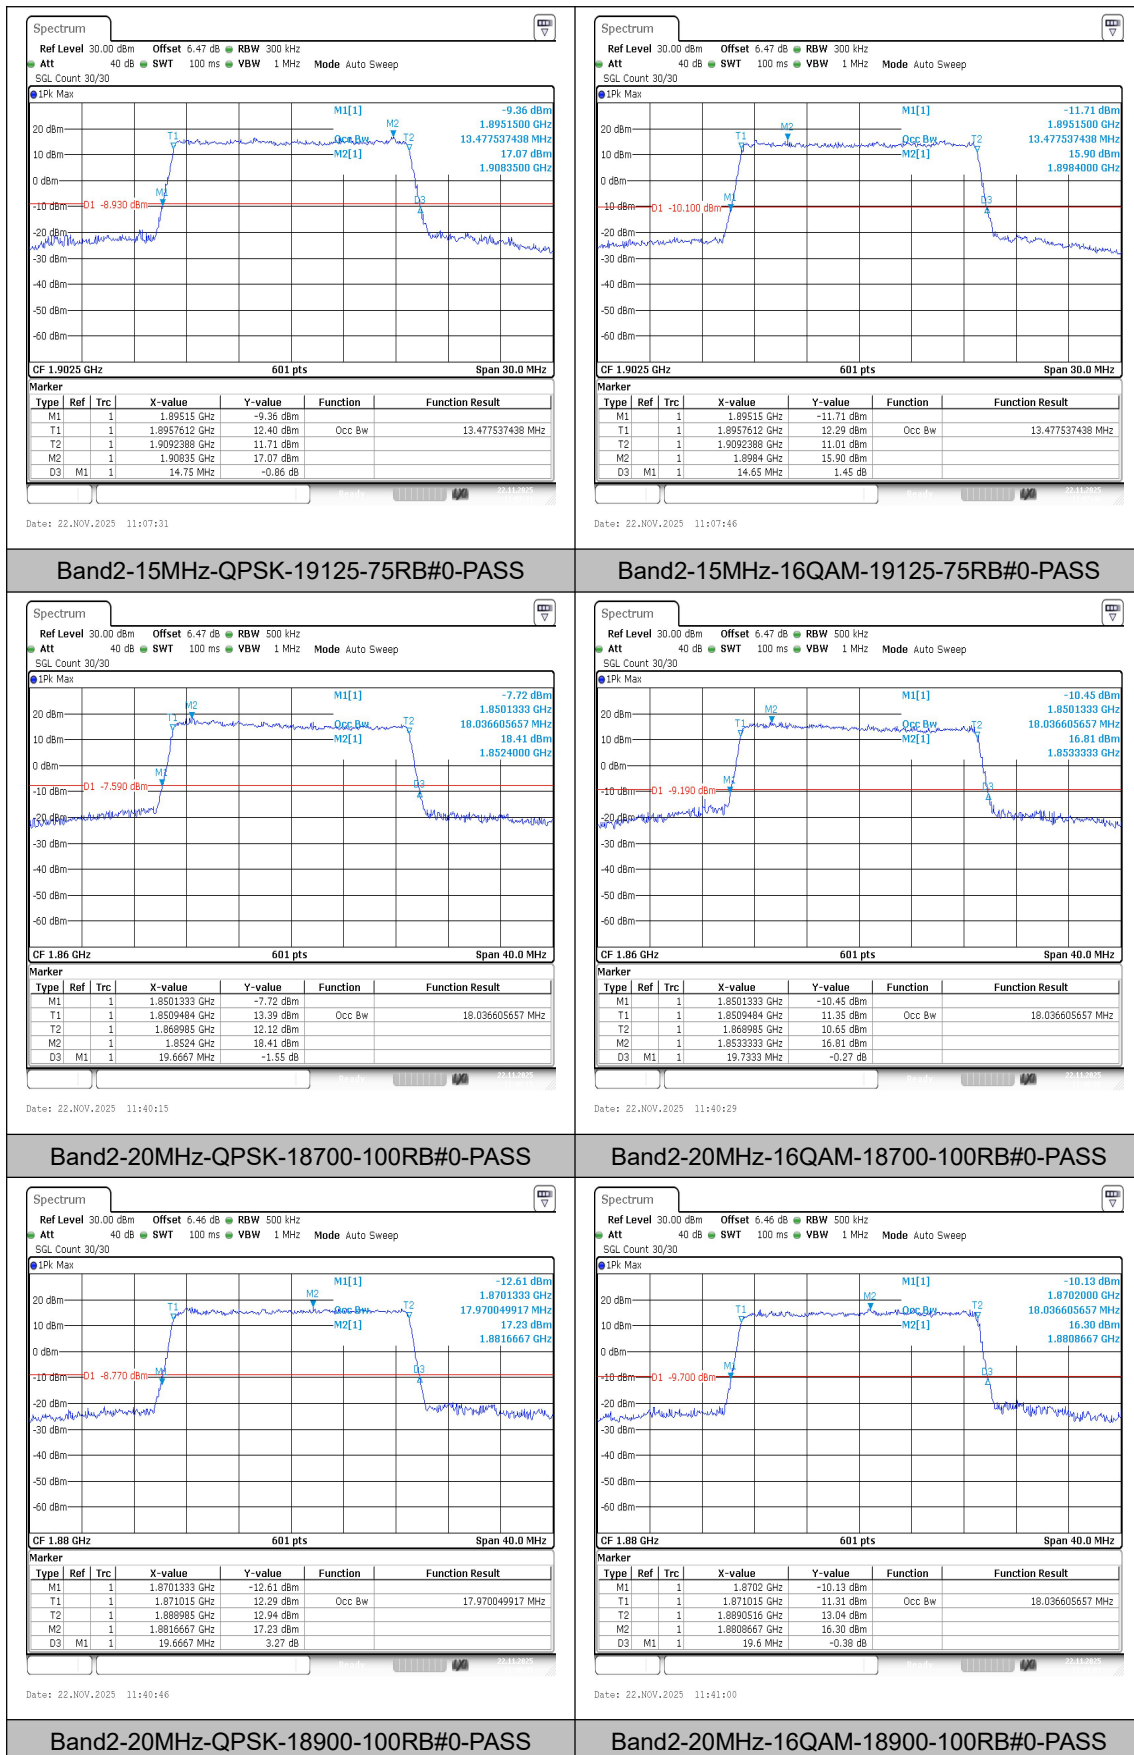

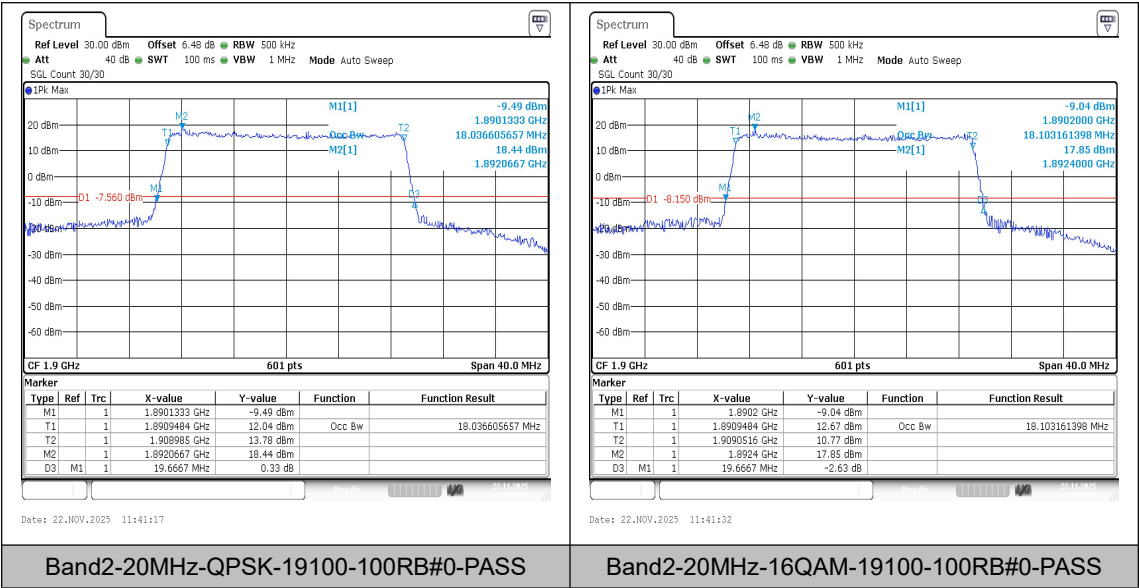

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-25.30	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	-37.17	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-32.55	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-26.54	PASS
Band2	1.4MHz	16QAM	18607	1RB#5	-39.31	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-33.23	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	-36.84	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-24.64	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-31.70	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	-38.88	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-24.60	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-31.88	PASS
Band2	3MHz	QPSK	18615	1RB#0	-22.94	PASS
Band2	3MHz	QPSK	18615	1RB#14	-47.59	PASS
Band2	3MHz	QPSK	18615	15RB#0	-33.06	PASS
Band2	3MHz	16QAM	18615	1RB#0	-23.81	PASS
Band2	3MHz	16QAM	18615	1RB#14	-48.27	PASS
Band2	3MHz	16QAM	18615	15RB#0	-34.88	PASS
Band2	3MHz	QPSK	19185	1RB#0	-49.14	PASS
Band2	3MHz	QPSK	19185	1RB#14	-21.67	PASS
Band2	3MHz	QPSK	19185	15RB#0	-33.53	PASS
Band2	3MHz	16QAM	19185	1RB#0	-49.74	PASS
Band2	3MHz	16QAM	19185	1RB#14	-21.98	PASS
Band2	3MHz	16QAM	19185	15RB#0	-34.18	PASS
Band2	5MHz	QPSK	18625	1RB#0	-21.51	PASS
Band2	5MHz	QPSK	18625	1RB#24	-48.92	PASS
Band2	5MHz	QPSK	18625	25RB#0	-32.29	PASS
Band2	5MHz	16QAM	18625	1RB#0	-22.07	PASS
Band2	5MHz	16QAM	18625	1RB#24	-48.76	PASS
Band2	5MHz	16QAM	18625	25RB#0	-34.09	PASS
Band2	5MHz	QPSK	19175	1RB#0	-48.62	PASS
Band2	5MHz	QPSK	19175	1RB#24	-20.39	PASS
Band2	5MHz	QPSK	19175	25RB#0	-32.28	PASS
Band2	5MHz	16QAM	19175	1RB#0	-48.69	PASS
Band2	5MHz	16QAM	19175	1RB#24	-21.89	PASS
Band2	5MHz	16QAM	19175	25RB#0	-32.97	PASS
Band2	10MHz	QPSK	18650	1RB#0	-24.14	PASS

Waltek Testing Group (Shenzhen) Co., Ltd.

[Http://www.waltek.com.cn](http://www.waltek.com.cn)

Band2	10MHz	QPSK	18650	1RB#49	-47.01	PASS
Band2	10MHz	QPSK	18650	50RB#0	-33.36	PASS
Band2	10MHz	16QAM	18650	1RB#0	-24.77	PASS
Band2	10MHz	16QAM	18650	1RB#49	-47.18	PASS
Band2	10MHz	16QAM	18650	50RB#0	-35.16	PASS
Band2	10MHz	QPSK	19150	1RB#0	-46.91	PASS
Band2	10MHz	QPSK	19150	1RB#49	-22.92	PASS
Band2	10MHz	QPSK	19150	50RB#0	-33.07	PASS
Band2	10MHz	16QAM	19150	1RB#0	-47.11	PASS
Band2	10MHz	16QAM	19150	1RB#49	-22.85	PASS
Band2	10MHz	16QAM	19150	50RB#0	-33.82	PASS
Band2	15MHz	QPSK	18675	1RB#0	-24.96	PASS
Band2	15MHz	QPSK	18675	1RB#74	-47.28	PASS
Band2	15MHz	QPSK	18675	75RB#0	-31.93	PASS
Band2	15MHz	16QAM	18675	1RB#0	-25.17	PASS
Band2	15MHz	16QAM	18675	1RB#74	-47.43	PASS
Band2	15MHz	16QAM	18675	75RB#0	-35.11	PASS
Band2	15MHz	QPSK	19125	1RB#0	-48.25	PASS
Band2	15MHz	QPSK	19125	1RB#74	-25.25	PASS
Band2	15MHz	QPSK	19125	75RB#0	-33.08	PASS
Band2	15MHz	16QAM	19125	1RB#0	-48.35	PASS
Band2	15MHz	16QAM	19125	1RB#74	-25.70	PASS
Band2	15MHz	16QAM	19125	75RB#0	-34.12	PASS
Band2	20MHz	QPSK	18700	1RB#0	-27.54	PASS
Band2	20MHz	QPSK	18700	1RB#99	-46.26	PASS
Band2	20MHz	QPSK	18700	100RB#0	-34.37	PASS
Band2	20MHz	16QAM	18700	1RB#0	-27.91	PASS
Band2	20MHz	16QAM	18700	1RB#99	-46.33	PASS
Band2	20MHz	16QAM	18700	100RB#0	-35.86	PASS
Band2	20MHz	QPSK	19100	1RB#0	-47.87	PASS
Band2	20MHz	QPSK	19100	1RB#99	-27.29	PASS
Band2	20MHz	QPSK	19100	100RB#0	-34.14	PASS
Band2	20MHz	16QAM	19100	1RB#0	-47.97	PASS
Band2	20MHz	16QAM	19100	1RB#99	-28.00	PASS
Band2	20MHz	16QAM	19100	100RB#0	-34.52	PASS

Test Graphs

